US GoM	
DSWO	
Diving Safet	y

DSWG Industry Incident & Near Miss Record

WORK GROUP			T	T	•			
						Topside/ Method	Depth of	
DSWG Meeting				Actual Incident		of Diving/Other	Dive -	
Date	Location	Occurrence Type	Injury or Damage	Rating	Primary Cause of Incident	Location	Feet	Description of Incident
		Non-Diving	None None		Diving Equipment	Saturation	Feet	While underway to a shallow water SAT job, the divers were being pressed, and the bell was being pressed with the system. During his normal outside pre-dive checks on the bell, the standby diver noticed an audible leaking sound and discovered that there were champagne bubbles leaking at the 6 o'clock position of one of the bell viewport windows. He informed the SAT techs, and upon further investigation it was discovered that all 4 ports had champagne bubbles, indicating pressure boundary failure. The bell was then vented to the surface for immediate repairs. It was determined that routine maintenance utilizing needle-guns for paint remediation had been performed about a month prior. The ports had not been removed during the remediation and the vibration of the needle-gunning had loosened the torque on the bolts and also affected the pressure distribution on the seal, which can cause leaks and even system failure. Updated maintenance protocols will require that all ports be removed completely during maintenance using needle-guns, all retaining bolts will be retorqued to manufacturer's specification after maintenance and rechecked with recurring torque verifications every three months, and seals also inspected, prior to use. Divers were doing decommissioning work on a platform, drilling holes for lifting points. When the drill was removed from the hole, the edge of the drill caught on the broken conductor and shifted the conductor, which then rolled down a VD, (vertical diagonal) which captured the diver's hose, and caught it in the crotch of the VD. The diver's hose was trapped, which restricted the diver's ability to return to surface, but was not pinched as to compromise his breathing air. Crew used one of the
								platform tuggers to shift the conductor out of the way and clear the diver's hose. Dive contractor is
								adding training for utilization of tools, aids, magnets, tile points that can be broken loose, and other
9/17/2025	GoM	Diving	None	Near Miss	Diving Equipment	Air Diving	15	safety devices that can be clipped off and are non-permanent to hose placement/position awareness training. These are particularly important for lifting procedures and hose management.
9/17/2025		Non-Diving	None	Near Miss	Environment	Air Diving		A contamination crew working on a refinery in the heat of the day were preparing to dive, when the supervisor made the call to stop work prior to starting the dive drills. The air was hot, the water was hot, and the decision was made to delay the dive until cooler temperatures would be in effect the next morning. Good decision making helped avoid the potential of overheated divers.
9/17/2025	GoM	Diving	None	Near Miss	Diving Equipment	Air Diving	45	A sudden loss of breathing air pressure occurred on a diver's regulator after 2 hours in the water. Diver went on his bailout bottle thinking he was out of air, but still was unable to breathe from the regulator. The dive supervisor advised him that the air pressure in his hose was fine and to try his free flow knob on his helmet. This restored breathing air to the diver, who then safely resurfaced. During the root cause analysis of the dive helmet, it was determined that the Kirby Morgan 455 regulator's plastic bearing retainer clip that attaches to the balance tube had failed. The helmet had been rebuilt 4 months prior and also passed routine inspection 7 days before, and this was the second dive of the day on this hat. The dive hat has been sent back for a thorough investigation. Be aware of the potential for failure of these clips, and inspect them pre-dive until the manufacturer can determine the root cause of the malfunction and create a viable solution. Pre-dive safety and training is crucial. When the manufacturer publishes an explanation and/or a solution, they will update the DSWG.
								A diver hand-jetting in a 15' deep ditch in 7' of water encountered a cave-in when a section of the
9/17/2025	Inland	Diving	None	Near Miss	Environment	Air Diving	7	ditch wall was undercut. All deep-ditch safety protocols were in place. The standby diver was jumped to assist the trapped diver. The main diver was recovered to surface within 9 minutes of the start of the incident.
9/17/2025	GoM	Diving	Illness	Recordable Incident	Personnel	Air Diving	111	Diver was diving No-D on a 120/15 table. After returning to surface, appromixately 10 minutes post-dive he experienced Type 2 symptoms and was treated on an air Navy Table 6. Diver got relief before reaching depth on the prescribed table. Diver is expected to make a full recovery.

		Ι					A friction crane failure occurred when the whole boom came down on top of a container. Belief is
							that the boom cable/friction wire jumped out of the sheave somehow, and caused the entire boom
							to fall without even having a load on it. Further investigation is being done, as the crane had
							functioned properly with a load the day before. Where the sheave is located is difficult to access for
							inspections. Better/more comprehensive inspections for gear, conducted in unmanned areas are
9/17/2025	Office/Warehouse	Non-Diving	Facility Damage	Property Damage	Other Equipment	Office/Warehouse	being researched.
							In a refinery, a spark went into a sump with explosive fluids. 4 people were injured in the resulting
							explosion, one being 75% burned. There is a big influx of 3rd party contractors going into big refinery
							operations, being told that production is the goal, to the detriment of safety meetings, orientations,
7/16/2025	Inland	Non-Diving	Multiple Injuries/Victims	Recordable Incident	Other Fauinment	Office/Warehouse	site and facility familiarization and safety teaching processes.
1, 10, 101			manapie mjanies, ricems	necon dazie incident	o the Equipment	o mee, iranemase	site and resimily reminer zeriory teasining processes.
							While diving inside a concrete structure, the diver had penetrated into an adjacent vault to replace a
							section of 1.5" diameter stainless steel flex hose. The flex hose went to an air burst system designed
							to stir up sand and silt on the bottom and unblock the screens. Facility had been toured twice, and all
							compressors were believed to be LOTO. There was an unknown third much larger air compressor in a
							building across the street about 200 yards away, which was triggered by the diver being in the water.
							It released 80psi for a few seconds near the diver, who was recovered to the surface without
							incident. Processes are being revised for identifying sources of power on the worksite. Client later
							confirmed that the previous diving contractor had wanted that compressor left hot to check for
7/16/2025	Inland	Diving	None	Near Miss	Other Equipment	Air Diving	leaks. None of this had been mentioned in the pre-job meetings.
							A small gasoline generator fire occurred during routine troubleshooting for unknown stop and start
							issues. The air filter was cleaned, plug was pulled, and when started back up after cleaning it burped,
							causing a small burst of fire out of the intake side. No damage was caused. Investigation determined
							that when the generator was serviced the previous day, they had overfilled the oil a little. That was
7/16/2025	GoM	Non-Diving	None	Near Miss	Personnel	Topside	causing the shutdown that led to the troubleshooting, which led to the small fire.
							On a dive boat, a topside maintenance technician was climbing down from the depth of the daughter
							craft using the guide liner to access the deck of the boat instead of the proper umbilical, and the
							guide liner stops short of the deck at an awkward angle. The worker slipped and fell about 4' and hit
							his hip, requiring stitches. Use the proper tool, the guide liner was not adequate or what he was
7/16/2025	GoM	Non-Diving	Head Injury	Recordable Incident	Other Equipment	Topside	supposed to be using for his descent.
							During an inland project, the customer brought 2 reps out for inspections. While they were out on
							deck, one was stung by a wasp. He was unaware he had an allergy and went into anaphylactic shock.
							A diver on the project had 3 Epipens for his own allergies; 911 was called, the inhouse medical rep
							instructed them to use one for the sting victim, and he was transported to the hospital and
7/16/2025	Inland	Non-Diving	Illness	Recordable Incident	Environment	Topside	recovered. Always make sure you have Epipens on board and know where they are.
							A snap shackle came apart while the diver was water blasting a vertical diagonal member during
7/16/2025	Pacific Ocean	Diving	None	Near Miss	Other Equipment	Air Diving	marine growth cleaning. Upon investigation, it was discovered that the bolt from the swivel ball had unthreaded from the body. Always double check shackles and give them a big tug before use.
7/10/2025	r acinc Ocean	DIAILIR	INOTIC	iveal iviiss	Other Equipment	IVII DIAILIR	and reduced from the body. Always addible check strackles and give them a big tug before use.
							Performing a requested inspection and cleaning work at a freshwater storage facility that was built in
							the 1950s, client had advised that LOTO of the discharge was nearly impossible, so the decision was
							made to perform the inspection robotically. On the 2nd day, the floor was being cleaned behind the
							intake when the 36" diameter intake went live and sucked in part of the control tether and discharge
							hose of the ROV. A meeting with the client confirmed that there was no way to isolate the intake and
							perform the LOTO due to its going directly to the city water. Second ROV was used to recover the
							hose with no damage to equipment. Client informed contractor that the same work had been
							performed with divers 3 years prior, and it was discussed how differently it could have gone had they
E /24 /202=	Inland	Nan District	Name	Naan Mirr	Other Facilities :	Other	tried to use divers on this project as well. Work inside of tanks and power plants can be extremely
5/21/2025	iniand	Non-Diving	None	Near Miss	Other Equipment	Other	dangerous.

					1			,
								On a platform abandonment job, an incident happened on a 4pt anchor boat in 70' of water. On the
								back deck there is a tugger that's midship that is utilized for PL abandonments. Diver was rigging a
								2x2 20' nylon strap to a piece of debris on bottom and was coming up on the10k tugger, but wanted
								to stop and inspect the rigging because there was movement on the bottom. When he went back to
								check the rigging, the vessel surged in 2-3' seas and he got tension on the tugger that caused the
								grating to bend as the diver was feeling his way along to check the rigging. When the vessel surged
								and the grating bent, it caught his finger and pinched the end of his finger. Topside was informed and
								diver was brought up and put in the chamber. He was treated on deck and was all right because he
								had his impact gloves on. Upon investigation it was determined that location and equipment
								condition, combined with a less experienced and younger diver was the root cause. When the All
								Stop was called on the tugger, he didn't have enough slack in there to account for potential surge.
								Maintain situational awareness, especially in zero visibility, and always be aware of potential surge
								of the vessel, even in fairly calm seas. Proper hand placement, marking on cables and tuggers, clear
								communication, inwater taglines, inspecting all objects to be lifted, ensure divers are out of the way
								before lifting anything, divers are not to put extremities between objects and must be aware of
								vessel and wave actions, Supervisor or rack operator should communicate to the diver to be aware
								of fingers, toes and hose before lifting anything. All of these are crucial to safety. Nylon web straps
5/21/2025	GoM	Diving	Hand Injury	Recordable Incident	Personnel	Air Diving		will also stretch before they will break.
		-				-		Two SCUBA deaths occurred in Minnesota from 2022 to 2024. People were diving SCUBA in 8' to 10'
								ponds doing weed removal work. Neither worker was certified in SCUBA, and were put into ponds to
								remove weeds in season. New regulations in MN require them to be certified in SCUBA or whatever
5/21/2025	Inland	Diving	Multiple Fatality	Fatality	Personnel	SCUBA	10	diving method is to be used.
								A worker was working on some hydraulics on a hydraulic ramp. He started working on the system,
								pulling on a 1" plug that shot out and hit one worker in the hard hat. Nobody was seriously injured,
5/21/2025	Inland	Non-Diving	None	Near Miss	Personnel	Other		but there was potential for fatalities in this incident.
								DEC (a bala in the control of the bound) in tile of control of the character of the charact
								PFO (a hole in the center of the heart) incident occurred when a person was in the chamber for a No-
								D dive, and later experienced neurological symptoms in his arm. He was treated successfully inhouse with dive doctors advising. He went on to be tested and confirmed that he did have a PFO. He
								had the surgery to correct it, passed the medical tests for a successful repair, and carried on with
								diving employment. Some time later the worker was at a gym doing breath hold exercises alone and
								apparently had a heart palpitation, hit the ground and died. Possibly the PFO procedure wasn't as
								successful as believed, and injuries and problems can present again later. Breath holding exercises
5/21/2025	Inland	Non-Diving	Single Fatality	Fatality		Other		should be performed with a partner because the danger of blacking out is always there.
5,22,252				, , , , , , , , , , , , , , , , , , , ,				
								While hooking up a 480v electric compressor at the shop, utilization of an extension cord was
								required. When an employee plugged in the extension cord to the main compressor cord, it caused
								the extension cord at the receptacle on the shop wall to short out, which then tripped the breaker. It
								was later determined that the compressor panel was in the ON position and the extension cord was
								energized. Immediately preceding this incident, the compressor had been hooked up and the
1								workers had noticed the rotation was wrong so they shut it off, disconnected it from the extension
								cord, and flipped the wires to correct the rotation. When the hook-up process was begun again, the
						_		compressor was already energized and shorted out at the wall plug instead of the employee. The
5/21/2025	GoM	Non-Diving	Equipment Damage	Near Miss	Personnel	Office/Warehouse		employee was not injured, and more training is being looked into for newer employees.
								An event occurred on a twin outhoard dock host that saveed 3 fatalities and critically injured another
								An event occurred on a twin outboard deck boat that caused 2 fatalities and critically injured another employee. They were preparing to leave the dock to work on a remediation project for wetlands, and
1								it's believed there was an internal combustion. There was a concussive explosion and 2 workers were
5/21/2025	Inland	Non-Diving	Multiple Fatality	Fatality	Other Equipment	Topside		killed with a third critically injured. This incident is still under investigation.
3/21/2023	manu	INOII-DIVIIIE	ividicipie i atality	ratanty	other Equipment	ιομοιας		Diver was hand-jetting in a 3' ditch, and when he returned to deck a coworker noticed he had a barb
								from a stingray that had gone through his neckdam. Diver was unaware and was not hurt. Very close
								call, and a reminder to be very aware of environmental hazards when diving, especially in zero
5/21/2025			None	Near Miss	Environment	Air Diving		visibility.
-,,	GoM	Diving	None					,
l i	GoM	Diving	None	Near Wilss				l l
	GoM	Diving	None	ivedi iviiss				A safety worker misjudged the distance for a swing rope transfer to a platform and fell into the
	GoM	Diving	None	real Miss				A safety worker misjudged the distance for a swing rope transfer to a platform and fell into the water. He wasn't injured. There have also been instances of not only ropes, but the hardware being
3/19/2025		Diving Non-Diving	None	Nedi Wilso				, , , , , , , , , , , , , , , , , , , ,

		ı	Т	1	T	1	
3/19/2025		Diving Non-Diving	None	Near Miss Near Miss	Diving Equipment Environment	Saturation	Hose fitting failure - fittings hadn't been properly swedged, and the hose hadn't been fully engaged in the fitting even though it passed the pressure test. All fittings were quarantined and sent back for further inspection. Upon return to and investigation by the manufacturer, it was discovered that the marking on the inner tube indicated it was only partially inserted and only a single spigot of the barb had been engaged. It was determined that even a partially inserted hose should hold in a pressure test, but once subjected to working conditions, it produced a complete failure. Decision was made to remediate all of those types of fittings and all were replaced. Procedures and best practices were reviewed and updated to stress proper procedures for connecting and crimping the hose. During trawling snag operations, a gas tank was recovered in the trawl snag net. The tank was brought in to the dock and dropped off with other debris where it was left unattended for some time until it was discovered that there were still unknown gas contents in the tank. It was disposed of accordingly by the dock.
3/19/2023	GOIVI	מחואות-חטאו	None	inear iviiss	Environment	Topside	accordingly by the dock.
3/19/2025 3/19/2025		Non-Diving Diving	None None	Near Miss	Other Equipment Environment	Topside	During a non-diving operation, a flex hose failed on the operator, as well as the tether. The flex line was a 3/8" hose. It was later determined that they had crimped the wrong fitting on the hose. Stand down was called on a pipeline remediation/caisson setting project after the pipeline mastic coating was recovered to deck. All stop was called and asbestos remediation services were called in to address the issue. No injuries or sickness. Many pipelines installed prior to 1980 contain asbestos. Here's the UK guidance from the HSE re asbestos on offshore installations HSE Offshore: Asbestos offshore
3/19/2025	GoM	Diving	Rash	First Aid	Diving Equipment	Air Diving	Skin bends occurred just above the waist belt that didn't progress. Diver noted slight marbling left of his umbilical and some swelling, noticeable only to him. Some itching was noted at the site and diver said his hot water unit was too hot. Doctor was called and the recommended treatment was applied with good result; symptoms were gone by the time decompression was finished. Skin bends are now supposed to be treated per medical advice and protocols. Massive amounts of Manta Ray are being sighted in the waters off Angola and are disrupting diving operations. Investigations are being done to try to determine why they're straying from their usual
1/15/2025	International TBD	Diving	None	Near Miss	Environment	Saturation	450 habitats and routines.
1/15/2025		Non-Diving	Head Injury	Recordable Incident	Operational Control	Topside	Decommissioning diving operations were being conducted on an FPSO. Divers were disconnecting at the midwater towers prior to disconnecting everything up topside. LOTO had been done, but due to various reasons, they got out of sequence. The divers were released and the next day the topside crew went to disconnect topside. The ones disconnected by divers were at about 150M, and when topside disconnected, unexpected pressure was released and the ring blew off and hit one worker in the head, requiring six stitches. Investigation revealed that the temperature change had increased the pressure on the topside clamp, and the LOTO process was 85 pages long and too confusing for reasonable use and understanding. That has been streamlined and made more user friendly for both divers and topside crews. It wasn't an issue for the divers, but the topside crew ended up having unexpected pressure buildup.
1/15/2025	GoM	Diving	Chemical Exposure	First Aid	Operational Control	Saturation	A saturation diver was diving on a pipeline during decommissioning and pigging operations and some chemically treated seawater leaked out, burning the skin on his neck and forearm. The incident occurred on a bell run to disconnect a pigging and flushing hose. The diver noted discomfort when the contents of the line hit him and was recalled back to the bell. Once at the bell the affected areas were cleaned with mild soap and cool water, and the suit and gear were removed and stored outside of the bell. The bell run was terminated and divers returned for monitoring and cleaning and treatment with burn cream. Light scabbing and blistering appeared, and the diver medic diagnosed 1st degree chemical burns to the neck and 2nd degree chemical burns to both forearms of the diver. Upon investigation there was lack of communication as to whether or not the line being handled by the divers had been flushed, and there were no engineered barriers in place to prevent divers coming in contact with the chemicals. Consequently there will be better communication and it will be made certain that lines being handled by divers have been flushed. Warnings will be issued for potential contents, barrier cream will be utilized, and steps will be taken to isolate and secure valves regardless of contents. Diver healed and was released back to work.

			Т	I	T	T	
11/13/2024		Non-Diving	Head Injury	Recordable Incident	Diving Equipment	Topside	While a technician was filling an HP Air bottle rack from an HP compressor, the standard brass fitting nipple that is inserted in the HP Air rack manifold king valve snapped off of the cross- fitting at the threads. The cross-fitting assembly, with valves and whips for the HP compressor, pressure guage, and bleed valve, did have a whip check installed. However, the whip check was still long enough for the cross assembly to hit the technician in the forehead, requiring 5 stitches. All fittings need to be checked for corrosion frequently.
, , ,			, ,		0 117 - 1	1 1	
11/13/2024		Non-Diving	Hand Injury	Recordable Incident	Diving Equipment	Topside	A technician was conducting maintenance on a Tescom regulator that was part of an HP Air Manifold inside the Chamber van. The technician failed to disconnect the whip from the external HP Air source removing all potential of trapped pressure and was relying on a single block valve that apparently did not hold or was not seated properly. During disassembly, the regulator came apart violently, breaking both of the technician's thumbs.
							A 3-man dive team (consisting of a Supervisor & 2 Tenders) was trying to do a 300' penetration dive in 15' of water, diving off a johnboat with surface supplied air. Diver 1 (Tender) dove off the boat first and his hose got caught, causing him to panic a little. The second tender was jumped to go and offer assistance, but Diver 1 (Tender 1) had freed himself and left the penetration. Both were recovered to surface, and both refused to go back in the water. They drug up and left the job,
11/13/2024	Inland	Diving	None	Near Miss	Personnel	Air Diving	15 nobody was harmed or injured.
9/18/2024	Inland	Non-Diving	Arm Injury	Recordable Incident	Personnel	Topside	Worker fell off a crane on a barge. The worker had mobility issues, but opted to climb up the crane instead of using the safety stairs, falling and breaking his arm. Utilize the safety measures that are available and necessary.
0 (10 (2001)							A diver was working on P&A on a gas line, that was supposedly not in service or used. Client wanted them to perform a pigging operation to the SS assembly. During the bell run on the pigging operation, the diver went out to disconnect the hose on the valve assembly. Diver expressed burning sensation on his forearms and neck. Back at the bell, still had discomfort, and a strong smell of petrochemicals was noted. Diver was removed and scrubbed down properly, with burn cream applied to affected areas. Some blistering was noted. After desat, he was sent to the doctor and treated and subsequently healed up. Treat every line as "hot" and take proper safety precautions such as barrier creams and a Tyvek suit if needed. Don't trust the client's word that a line is not hot
9/18/2024		Diving	Chemical Exposure	Recordable Incident	Environment	Saturation	or containing any hydrocarbons or petrochemicals.
9/18/2024		Diving	None Single Fatality	Near Miss Fatality	Personnel		Downed diver recovery drill was being performed at a dive school. Students got a little overzealous, and instead of using the harness or D-ring, they grabbed the diver by the arm. This almost pulled the arm out of the socket. Diver was bruised and had to sit out a couple of days, but had no lasting injury. Students must be properly trained and taught the right ways to perform tasks and recoveries. An explosion occurred while attending to a pipeline leak. Crew was waiting for distillates to clear out, when an airboat drove through the affected area, causing an explosion. More details are pending.
9/18/2024	Inland	Diving	Illness	Recordable Incident			DCS - type 1 elbow pain from 123' dive for 48 minutes, planning 3 repetitive groups diving at altitude. SURDO2 is not meant to be done at altitude. There was no compensation for the altitude taken into consideration for the SURDO2, and there were multiple contributing factors present that could have caused a DCS.
							Recreational vessels are encroaching into diving areas during fishing seasons. One jet hose was cut and Harbor Police had to find the vessel to flag them down. More information needs to be distributed publicly at fishing tournaments and gatherings to educate the public on recognizing diving operations and how to operate near them, and to avoid the area completely if possible. More/better communication with organizers of these events is needed, to possibly have them
9/18/2024	Inland	Diving	Equipment Damage	Near Miss	Public/Others	Air Diving	include commercial diving information in the initial paperwork for the event.
9/18/2024	Inland	Diving	None	Near Miss	Operational Control	Air Diving	A rack operator had to use the restroom, so asked standby diver to take over the rack. The main diver was jetting, and the ditch collapsed on him, so he asked for assistance. Standby diver told him that the rack operator had to come back before he could come help, so there was a delay in sending the standby diver down to assist the main diver. They didn't have enough personnel to fill all necessary positions without delay. Crews need to be manned properly for safety, and luckily no one was injured in this incident.
9/18/2024	International TBD	Diving	Single Fatality	Fatality	Diving Equipment		A diving school student's umbilical became pinched at 40 meters. Standby student diver was jumped and his band mask leaked, so he returned to surface, and eventually an instructor diver was jumped. 120 Original student was recovered to surface about 1.5 hours later, and he'd passed away.

		1	T		T	1	
9/18/2024	International TBD	Non-Diving	Arm Injury	Recordable Incident	Personnel	Topside	In a windmill operation, the crane operator was unavailable, so the contractor opted to ask their driver to operate the crane. Driver was not crane-qualified, but contractor believed his driving certifications were enough. Driver inadvertently jerked the crane with the man basket attached, throwing the rider out for a drop of 75'. Compound fractures of arm, broken hip, all broken ribs on his left side; numerous injuries were sustained. Be sure personnel are qualified to any position or role they are being asked to fill. Other industries are not necessarily up to the safety standards of the diving industry.
0/40/2024	C-M	Non Birina	Circle February	Estable:	Daman al	To maide	Single fatality, person was in the wrong place at the wrong time topside. Incident is under
9/18/2024	GOM	Non-Diving	Single Fatality	Fatality	Personnel	Topside	investigation, more details to come. In Nigeria, a worker was filling HP bottles from a compressor when the nipple broke off at the
9/18/2024	International TBD	Non-Diving	Head Injury	Recordable Incident	Other Equipment	Topside	stainless cross and struck the worker in the head. Five stitches were required. Contractor awaiting report on official cause of the failure.
	International TBD	Non-Diving	Hand Injury	Recordable Incident	Other Equipment	Topside	Contractor overseas was working maintenance on a chamber with two LP compressors and one HP inlet to a test comm valve. The seat of the valve before the test comm failed and caused the test comm to come apart and broke the man's two thumbs. This is still under investigation.
7/17/2024	International TBD	Diving	Single Fatality	Fatality			CUSH related diver death reported in Singapore - no further details given.
							Three man survey team working in a remote area on land - had to set up an extended antenna for radios to communicate between GPS stations. Antenna was set up taped to a pipeline pin, next to a power line. Crew was unaware of proximity to power lines. After survey, a short-service employee went to take down the antenna, which was duct taped. He cut the tape and the antenna came into contact with the power line. The current went through the employee's body and exited out his little toes, blowing pin holes in his steel-toed boots. He was rushed to hospital, they cleaned wounds and he had to have skin graft operations for the toe injuries. Everyone should be very mindful and
7/17/2024	Inland	Non-Diving	Leg Injury	Recordable Incident	Personnel	Other	careful working around any power and electrical sources.
							During a two diver operation using an inwater tending point while DP diving, Diver 1 had a loss of gas incident and went on bailout bottle. Diver 2 had no loss of gas. Both divers were recovered to deck without further incident and both hats and umbilicals were inspected by a certified technician. Loss of gas was determined to be caused by a kink in the spiral dive hose just below the last excursion limit D ring. Contractor is investigating alternative umbilical stops to prevent this from happening in
7/17/2024	GoM	Diving	None	Near Miss	Diving Equipment	Air Diving	the future.
7/17/2024	Inland	Diving	Hand Injury	Recordable Incident	Operational Control	Air Diving	Diver suffered a minor fracture on his fingertip when moving a twin line torque wrench to the next bolt location. The 3rd party tech mistakenly thought he heard a "make it hot" command on the radio, causing the diver's finger to get slightly pinched when the tool was engaged. During LARS clump weight recovery operations the clump weight fouled on the edge of the upper deck. In this case no spotter/observer was in use and when the wire parted, the clump weight snagged a cable that prevented it from falling into the water. The clump weight was later recovered
7/17/2024	GoM	Non-Diving	Vessel Damage	Property Damage	Other Equipment	Air Diving	without further incident.
7/17/2024			None	Near Miss	Operational Control	Air Diving	Inspection diver was near a fire pump intake that was set to automatic versus manual control. Better communication was established between dive operations and the control room to ensure that the control room was aware of exactly where divers/dive operations were in progress so the pump 107 could be set to manual.
//1//2024	COIVI	Diving	None	INCAL IVII33	Operational Control	VII PIVIIIR	A tender with proper PPE on had just finished filling a grit pot. Shortly thereafter, he was wiping
							sweat off of his face with his shirt sleeve and got some grit in his eye, causing discomfort. His eye
7/17/2024	GoM	Non-Diving	None	First Aid	Personnel	Topside	was flushed and there was no injury. A fatality was recorded in March in a water tank 100' in the air, in 40' of water. These projects tend
5/15/2024	Inland	Diving	Single Fatality	Fatality		Air Diving	to be performed by 3-man dive teams, and the elevation and confined space for the dive make these very dangerous for the divers. Once an emergency starts, rescue is hard to execute when the incident is already 100' up in the air and access to the injured diver is difficult or limited. These projects should be bid with an eye to safety, but are often bid with insufficient dive teams to keep 40 costs low and win the project.
5/15/2024	GoM	Non-Diving	Vessel Damage	Near Miss	Other Equipment		A dive crew was doing a caisson inspection in 40' of water. The structure was impacted by the liftboat and topside inspection of the platform observed some damage. An All Stop was called and some topside hanging hazards were identified, topside burning gear and some rigging were removed 40 before resuming diving operations safely.
5/15/2024	International TBD	Non-Diving	None	Near Miss	Operational Control	Topside	A crane operator was losing control over a whip line - it was immediately identified that it was due to using wireless internet to the controls as opposed to the preferred hard line. Immediately called an All Stop and IT was able to remedy the issue. No damage or injury occurred.

						1	Many and an arranged and air if a satisfactor and localized for a smaller direct access on air all and it is a surface.
							Many government and civil entities are looking for smaller dive teams or single man divers in order
							to cut costs. Explain to requestors that one-man divers and SCUBA are not always appropriate for
							projects and dives due to safety concerns. This seems to be a trend in some inland and
5/15/2024		Non-Diving	None		Public/Others	Other	government/municipality requests for divers.
							This incident occurred when three coworkers were traveling in a side by side down a dirt road on
							their facility. Middle rider was horse-playing and stomped on the gas pedal, causing the driver to
							lose control. The vehicle rolled and the right side passenger was thrown from the vehicle, with the
							vehicle landing on his head. Had to be airlifted over to Houston, have a piece of his skull removed
							due to brain swelling and a severe brain bleed. Victim survived and is all right now, but he will have
							a long recovery process. This incident was completely preventable and caused by a silly act that was
							unprofessional. Stress safety and professionalism to all workers, even when out and about on a job
5/15/2024	Inland	Non-Diving	Head Injury	Recordable Incident	Personnel	Other	site. Something that seemed harmless and fun at the time could have been fatal.
							USCG Safety Flash - Dangerous materials from discarded munitions. A deckhand on a clamming
							vessel was severely burned when some old canisters of mustard gas were caught up in the net with
							the clams and other debris. Canisters didn't display any outward signs of discharged content or
							danger. The deckhand threw the canister back overboard, and several hours later developed severe
							rash and required medical treatment. In the GoM and off the East coast, there are several areas
- / /			l		L .	0.1	where there were discarded munitions and hazardous materials. Be aware of your locations and
5/15/2024		Non-Diving	Chemical Exposure	First Aid	Environment	Other	potential dangers from discarded materials.
							IMCA Safety Flash - Main bell crane wire rope failure; purchase order was made by owners when
							vessel was reactivated. The purchase was made without consultation of the company's wire rope
							integrity management team, not in line with their wire rope specifications, and was purchased from
							a non-approved wire rope vendor. Could have been catastrophic, but was caught and nobody was
							hurt. A separate operational failure was listed; the bell main wire was damaged by the proximity
							switch bracket. Incident occurred during recovery of the bell after a saturation dive; moon pool
							- '
							operator stopped the winch operator's recovery of the bell after he noticed that the proximity switch
							was in the bell launch and recovery sheet. The bell launch technician freed the chandelier from the
							sheave and the bell was safely recovered. Wire was damaged from being caught up in the sheave.
5/15/2024		Non-Diving	None	Near Miss	Other Equipment	Saturation	Chandelier was moved to the other side to prevent it getting caught again. Nobody was hurt.
							Crane wire near miss - crane wire from the chandelier got sucked up into the sheave. Luckily it was
							noticed and work was stopped and incident avoided. Double check two-block wire to make sure it's
5/15/2024		Non-Diving	None	Near Miss	Other Equipment		clear and there's no chance of getting hung up or tangled in something.
							Mobing on a DP vessel for ROV, a ground fault in the generators caused the generators to not
5/15/2024		Non-Diving	None	Near Miss	Other Equipment	Other	communicate. Took about 18 hours to find the fault before they could resume operations.
, ,		J					
							30 year old diver was conducting a dive in a deep ditch operation in 10' of water with no incidents,
							cave-in, or known problems. Diver suddenly stopped responding on comms. Dive supervisor jumped
							the standby diver, who discovered the initial diver slumped over with no signs of an accident or
							incident. The standby diver had the initial diver back on the jackup deck within 8 minutes. Hat was
							dry, air was working, and no visible signs of injury were noted. Diver had no pulse or breathing, and
							some blood around his nose and some white froth on his lips. CPR was started immediately, and the
							diver was evacuated to the dock, where he was pronounced deceased. Diver had a clear physical two
							months prior. Investigation is still in progress - no coroner's report or toxicology has been received as
3/20/2024		Diving	Single Fatality	Fatality		Air Diving	10 of 5/15/2024.
, , , , , , , , , , , , , , , , , , , ,		<u> </u>	 			 	
							Diver diving in 37' of water (altitude adjusted to 45' table) for 117 minutes - right at the edge of his
							No-D limit presented with bilateral arm numbness, compounded by the fact that the physician at a
2/20/2021		Diving	Illness	Dogardahla kastalaa	Dorsonnal	Air Divisa	
3/20/2024		Diving	Illness	Recordable Incident	reisonnei	Air Diving	45 regional unit opted to use Table 5 for DCS, so the diver had a poor outcome.
							Diver was diving at 67' for 44 minutes. Upon resurfacing, experienced numbness in his bilateral
							lower extremities, which in time spread to his lower back and abdomen. He ignored symptoms for
							about 20 hours before alerting anyone. Such a long delay to recompression led to a long period of
3/20/2024		Diving	Illness	Recordable Incident	Personnel	Air Diving	67 lengthy therapies and a very poor outcome.
							Diver was diving in 68' of seawater for 46 minutes, and presented deco symptoms immediately after
							dive. He had loss of vision, left arm, chest and abdomen pain with numbness at the borders of the
1			L.,	L	l	1	
3/20/2024		Diving	Illness	Recordable Incident	[Personnel	Air Diving	68 pain regions. Significant Type 2 spinal cord DCS and also likely cerebral infarctions as well.

			I	I	1	T T	
3/20/2024		Diving	Illness	Restricted Duty	Personnel	Air Diving	Diver was diving in 70' of seawater for 46 minutes, and was 2 minutes from reaching his No-D limit. Diver delayed reporting any symptoms for 6 hours, but he had significant areas of raised red rash and itching on his abdomen and flank which he described as severely itching, that later developed into joint pain as well. Skin presentation was missed as a likely clue to spinal involvement - more education is needed for all to recognize different signs and symptoms of possible DCS.
							ROV boat had a tech working on the ROV who got some liquid in his eye. They were pressure washing the bridge above him and some of the wash got in his eye despite safety glasses. Eye wash was administered to alleviate irritation, and crew was advised not to pressure wash above or near
3/20/2024		Non-Diving	None	First Aid	Personnel		other coworkers.
3/20/2024		Non-Diving	Hand Injury	First Aid	Personnel		Tender opening up a bell guide wire latch for the first time - got his hand pinched a little and first aid was administered.
3/20/2024	GoM	Diving	None	Near Miss	Other Equipment		DP2 diving, vessel operator informed crew the main generator went down and the backup generator was in use. POC connection between generators interfacing the computer and control room was down and was not broadcasting vessel status or the life of the generator to the control room. Control gave dive crew a blue advisory status, and decided to run the generator in a manual mode. That meant you had to physically check and log the life of the generator and its operational output status on the generator itself vs being broadcast to the control room, so control walked around to check every 15 minutes and work was continued in "blue status". In the vessel manual, green signifies auto mode, and blue signifies manual mode. Blue advisory mode is new and unfamiliar, and brings up the point that dive contractors need to be familiarized with a particular vessel and its protocols, to be able to operate safely by understanding different vessels and their operation.
3/20/2024	GoM	Diving	Illness	Recordable Incident	Personnel	Gas Diving	Diver was No-D diving, breathing nitrox. Following the Navy schedule, he dove for 35 minutes. Upon resurfacing, diver noticed pain in inner right thigh, sat down to look at the leg and felt pain in lower back. When he stood up pain in lower back diminished, but he felt tingling from navel down in both legs and feet. Contacted DMT and said he was feeling funny. DMT conducted a neuro and treated him on Table 6 with couple of extensions, and were able to diminish most of the symptoms. Upon arrival a full table was run and currently the diver reports no symptoms, and PMO will run some further tests to try to determine what happened and how to prevent it. Two divers were working 96 side by side when this occurred, and the other diver had no symptoms or issues whatsoever.
3/20/2024		Non-Diving	None	Near Miss	Other Equipment		During loading of submar mats with a submar handling frame on the back deck of the boat, some of the welds on the frame were discovered to have indications of failure. Stop Work was called and the handling frame replaced. Decision was made again to closely inspect all equipment upon receipt, to be able to catch potential problems before the equipment and materials are in use.
3/20/2024		Diving	None	Near Miss	Other Equipment		4500' of pipeline, using HDD to connect to offshore. Using a hoop to hoop shackle, and the HDD was oscillating and putting diver's hand in potential danger. Diver called an All Stop, some chain was added and procedure was altered to allow the diver to complete the task without putting his hand in danger. All parties were satisfied with the solution and job was completed with no further incidents.
3/20/2024	Inland	Diving	None	Near Miss	Environment	Air Diving	Diving operations on a 30" Pipeline Repair in 13' of water. The main diver, who had been broken out for a year and a half, was hand jetting to assist with the installation of belly bands around the pipeline. While installing a belly band the diver experienced a soft mud slide. The main diver called for the standby diver to assist with freeing himself. The main diver worked to clear himself from the mud while the standby diver was deployed and was on location in less than three minutes. When the standby diver reached the main diver, he was in the process of freeing himself out of the soft mud and the standby diver assisted with clearing the main diver the rest of the way. The standby diver was recovered to surface and the main diver followed immediately after without any injury. This scope of work was considered a "Deep Ditch Scenario" and was discussed in the Pre-Job Planning and in the HIRA process. A second jet pump was on location and ready to be utilized if needed. A Safety Stand-Down was initiated, and the divers were reminded not to rush installing the belly bands. The Supervisor was also reminded to spend additional time with junior personnel concerning the hazards of Deep Ditch Jetting. Upon completion of the investigation all work was resumed with no further incidents.
			_				Spineys in hands, encouraging people to report quickly, no matter how small, so it doesn't get
1/17/2024		Diving	Hand Injury	First Aid	Environment	1	infected.

1/17/2024		Non-Diving	None	Near Miss	Personnel	Topside	Picking up a big anchor on the back of the boat and crane lift timing was critical due to how fast the crane could come up on the load - timing was off so it nicked the transom a little bit. Nobody was hurt and environmental and timing factors were reviewed for lifting operations.
1/17/2024		Non-Diving	Leg Injury	Recordable Incident	Personnel	Other	A renewable company was moving the forks on a skid steer, and didn't disengage the skid steer all the way. When operator got up to say forks weren't wide enough, he inadvertently hit the throttle and hit the worker in front in the ankle, breaking his ankle. Knee jerk reaction was to grab the throttle and pull back. When he did this, the third worker behind the skid steer was struck with the skid steer going backwards and it broke his hip. Two people were injured due to proper LOTO not being performed. LOTO on all equipment is necessary.
		Diving	None	Near Miss	Other Equipment		Near miss on a pipeline pull project offshore CA. Called an All Stop on moving 4500' pipe into the pullback. Pipe was moving a lot while trying to rig up, so the divers and supervisors called All Stop pipe was rerigged and the move was successfully completed. No damage and no one was harmed. This is a good reminder to all that everyone has All Stop authority, and onshore management will support it and have your back.
1/17/2024		Non-Diving			Public/Others	Other	Travel management - one company had a string of vehicle accidents. When cameras loaded into company vehicles were reviewed, it was discovered there was a group of people targeting company vehicles with logos for accidents for the purpose of litigation.
11/15/2023		Non-Diving	None		Personnel		Subsea beacon holder fell off crane wire and fell 3 meters to deck. All stop was called, site was secured and then lifting operations resumed. Subsea beacon is normally attached by two clamps one for the holder and one for the beacon itself - this one was just held by one. When worker went to remove what he thought was just the first clamp from the beacon, the beacon holder was released and fell to deck. No injuries, no damage. Stand down was immediately called and proper installation and removal of beacon revisited. Crane operator will now verify, and second strap was also added to ensure proper attachment in the future.
11/15/2023		Diving	None		Personnel	Air Diving	DP diving ops, recovering diver on a No-D dive, miscommunication occurred. Diving supervisor told the LARS operator that "diver was No-D, come up on him". LARS misunderstood and thought he said to start moving up on the stage. Diver called All Stop and clipped hose into stage and off of crossover. Moving forward the supervisor is going to confirm the stage is ready to travel, and will then tell LARS operator to "recover the diver to the surface."
11/15/2023			None			Air Diving	Two suspected DCS initially but ruled out. 1 - Diver experienced left foot pain 2 days after completing a 32 foot dive. Ruled out due to length of time before symptoms showed up, and also because pain only occurred when weight was put on the foot. 2 - Another diver experienced shoulder pain 4 hours after completion of a 35 foot dive. Also ruled out through investigation, partially due to the discovery that diver had pre-existing condition, likely spinal stenosis. When suspected DCS hits occur at the jobsite, personnel are immediately put in the chamber and run on a 35 Table 6.
11/15/2023		Non-Diving	None	Near Miss	Public/Others	Other	ROV boat on location with ROV on bottom and seismic boat entered the cone of safety. Neither vessel was aware of the other initially. Seismic boat told dive boat to leave, dive boat couldn't due to ROV being on bottom. Near miss with a potential for entanglement.
11/15/2023	GoM	Non-Diving	Head Injury	First Aid	Other Equipment	Saturation	Dropped object incident; frozen gallon jugs were being hung in the bell due to high temperature in the bell. Tied with a rope through the handles. One handle broke and the jug fell and hit a diver in the head, causing a cut. Neurological testing and first aid done, diver was all right and made a full recovery. Will install cooler to better regulate temperature in the bell, and secure hanging objects much more carefully.
9/20/2023		Diving	Illness	First Aid	Environment		Diver in S. LA finishing dive, brushed himself off. Started acting strange and unresponsive, but vitals were ok. EMS was called, and by the time they came he was coming back to normal, but tired. Doctors determined he had a severe allergy to fire ants, previously unknown.
9/20/2023		Diving	Illness	Recordable Incident		Air Diving	Commercial diver who had taken a recreational diving course before going to dive school. He felt he'd possibly gotten bent in the recreational course, but nobody believed him. Worked for quite a while professionally, but kept having complaints. MRI revealed he does have brain infarqs, likely from the original recreational course. Diver also had a PFO, and can no longer dive.
9/20/2023		Diving	Illness	Recordable Incident		Air Diving	Diver was doing repet diving to 110', came up with Type 1 joint pain. Even though he was within his 110 Navy NoD limits. Multiple repet diving with short surface intervals could have been a factor.

			I	1			
9/20/2023		Diving	Illness	Recordable Incident		Air Diving	Suspected DCS - first presented as a skin rash. Left bottom at 110' on NoD, then went up to 92', continuing work. Possible issue of dive table not being followed properly. Company rep was insistent it was not a DCS, it was just a skin rash. Some clients resist labeling something as a DCS, and this can lead to greater injuries. Stigma needs to be removed.
							On a surface diving boat - crane wire headache ball took a rap during operations. ALL STOP was called. Supervisor and couple tenders working on deck, supervisor took a break, the tending crew decided they were going to try to get the headache ball unwrapped from the boom. Crane operator was instructed to start booming down the crane, and the crane wire snapped, headache ball fell directly to the top of the crane cab and nearly missed the crane operator. JSAs and plans must be in
9/20/2023		Non-Diving	None	Near Miss	Personnel	Topside	order before anyone decides to try to perform an operation, especially without supervision.
9/20/2023		Diving	None	Near Miss	Personnel	Air Diving	Diver rigging 12" pipe, pulling out pieces as cut. 65' long, 7,000lbs w/2 point rigging. Working in zero visibility. One pipe rigged, load was raised, pipe came free of mud, causing it to spring up and broke free. Diver was moved out of the way to ladder, and pipe was dunked several times to try to clear mud off. Once removed, one strap started to slip and came loose. Load lowered, ALL STOP called. Strap was not affixed to the continuous sling - when diver wrapped it, he accidentally attached it to the wraps and not to the sling. When pipe was bounced, it started to slip due to not being properly choked.
3/20/2023		Diving	None	ivear iviiss	rersonner	All Diving	CHOKEG.
9/20/2023	International TBD	Diving	None	Near Miss	Personnel	Air Diving	Diver recovery drill, there was restriction to diver's air supply. Improper umbilical management of umbilical in moving umbilical from basket to basket, resulting in loss of main air supply to diver. Both diver and standby diver were recovered without incident or injury.
9/20/2023	International TBD	Non-Diving	None	Near Miss	Other Equipment	Saturation	Two divers in water, connecting pipe to new crane with heave compensation, which was in inactive mode. Reconnecting the hooks, ALL STOP was called. Within 3 seconds crane put itself back in original position without operator touching the joystick. Determined to be a software issue. No injuries, divers were moved out of way and back to ladder.
9/20/2023	Inland	Diving	Heat Exhaustion	First Aid	Personnel	Air Diving	Diver on deck started showing signs of heat exhaustion late in the day. Not acclimated to the area or the extremely high temps. Was removed from deck at first signs, hydrated and rested to cool down. Seemed fine, but started showing symptoms again after three days when crew went back to diving. Checked out by doctor upon return, who said that once heat exhaustion is experienced by someone, 30 it's more likely to occur again. No injuries or lasting effects.
7/10/2022	Inland	Diving	Illnors	Posardable Incident	Perconnel	Air Diving	Significant DCS type 2. Young guy doing shipping work diving in 60' of water, no decompression time. No abnormalities in the ascent, but 16 minutes after surfacing he developed hip pain, arm and extremities pain. Supervisor got him on surface O2 and called EMS immediately, so lag time was only 30 minutes. Fortunately he was diving on a Navy base and the facility checked him out. Complete and rapid recovery. Should consider bringing a chamber even for shallow depths greater than 30', or know the nearest hyperbaric chamber facility to the worksite, and confirm it's operational and
7/19/2023	inianu	Diving	Illness	Recordable Incident	Personner	Air Diving	60 manned. Finger was injured by underwater tool basket. Hatch lid fell down and pinched employee's finger
7/19/2023	GoM	Non-Diving	Hand Injury	Recordable Incident	Other Equipment	Topside	and the tip of the employee's finger was cut off.
5/17/2023	International TBD	Non-Diving	Facility Damage	Property Damage	Operational Control	Other	Tugboat tying up to a platform. Didn't inform platform they were tying up to the horizontal and a wave threw the tug into the structure. Ended up underneath the horizontal and busted off part of the leg. Nobody hurt, just damage to the platform. Mooring incident.
							While recovering the tugger wire to surface, a tender was attempting to hand level wind the drum. While doing so, his pinky finger was caught between the cable and the drum. The tender all stopped coming up on the tugger and slacked it off to free his finger. The tender had minor abrasions on his
5/17/2023	GoM	Non-Diving	Hand Injury	First Aid	Personnel	Air Diving	pinky finger. He was examined by the DMT onboard and returned to work. While cross hauling a flange from the work location to surface, there was a breakdown in
5/17/2023	GoM	Non-Diving	Facility Damage	Property Damage	Operational Control	Air Diving	communications between the Supervisor, Crane Operator, and Tugger Operator. Due to this breakdown in communication, the crane operator, who had been instructed to come up on the load, continued with these instructions even though the tugger operator was not slacking off the tugger. This lack of communication resulted in the tugger wire parting and the flange dropped to bottom. Prior to coming up on the load, the diver was moved to a safe location and was at no time during this evolution put in harm's way.

			1				
5/17/2023		Non-Diving	None	Near Miss	Personnel		DSV had a large winch on back deck. A socket failure occurred during attempted 47 ton load test. Epoxy was bleeding through. Socket hadn't sat for 12-24 hours as needed, prep work hadn't been done properly, and socket/cables weren't cleaned well. A third party technician handled the pour and it was later found that the technician had questionable experience. Manufacturer's instructions weren't followed correctly. MSDS sheets must be studied and the instructions for each component followed as per the manufacturer's directions. Will have better communication and checklist with vendors prior to commencing work.
3/11/2023		INOII-DIVING	None	iveal iviiss	reisonnei	+	vendors prior to commencing work.
5/17/2023	International TBD	Diving	Illness	Restricted Duty		Saturation	Around the world, 3 cases of having to decompress people from SAT. One was ear issue, one was abdominal issue, and one was difficulty breathing. Undetermined cause, but potential cause long-term COVID. Diffusion level was very low, unsure if he will be able to be cleared for diving again. Need capability to get people out in case of illness in SAT systems. While conducting a UWILD on a tanker in Thailand, the diving contractor placed an inflatable plug in
5/17/2023	International TBD	Diving	Single Fatality	Fatality	Other Equipment		a seachest opening for valve removal inside the engine room. Inflatable plug didn't hold and caused flooding of the engine room of the FPSO, causing a fatality inside the engine room. Wooden plugs and inflatables are still being used around the world for UWILDs, and are not as dependable as an internal friction fit plug.
		<u> </u>					Reports out of Norway, another bad gas incident. They were diving doing decompression on a salvage job. Two of the O2 bottles were actually only air and not O2. Both divers had some decompression symptoms/issues from decompressing on straight air versus the O2 it should have been. Awaiting more details. Breathing gases MUST be checked more thoroughly than they
5/17/2023	International TBD	Diving	Illness	Recordable Incident	Diving Equipment	Air Diving	currently are.
5/17/2023	International TBD	Diving	Single Fatality	Fatality		Air Diving	A Mexican diving company had a fatality, working on an underwater ship's husbandry inspection of a lay barge. There was no proper LOTO of the thrusters and diver was killed when one of the thrusters engaged while he was in close proximity. No plan in place, no adherence to any safety standards for UWSH, company is being reviewed and audited.
							Employee grabbed rope during mooring operations, and his hand was broken. This is a very common
5/17/2023		Non-Diving	Hand Injury	Recordable Incident	Personnel		occurrence. Don't be afraid to call an ALL STOP.
5/17/2023		Non-Diving	None	Near Miss	Personnel		Welding machine on deck, crew member stepped back to get out of the way and stepped into the rope. Was caught up and hung 20' up in the air. Able to grab the line and untangle him, lowered back to deck safely. Always be aware of mooring lines and ropes and the dangers they pose. IMCA safety flash.
3/15/2023	International TBD	Diving	Multiple Fatality	Fatality		SCUBA	Around March 4, 2023, two SCUBA fatalities in Venezuela. Two divers inspecting the bottom of a large tanker at ~75fsw. About 40 minutes into the dive, topside crew started to wonder about the divers. Sent another diver to check, he couldn't find them. Next day one diver was found floating on 75 bottom, and the other drifted to shore about nine days later. No further information at this time.
	International TBD	Diving	Single Fatality	Fatality		SCUBA	Around January, 2023, a SCUBA diver was killed due to a DP accident in dry dock. Cause not given. Working with the Venezuelan government trying to put new guidelines in place up to US standards, but every ship has to be inspected by their port authority. We have no control over their use of SCUBA on these sites.
3/15/2023		Non-Diving	None	Near Miss	Other Equipment		Deep water winch commissioning process, had a bad socket board. Caught by one guy on deck when they were stripping wire out through the sheave and overboard sheave. Called an All Stop. PowerPoint created internally and getting feedback to correct and prevent this in the future. Manufacturer has wrong shelf life and set times on their sockets. They don't do well in temperatures above 80 degrees. Fortunately caught, could have been bad.
3/15/2023	GoM	Diving	None	Near Miss	Operational Control	Air Diving	Plidco clamp uninstall and repair/reinstall in Louisiana. End customer said line was completely bled, so work was started. Company rep walked by and told diving supervisor to hurry up, they were pumping 100% natural gas through that pipeline. Supervisor called All Stop, co rep called company and dive company got significant pushback; threats to run off, tell everyone, etc. Said back in 2003 they would have done this work. Found out operations did not tell their safety department right info and didn't report leak they were supposedly repairing. Government, safety, etc. involved now. Inland companies are promoting people to supervisor prematurely and end clients in shallow water are pushing unsafe practices. Too much work and too many unskilled and inexperienced workers.

			I				
3/15/2023	North Sea	Diving	None	Near Miss	Operational Control	Saturation	SAT diver working underwater on a water injection tree, removing a dummy plug and replacing. Tree flushed, plug was replaced with two half shells, so divers were unbolting the shells and saw some gas coming out, which was expected until due to flushing, until they saw bubbles. Got the bolts loose and the plug ejected from the pressure behind it. Isolations were in place and tested, but they left the vent closed per the procedure which was not picked up as an error. Plug weighed about 192lbs. Divers not in the line of fire, plug popped out a couple of feet and fell down. Nobody hurt, but leaving the vent closed should have been caught and generated and MOC to leave the vent open. The expected pressure wasn't investigated enough, so when bubbles were there it didn't raise the appropriate alarms. All that happened at 30psi. Assessing the situation and potential dangers needs to be done properly, and what to expect should be addressed more thoroughly. In Africa, gas rack wasn't properly inspected per QHQC before it came out. Contractors and
							procedures were lax on how to test bottles in a cascading system. Supposed to be pure O2, several bottles were found to be less than 2%. Once realized, they brought the diver up, and he was passing
3/15/2023	International TBD	Diving	Fatigue	Near Miss	Operational Control		out as he came out of his hat. Very close to being a fatality or major injury, gas management is paramount.
1/18/2023		Non-Diving	Leg Injury	Recordable Incident	Personnel	Topside	Pressure washing vessel with heated pressure washer. Was distracted by person coming up to talk to him, and had washer gun pointing down while chatting - accidentally hit trigger on pressure washer and shot other person in the foot. Penetration right in front of steel toe boot, went through boot and left a burn hole the size of a human hand, just from one quick press of the trigger. Remember, when not in use, pressure continues building. Victim was transported to burn unit and treated.
1/18/2023	Pacific Ocean	Diving	None	Near Miss	Personnel	Air Diving	Diving off a barge on the West Coast, barge job doing 16" PL repair. Using sweeper pipes to stabilize the EOP once it was cut. Made the cut and sleeper pipes were going to be pulled using a dead man anchor and a snatch block to pull them out at a 90 degree angle. Bottom is compact sand, so enough tension on the sleeper pipes that the dead man anchors were starting to slide. Decision was made to connect rigging directly to the sleeper pipes and pull them up with the barge crane. Supervisor and diver had clear visibility, over 100'+, sup asked diver numerous times about umbilical management. Diver was a little complacent and thought it was good. Got tension on sleeper pipes and started to pull them out. Didn't pull like it would with the dead man anchors, little cantilever action, put some force on pipe and pipe shifted a few inches as pipes were pulled out. All looked good and pipes were pulled out. Supervisor had diver go back up pipe to do some checks, and at that point he realized his umbilical was stuck under the pipe. Gas was never compromised and diver was able to free umbilical, but could have been much worse. Reviewed HAZID and procedures, discussed sleeper pipes and their use, but realized there was no drill-down on what to do if they're stuck or not pulling out properly. Discussions were had, but they were not in the procedure. Procedure was amended to add possible problems and corrective actions, and reviewed with entire crew. Hose management was covered again.
1/18/2023	Pacific Ocean	Non-Diving	None	Near Miss	Other Equipment	Other	Incident in California - working around the plus 15 and had stepped on some grating. Grating was in disrepair, and person almost went through. Inspection work on something that was waist height, grating at ground level almost gave way. Handrails and grating need to be kept up.
11/16/2022		Non-Diving	Vessel Damage	Property Damage	Personnel	Other	Airboat operator hung his hardhat from the steering lever while driving to not lose hat. In travel, the ditch made an S, as he turned the lever to maneuver the water way, the hardhat jammed the steering lever, preventing turning. He hit a stump which sent boat airborne and collided with a tree and ejected passenger. Passenger missed hitting the tree by 3'. No injuries, but the front of the boat was ruined. Better situational awareness and critical thinking of potential hazards. Nothing should be hung on the steering lever while driving.
11/16/2022	Office/Warehouse	Non-Diving	Heart Issue	Recordable Incident	Personnel	Office/Warehouse	Chemical refinery hired new twenty-something. Went out partying night before, and went to work out in the am, took 3 scoops of pre-workout, then on way to work drank 4 Red Bulls. At work drank 4 more. Fell out at work and had a cardiac event at 25 years old. Safety policies need to better address OTC stimulant use on the job.
11/16/2022		Non-Diving	Leg Injury	First Aid	Personnel	Topside	4 point anchor boat on 3 month tie-in campaign this year. Within one week, 4 first aids, all to do with people cutting their shin, knee, calf, all related to crowded deckspace. Two weren't reported till days later because they weren't considered significant. Full stand-down, safety had to go and examine the deck for hazards and police the deck for the rest of the campaign. When deck was cleaned and organized better, superintendent realized how important it was for safety. Cleanliness is important. No recordables, all minor/first aid.

	I	1	1	T			
							In weather period. Surface 180' boat in 60fsw in EI area. Weather coming, pick up anchors to head
							in. Within 2 hours, went from 3-5s to 15-16' seas coming straight out of the north with 88 knot
44/45/2022			.				sustained winds. No warning. Nobody was hurt, but be extra aware of how quickly the weather can
11/16/2022	GoM	Non-Diving	None	Near Miss	Weather	Topside	change before you can even get a weather report/warning.
							Diver using a liftbag attached by a basketed rigging, (not choked) was trying to get a closing spool to
							hang level. Rigging slid, causing uncontrolled ascent of liftbag. Inverter line was last line of defense,
							could have been bad with diver inflating bag right next to spool. MOC should've been initiated with
							writing of new procedures. This was the end of a long campaign, personnel complacency was a
							factor. Liftbag was changed, but was not articulated. Personnel didn't follow up closely on checklist
11/16/2022	GoM	Non-Diving	None	Near Miss	Personnel	Saturation	330 to check rigging.
==,==,====							Guy got a bit of his dive hose underneath pipe. There was some freespan, had good enough visibility
							to make sure sleepers weren't being stripped out and moved, he was able to get his hose out. JSAs
11/16/2022	Othor	Diving	None	Noor Micc	Diving Faviament	Air Divina	100 need to be followed more closely.
11/16/2022	Other	Diving	None	Near Miss	Diving Equipment	Air Diving	100 freed to be followed filter closely.
							Alberta, Canada. Sluice gate work on dam. Put diver in on high pressure side of dam to see why gate
							wouldn't close properly. Heard banging, thought diver was working to free debris, was actually
							trying to free himself. Scuba diving, so no comms. DeltaP situation, he was sucked in and was killed.
11/16/2022	International TBD	Diving	Single Fatality	Fatality	Operational Control	SCUBA	ALWAYS be aware of DeltaP conditions and the dangers associated.
							Diver on West coast of Scotland. Working on shipwreck, suspended one end of the lift, the wreck
11/16/2022	International TBD	Diving	Single Fatality	Fatality	Operational Control	Air Diving	folded up and ended up crushing the diver, killing him.
, ,, ,		l "	1 0 1 11 17	,			Diver suffered crushed finger when vessel heaved. Diver had hand in wrong spot, installing a grating
							over a SS tree. Using a crane and had active heave. Caused his finger to be crushed between panel
							and tree. He was in a pinch point, and there was another method of installing it, which he should
9/21/2022	CoM	Diving	Hand Injury	Recordable Incident	Masthar	Air Divina	
9/21/2022	GOIVI	Diving	Hand Injury	Recordable incident	weather	Air Diving	have used.
							Flash fire on an oxygen/gas quad onboard a DSV. Compressor had been put too close. During routine
							checks, closed regulator and LST reported that control was low, SAT control informed dive control
							and a flash fire erupted. Put out with a fire extinguisher. Filter had been removed from bullnose
							fitting to the oxygen quad and debris had entered and caused a stuck piece of trash that caused
							ignition when the hose blew. Have the guys check the fittings on regulators; oxygen hoses have to
9/21/2022	GoM	Non-Diving	Vessel Damage	Recordable Incident	Diving Equipment	Saturation	be clean and chemicals are never to be mixed offshore.
							Loss of air, first dive of day. Electric 5120 compressor broke down or stopped while diver was in
							water. Had to go to bailout. All was fine, but had to investigate what happened with the
							compressor and why or if it wasn't properly maintained. No reason found why compressor would
							have shut off, may have never been started. Lost gas/air drills are routinely performed to prepare
							personnel and help maintain calm in an incident; and reminder to check all breakers on compressors
9/21/2022	GoM	Diving	None	Near Miss	Diving Equipment	Air Diving	prior to diving.
9/21/2022	GOIVI	Diving	None	ivedi iviiss	Divilig Equipment	Air Diving	i s
0/24/2022		s	.				Lost comms; speaker went out prematurely. Older style, has issues. Had to abort dive and bring
9/21/2022	GOM	Diving	None	Near Miss	Diving Equipment		diver back on deck.
							Lost comms on dive, had to abort. On a 17B, called Baytech; good fix was to poke a hole in the
9/21/2022	GoM	Diving	None	Near Miss	Diving Equipment		module and it worked fine. No injury or incident.
							Had to resupply 5/8 shackles. Tender put them on deck, had made in China on every shackle.
							Quarantined. Newer personnel have to be informed about why Chinese shackles are not acceptable.
9/21/2022	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	Had standdown and a safety alert.
							Hiring practices; call received from deep gas job when 1 year tender posed as a 6 year experienced
							diver. Had been hired and sent on deep gas job. Another diver came on job and knew the tender's
							experience. He'd surrepticiously stolen a position from more experienced and qualified potential
							hires. Check credentials and go over everything before hiring. Trust your gut and investigate all
0/24/2022	GoM	Non Divins	None	Near Miss	Dorconnol	Tonsido	
9/21/2022	GUIVI	Non-Diving	None	Near Miss	Personnel	Topside	potential hires well. Could've caused a serious injury or death.
							West transport from the Philade Biography of the control of the co
							Working on medium size liftboat. Diver was in sleeping quarters, jumped from top bunk and landed
							wrong. Impact caused pain in left buttocks and down leg, proceeded to go to work. Lack of a ladder
							for bunks. After scheduled dive, reported issue. Ended up being a lost time incident due to slight
							injury of diver's back. Liftboat captain wasn't aware of issue or incident. No room for ladders, so pull-
							down steps were added, as well as orientation to the boat about the potential for injury. Should
9/21/2022	GoM	Non-Diving	Back Injury	Recordable Incident	Other Equipment	Topside	have been reported prior to dive.
, ,		1	, ,			<u> </u>	In Malaysia, had some certs from divers who didn't look right. Upon investigation, one had stolen
							the identity of an American diver. Check ADCI certs and all documentation of your divers and
0/21/2022	International TBD	Non-Diving	None	Near Miss	Personnel	Topside	personnel, fraud is rampant.
3/21/2022	international IBD	LIAOH-DIAHR	INOLIC	INCUI IVIISS	i cisoiilici	Tropside	personner, made is rampaire.

							Boat took a rock, captain on back deck fell and was injured with shoulder dislocation. Previous
							condition, he put it back in place and continued project. Had trouble getting incident form from
7/20/2022	GoM	Non-Diving	Shoulder Injury	First Aid	Other Equipment	Topside	third-party vessel.
							Two divers working on FPSO in about 20' of water doing an adaptor mating test. About 2 hours into
							dive, the adaptor lost buoyancy and diver number 1 was tangled up in the adaptor mating flange,
							sank to about 165' (55m). Diver number 2 went to recover diver number 1, who had lost
7/20/2022	International TDD	Divine	Cinala Fatalitu	Fatalit.	Other Frances	Air Divine	consciousness. Recovered both divers and got them into chamber, but diver number 1 did not
7/20/2022	International TBD	Diving	Single Fatality	Fatality	Other Equipment	Air Diving	20 survive. Not a lot of details available.
							Terminal diving at New Jersey birth. Key is off of main waterway, two divers in the water. Signs and
							flags were up, in addition to a hard barrier and oil boom. A tug had a pilot on it, he informed captain
							of the tug to push the well boom to drop him off at dock. Never informed anyone and it wasn't even
							noted that they were there due to the setup. Came within 20-30 feet of divers in the water. No
							incident, but very close call due to not following any established protocols. Admitted they saw all
7/20/2022	Atlantic Ocean	Non-Diving	None	Near Miss	Public/Others	Topside	signs, and still pushed the hard barrier.
7/20/2022	Atlantic Ocean	Non-Diving	None	INEdi IVIISS	Public/Others	Topside	Employees either don't want to do a COVID test, or else break quarantine. One employee contracted
							COVID and is in serious shape. Personnel can't go in SAT or be in close proximity with an offshore
7/20/2022	GoM	Non-Diving	Illness	Restricted Duty	Personnel	Other	crew unless it's known all are safe.
7/20/2022	GOIVI	Non-Diving	iiiiess	Restricted Duty	reisonnei	Other	Crew unless it s known an are sare.
							A tall, slender 21 year-old diver tender developed a pneumostynum while coming out on a slope
							from diving in 8'. Had been moving rocks, employee was tall and water depth was only 8'. Chest
							started hurting with congestion a couple hours after dive. Did a CT scan and saw air bubbles in heart
							ventricle. Take care lifting heavy objects, even in shallow water, and come up at the prescribed rate
							Doctors later informed Supervisor there's a condition where ulcers form in the lungs, which can only
							be detected from a lung scan. This disqualifies people from diving, most common in younger, tall
7/20/2022	Inland	Diving	Illness	Recordable Incident	Environment	Air Diving	8 men with slender upper bodies.
1,20,2022							Reminder to provide workers with water and ice; heat stroke and heat exhaustion are a very real
7/20/2022	GoM	Non-Diving	None	Near Miss	Operational Control	Other	possibility with these temperatures.
•		J			·		
							Setting up for daily dive ops, Supervisor noted interference on the diver video monitor.
							Troubleshooting, all video components changed without correction of issue. Dive initiated, comms
							failed. Dive aborted, video was still marginal. Vessel power was checked and acceptable. Post-dive,
							the Supervisor heard a strange hiss and smelled smoke in dive control. Video was not working
							perfectly and mini-fridge installed was found to have shorted out. It was in the same power circuit
							as comms/video to diver. Lesson learned: ensure that peripheral equipment is not connected to
							same power source as critical path equipment, even if power output is well within limits. Could have
7/20/2022	GoM	Diving	None	Near Miss	Other Equipment		caught fire and caused dive control to need evacuation, leaving diver unattended/unprotected.
							Check valves - flushing a pipeline, valve was supposed to be pinned open. Dust cover was never
							removed, and caused injury to second diver who went down to check it later. Remove dust cover
7/20/2022	GoM	Diving	None		Personnel		from valve, and double-check to avoid injury.
							Misidentified labeled bottom mix that wasn't reported - surface dive went all the way to bailout
							checks before discovered. Clearly marked to anyone who knew what they were looking at. Had
							bottom mix gas on an air job, got it sorted. Already tucked into the jacket, everyone was just
7/20/2022	GoM	Diving	None	Near Miss	Personnel	Air Diving	complacent.
							Water bottle exploded coming out of the medlock at about 380'. Very dramatic, no injury, just a near
7/20/2022	GoM	Diving	None	Near Miss		Saturation	380 miss.
							Diver in the stage, coming up from bottom. Alarm saying low oxygen on actual 50/50. Switched over
							O2 monitor, all good. Couple seconds later, alarmed again. Supervisor, because at end of
							decompression, decked the stage. As diver got to surface, he fell out. Rack had been tested with
							nitrogen, supposedly bled off and rejammed with pure O2. Couple bottles had not been properly
							vented and refilled. Diver ended up breathing pure nitrogen. Non-oxygen compromises pulmonary
							system. Gas had not been properly analyzed. Went back and tested every individual bottle, as IMCA
7/20/2022	Pacific Ocean	Diving	Lung Injury	Recordable Incident	Diving Equipment		dictates. Not followed most of the time. Lesson learned, test every single bottle to verify.
							Mode hains done to a see year. In a much the mean result in the day of the da
							Mods being done to a gas rack. In a rush, too many people involved, no clear communication
							between personnel checking, and some checks were confirmed verbally. Check valve was backwards
							on 50/50 supply to number one diver. Valves are small, can look just like a connection. Arrow was in
							back of valve, no visual cue. Delay of almost 15 minutes getting 50/50 to the diver. Fell back on
							procedures and then got back on schedule. No injuries or symptoms, but definitely a near miss.
7/20/2022		L		l			Racks need to be tested and testers confined to fewer people to ensure all boxes are checked and
		Diving	None	Near Miss	Personnel	Gas Diving	proper paperwork and safety measures are completed.

				1	ĺ		
5/18/2022	2 Atlantic Ocean	Non-Diving	Shoulder Injury	Recordable Incident	Personnel	Topside	Survey type work, collecting samples off the sea floor. Roughneck during mixed sea, tool got away from him. Tried to stop tool from injuring others, and it got away from him. Will need surgery on his rotator cuff. Less than 50' visibility in deep fog. Should have been an All Stop.
							Dredging group took submerged line and attached to a barge, pipe was extending out and not completely secured yet. Out of the blue two kayakers came and decided it was cool to paddle under pipe to take selfies. Interface with the public with dredge jobs and near shore jobs is a constant
5/18/2022	2 Atlantic Ocean	Non-Diving	None	Near Miss	Public/Others	Topside	battle.
5/18/2022	2	Diving	None	Near Miss	Operational Control		Since September, now 3rd project wanting to put templates/spools underwater with blind flanges; no valves, diffusers, any safety equipment for diver to work with it underwater. Part of the big Delta P push. Trying to dehydratize flanges to try to equalize pressure is just desperation; should all be planned before it goes underwater. Still happening, very difficult to mitigate. All 3 projects had very heavy spoolpieces, and want to wet store and have divers come later to assemble. In 2 incidents, was identified as a risk, but decided not to use equipment to equalize pressure. Seems to be related to size of the spools and anti-corrosion treatment. 3rd project was completely forgotten.
							From IMCA website-near miss with SAT diver, bailout bottle failure, no divers in bell but supervisor
							heard gas on comms and camera showed mist on screen. Nut missing from bailout bottle system
3/16/2022	2 GoM	Diving	None	Near Miss	Diving Equipment	Saturation	and thread failed under pressure. Check your bottles.
3/10/2022	Z GOIVI	Diving	None	IVEGI IVII33	Diving Equipment	Saturation	and thread falled under pressure. Check your bottles.
3/16/2022	2 GoM	Diving	None	Near Miss	Other Equipment		Umbilical was drawn underneath the load. Fiberlass like cover with diver working near load. Heave compensated crane was not expected to move and diver was unprepared for it. It did, and hose was sucked under fiberglass but came back out immediately. Be prepared for potential crane movement, even when unlikely and stress proper hose management.
2/15/2025						CCURA	Four divers were killed in Trinidad recently. All on SCUBA working on 36" pipeline. Exact SOW unclear, but 5 divers were working on a pipeline with a vertical riser. Putting new end connector on vertical part and experienced differential pressure situation. Som loading hose going offshore, said they popped "ping or plug" on riser (which was 30' off bottom), and all divers went down into the pipe. All in pipe for several minutes and communicating with each other, lone survivor said he thought all four were behind him. He got out and thought all were coming, but they would not let him go back for others and they shut the job/rescue down. Investigation in progress, waiting on
3/16/2022	2 Other	Diving	Multiple Fatality	Fatality	Diving Equipment	SCUBA	official report.
							Near miss due to equipment. Medical lock on surface deck decompression chamber that had been shipped from Broussard, LA to platform in CA. When chamber was transported, it was pressured up to 20' on inner lock and little less on outer lock. Medical lock was at surface to protect hatches
3/16/2022	2 GoM	Non-Diving	Fauinment Damage	Near Miss	Diving Equipment		during transport. Inner door has hub flanged on to tube turn piece of pipe and has dog that holds it around pipe. When offshore in CA and cycling medical lock to check chamber, opened the outer door and made sure no leaks coming from inner door. None, so they closed medical lock back up. There is a valve on the medical lock where a piece of tubing goes to a hull valve to be able to control from topside. Pressured up medial lock and checked outer door for leaks and went about their business. Continuing investigation shows they should not have left it pressure up but should have bled it off. Medical lock pressurized, then internal checks on chamber started. Brought outer lock to surface and went to hit crossover valve to bring the inner lock to surface, and when they did that there was a big lound boom and crash. Differential pressure caused the inner door to blow off the medical lock. They think the door actually struck the other side of the chamber. Trying to duplicate the incident on similar chamber in GoM. Only blowing the O-ring so far, so theory is besides operator error, the dog probably shook loose during long transport. No injuries and procedures and training are being reviewed. Note-inner door assembly was provided by the chamber manufacturer. Probably had 10# of pressure on it at time of incident. Double check chambers for safety, especially after transport
3/16/2022	2 G oM	Non-Diving	Equipment Damage	Near Miss	Diving Equipment		around pipe. When offshore in CA and cycling medical lock to check chamber, opened the outer door and made sure no leaks coming from inner door. None, so they closed medical lock back up. There is a valve on the medical lock where a piece of tubing goes to a hull valve to be able to control from topside. Pressured up medial lock and checked outer door for leaks and went about their business. Continuing investigation shows they should not have left it pressure up but should have bled it off. Medical lock pressurized, then internal checks on chamber started. Brought outer lock to surface and went to hit crossover valve to bring the inner lock to surface, and when they did that there was a big lound boom and crash. Differential pressure caused the inner door to blow off the medical lock. They think the door actually struck the other side of the chamber. Trying to duplicate the incident on similar chamber in GoM. Only blowing the O-ring so far, so theory is besides operator error, the dog probably shook loose during long transport. No injuries and procedures and training are being reviewed. Note-inner door assembly was provided by the chamber manufacturer.
	2 GoM 2 Office/Warehouse	Non-Diving	Equipment Damage	Near Miss	Diving Equipment Personnel	Topside	around pipe. When offshore in CA and cycling medical lock to check chamber, opened the outer door and made sure no leaks coming from inner door. None, so they closed medical lock back up. There is a valve on the medical lock where a piece of tubing goes to a hull valve to be able to control from topside. Pressured up medial lock and checked outer door for leaks and went about their business. Continuing investigation shows they should not have left it pressure up but should have bled it off. Medical lock pressurized, then internal checks on chamber started. Brought outer lock to surface and went to hit crossover valve to bring the inner lock to surface, and when they did that there was a big lound boom and crash. Differential pressure caused the inner door to blow off the medical lock. They think the door actually struck the other side of the chamber. Trying to duplicate the incident on similar chamber in GoM. Only blowing the O-ring so far, so theory is besides operator error, the dog probably shook loose during long transport. No injuries and procedures and training are being reviewed. Note-inner door assembly was provided by the chamber manufacturer. Probably had 10# of pressure on it at time of incident. Double check chambers for safety, especially after transport. Near miss topside. All stop called. Some pipe in yard had come back from Guantanamo Bay in Cuba. Pipe was to be recoated. Ops. Mgr. came out and noticed piepes were located next to the rack. Workers were grinding and sparks were flying near O2. It was basically hot work; make sure all safety protocols are followed and understood with everyone involved.
						Topside	around pipe. When offshore in CA and cycling medical lock to check chamber, opened the outer door and made sure no leaks coming from inner door. None, so they closed medical lock back up. There is a valve on the medical lock where a piece of tubing goes to a hull valve to be able to control from topside. Pressured up medial lock and checked outer door for leaks and went about their business. Continuing investigation shows they should not have left it pressure up but should have bled it off. Medical lock pressurized, then internal checks on chamber started. Brought outer lock to surface and went to hit crossover valve to bring the inner lock to surface, and when they did that there was a big lound boom and crash. Differential pressure caused the inner door to blow off the medical lock. They think the door actually struck the other side of the chamber. Trying to duplicate the incident on similar chamber in GoM. Only blowing the O-ring so far, so theory is besides operator error, the dog probably shook loose during long transport. No injuries and procedures and training are being reviewed. Note-inner door assembly was provided by the chamber manufacturer. Probably had 10# of pressure on it at time of incident. Double check chambers for safety, especially after transport. Near miss topside. All stop called. Some pipe in yard had come back from Guantanamo Bay in Cuba. Pipe was to be recoated. Ops. Mgr. came out and noticed piepes were located next to the rack. Workers were grinding and sparks were flying near O2. It was basically hot work; make sure all safety protocols are followed and understood with everyone involved. Boat crew member experienced fatigue; had been working too hard for too long, became
						Topside	around pipe. When offshore in CA and cycling medical lock to check chamber, opened the outer door and made sure no leaks coming from inner door. None, so they closed medical lock back up. There is a valve on the medical lock where a piece of tubing goes to a hull valve to be able to control from topside. Pressured up medial lock and checked outer door for leaks and went about their business. Continuing investigation shows they should not have left it pressure up but should have bled it off. Medical lock pressurized, then internal checks on chamber started. Brought outer lock to surface and went to hit crossover valve to bring the inner lock to surface, and when they did that there was a big lound boom and crash. Differential pressure caused the inner door to blow off the medical lock. They think the door actually struck the other side of the chamber. Trying to duplicate the incident on similar chamber in GoM. Only blowing the O-ring so far, so theory is besides operator error, the dog probably shook loose during long transport. No injuries and procedures and training are being reviewed. Note-inner door assembly was provided by the chamber manufacturer. Probably had 10# of pressure on it at time of incident. Double check chambers for safety, especially after transport. Near miss topside. All stop called. Some pipe in yard had come back from Guantanamo Bay in Cuba. Pipe was to be recoated. Ops. Mgr. came out and noticed piepes were located next to the rack. Workers were grinding and sparks were flying near O2. It was basically hot work; make sure all safety protocols are followed and understood with everyone involved.

have five the property of the			ı		T			
Non-During None Near Miss 1/15/2022 National Non-During None None Near Miss 1/15/2022 National None None None Near Miss 1/15/2022 National None None None None None None None None	1/19/2022	GoM	Non-Diving	None	Near Miss	Personnel	Topside	Tender out on back deck while vessel in transit in the yellow area without life jacket on. Sent to do task and had another tender with him, captain unaware. Reprimanded Lead Tender and
1/19/2022 lealand Non-Diving None Near Miss Diving Caripment Fopalde These titings should be rosed and addressed form by they become an accident or injuny. 1/19/2022 lealand Non-Diving Arm Impury Next Aid Other Equipment Copaide Section of the Propose None Section (Institute of the Section								heater, but failed to tell deckhand if waited too long to start, it can flame up. Too much time elapsed, and when heater started the fuel caught and fire blew out top of heater. No one was hurt.
1/19/2007 Inland Note During Am Injury Am	1/19/2022	Inland	Non-Diving	None	Near Miss	Diving Fauinment	Topside	
1/19/2022 International TBD Non-Diving Single Fatality Patality Other Equipment Topide versus renote equipment. This must be addressed topida as well as in elving conditions. 1/19/2022 GoM Diving None Near Miss Operational Control Air Diving Own Single Fatality Single Fatality Own Sin						5		Popped line topside when lifting pipe. Poly rope snapped back and hit worker in arm. First aid treatment and worker was fine, but crew made comment that they pop lines all the time. This
Divers directed by Supervisor and Clinn Rep to move rigging on spool piece of floating production platform about # "while spool was being placed to avoid sling landing on portion clinary. Continued work and when spool get down it stammed into the platform, Sool sharing around and pushed diver off pontoon. Diver not figured, but could have been deadly. Classified as a serious near miss. Incorrect camping complex of pontoon. Diver not figured, but could have been deadly. Classified as a serious near miss. Incorrect camping complex ponton continue workings and greated when it should have been deadly. Classified as a serious near miss. Incorrect camping complex ponton continue workings and greated when it should have been all slot part of MCC (lent Rep's verbal of to continue workings and greated when it should have been and all Stop and MCC implemented. Divers were rigging unkneh barse for III. Barge did not come of bottom at proper orientation so diver were the stock down to burn another raging he lost have barge. Burning new riggine, holes devire had been been so that the proper orientation so diver were thought to how back soc communications. Topicite public him up and had remodern J DCS. Design to the barge society and characteristic power had been been soon and the proper orientations of divers were sugging unkneh barge for III. Barge did not come of bottom at proper orientation so divers were the stopped orientations. In the proper orientation so divers were the barge. Burning have been been so deal the proper orientation so divers the barge. Burning have been so deal they develor had developed decreased the proper orientation so developed decreased in the proper orientation so developed decreased and handle received to the proper orientation so developed decreased and handle received to the proper orientation so developed decreased and handle received to the proper orientation so developed decreased and handle received to the proper orientation so developed decreased and handle received to the proper orien								repair. Cutting with a power tool topside, pipe sprung back, struck worker and killed him. Always be aware of potential stored energy in pipes, particularly when a person is cutting or working on them
platform about 5° while spool was being placed to avoid single panding on pontoon ciams. Continued work and when spool got down its abmend into the platform. Spool swung around and published diver off pontoon. Diver not injured, but could have been deady. Classified as a serious near miss. Increaced clamp location on drawings, MOC process failed as it was not implemented. Supervisor took Client Reps variable to continue working as directed when it should have been an All Stop and MOC implemented. 1/16/2019 GoM Oving Single Fatality Fatality Diving Equipment Air Diving Over when the stop of the process of the stop of the s	1/19/2022	International TBD	Non-Diving	Single Fatality	Fatality	Other Equipment	Topside	versus remote equipment. This must be addressed topside as well as in diving conditions.
1/16/2019 GoM Diving Single Fatality Fatality Diving Equipment Air Diving 70 recompress at hospital diver dies in transport. Don't know about styl diver and chamber footation. **Province of the province of								platform about 6" while spool was being placed to avoid sling landing on pontoon clamp. Continued work and when spool got down it slammed into the platform. Spool swung around and pushed diver off pontoon. Diver not injured, but could have been deadly. Classified as a serious near miss. Incorrect clamp location on drawings, MOC process failed as it was not implemented. Supervisor took Client Rep's verbal ok to continue working as directed when it should have been an All Stop and
diver went back down to burn another rigging hole in barge. Burning new rigging holes diver had blow back lots communications. Topside pulled him up and had Embolism / DCS. Decision to blow back lots communications. Topside pulled him up and had Embolism / DCS. Decision to low back lots communications. Topside pulled him up and had Embolism / DCS. Decision to low back lots communications. Topside pulled him up and had Embolism / DCS. Decision to low back lots communications. Topside letter motor on ROV, no gloves acting alone no SA. The motor weight twas 300 ib. Individual moving mont down starts infragerity cut of between motor and grating on steps. Diving on outfall no chamber on location. Diver surfaced and developed decompression sickness. No chamber on site no emergency plan. Diver was brought to Santa Barbara City College for treatment, only they cannot treat aft apraty riders. Dower than brought had 6 treatment and the surface of the developed decompression sickness. No chamber on site no emergency plan. Diver was brought to santa Barbara City College for treatment, only they cannot treat aft apraty riders. Dower than the treatment of the surface of	1/19/2022	GoM	Diving	None	Near Miss	Operational Control	Air Diving	
12/22/2018 GoM Non-Diving Hand Injury Recordable Incident Personnel Topside On SEps. 12/22/2018 GoM Diving Illness Recordable Incident Operational Control Operation								diver went back down to burn another rigging hole in barge. Burning new rigging holes diver had blow back lost communications. Topside pulled him up and had Embolism / DCS. Decision to
12/22/2018 GoM Non-Diving Hand Injury Recordable Incident Personnel Topside Topside Topside On steps.	1/16/2019	GoM	Diving	Single Fatality	Fatality	Diving Equipment	Air Diving	
Diving on outfall no chamber on location. Diver surfaced and developed decompression sickness. No chamber on site on emergency plan. Diver surfaced and developed decompression sickness. No chamber on site on emergency plan. Diver was brought to Santa Barbar City College for treatment, only they cannot treat 3rd party divers. Diver then brought to shorts abrara City College for treatments and it. nk. 12/22/2018 Facility Single Fatality Fatality Personnel SCUBA Mexico. Female diver on dredge utilizing sport hookah. No more info. Spud barge unable to get close enough to worksite for a down line to run tools. Diver came to surface to get tools about 12 times dabout 12 times dabou	12/22/2018	GoM	Non-Diving	Hand Injury	Recordable Incident	Personnel	Topside	weight was 300 lb. Individual moving motor down stairs fingertip cut off between motor and grating
12/22/2018 GoM Diving Illness Recordable Incident Operational Control South Personnel SCUBA Mexico. Female diver on dredge utilizing sport hookah. No more info. 12/22/2018 Pacific Ocean Diving Single Fatality Fatality Personnel SCUBA Mexico. Female diver on dredge utilizing sport hookah. No more info. Spud barge unable to get close enough to worksite for a down line to run tools. Diver came to surface to get tools about 12 times during 2, hour bottom time. Upon completion of dive when diver surfaced he had eye irritation. Diver was transported to see Dr. Serio, told to go to eye doctor. Dr. Serio reconsidered and had diver recompressed. Once back under pressure all symptoms went away. 12/22/2018 GoM Diving None Near Miss Personnel Saturation 11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving 10 Diver so billow whip was too long and snagged on a ladder under compressure of the first stage regulator. 11/14/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's billout whip was too long and snagged on a ladder under composed on a ladder of the first stage regulator. 11/14/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside Stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside medivac plan in place. 10 Diver unbiblical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6				1 .			•	Diving on outfall no chamber on location. Diver surfaced and developed decompression sickness. No
12/22/2018 GoM Diving Illness Recordable Incident Operational Control Single Fatality Fatality Personnel SCUBA Mexico. Female diver on dredge utilizing sport hookah. No more info. Spud barge unable to get close enough to worksite for a down line for un tools. Diver came to surface to get tools about 12 times during 2-hour bottom time. Upon completion of dive when diver surfaced he had eye irritation. Diver was transported to see Dr. Serio, told to go to eye doctor. Dr. Serio reconsidered and had diver recompressed. Once back under pressure all symptoms went away. 12/22/2018 GoM Diving Eye Injury Personnel Air Diving 12/22/2018 GoM Diving None Near Miss Personnel Saturation 11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's ballout whip was too long and snagged on a ladder upon returning from a dive. Near Whip, post dive whip blew off of hair Mitting as under the Diver whip blew off of hair Mitting is under the diver was published and even the sat technical in the dive control was also left on during the bell run. Near Whip, post dive whip blew off of hair Mitting attendance of the diver whip is too long and snagged on a ladder upon returning from a dive. Near Whip, post dive whip blew off of hair Mitting early greated and diver upon returning from a dive. Near Whip, post dive whip blew off of hair Mitting early greated and diverse returning from a dive. Near Whip, post dive whip blew off of hair Mitting early great fast and went into cardiac arrest-was stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside Sown and that the vessel owner did not have a response covered medivar, but making the post of a stroke-after researching, it was found that the vessel owner did not have a response covered medivar, but multiple and pace. Non-Diving Heart Issue Recordable Incident Personnel Topside Diver with blinded was caught by mantary-diver climbed his hose and finally got loose. Went table 6								
12/22/2018 Pacific Ocean Diving Single Fatality Fatality Personnel SCUBA Mexico. Female diver on dredge utilizing sport hookah. No more info.	12/22/2010	GoM	Diving	Illnoss	Pocordable Incident	Operational Control		only they cannot treat 3rd party divers. Diver then brought to hospital where diver had 4 treatments
Spud barge unable to get close enough to worksite for a down line to run tools. Diver came to surface to get tools about 12 times during 2-hour bottom time. Upon completion of dive when diver surfaced he had eye irritation. Diver was transported to see Dr. Serio, told to go to eye doctor. Dr. Serio reconsidered and had diver recompressed. Once back under pressure all symptoms went away. 12 All the up and down caused the DCS. During a saturation bell run, the saturation technician inadvertently began coming up on the bell winch before the diver was still standing on the clump weight frame. Miscommunication due to lack of clear, two-way communications between the sat tech and diving supervisor over a VHF radio. 11/18/2018 GoM Diving None Near Miss Personnel Saturation Additionally, the bell winch override switch in the dive containing the bell run. 11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's bailout whip was too long and snagged on a ladder upon returning from a dive. New whip, post dive whip blew off of hat fitting. Investigation uncovered a bad crimp and pressure 11/14/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside Stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside Stoke-after researching, it was found that the vessel owner did not have a response covered medivacy also all the vessel owner did not have a response covered medivacy plan to place. Diver umbilitical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6						<u> </u>	SCLIBA	Mayico, Female diver on dredge utilizing sport hookah. No more info
surface to get tools about 12 times during 2-hour bottom time. Upon completion of dive when diver surfaced he had eye irritation. Diver was transported to see Dr. Serio, told to go to eye doctor. Dr. Serio reconsidered and had diver recompressed. Once back under pressure all symptoms went away. 12/22/2018 GoM Diving Eye Injury Personnel Air Diving 12 All the up and down caused the DCS. During a saturation bell run, the saturation technician inadvertently began coming up on the bell winch before the diver was still standing on the clump weight frame. Miscommunication better too lack of clear, two-way communications between the satt tech and diving supervisor over a VHF radio. Additionally, the bell winch override switch in the dive control was also left on during the bell run. 11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's bailout whip was too long and snagged on a ladder upon returning from a dive. Non-Diving None Near Miss Diving Equipment Air Diving 100 Sex with the first stage regulator. A marrine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Illness First Aid Personnel Topside 16 people were transported in with the fivs symptoms from offshore platform. Medivac was called from a third party charter vessel, employee (marrine crew member) had signs of a stroke-after researching, it was found that the vessel owner did not have a response covered medivac plan in place. Diver umblical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6	12/22/2018	racilic Ocean	Diving	Single Facality	i atality	reisonnei	JCOBA	
Serio reconsidered and had diver recompressed. Once back under pressure all symptoms went away. 12/22/2018 GoM Diving Eye Injury Personnel Air Diving Diving a saturation bell run, the saturation technician inadvertently began coming up on the bell winch before the diver was still standing on the clump weight frame. Miscommunication due to lack of clear, two-way communications between the sat tech and diving supervisor over a VHF radio. 11/18/2018 GoM Diving None Near Miss Personnel Saturation Additionally, the bell winch override switch in the dive control was also left on during the bell run. 11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving None Non-Diving None Near Miss Diving Equipment Air Diving None Non-Diving None Non-Diving None Near Miss Diving Equipment Air Diving None Non-Diving								
11/18/2018 GoM Diving Eye Injury Personnel Air Diving 12 All the up and down caused the DCS. Air Diving Saturation bell run, the sturation technician inadvertently began coming up on the bell winch before the diver was still standing on the clump weight frame. Miscommunication due to lack of clear, two-way communications between the sat tech and diving supervisor over a VHF radio. 11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's ballout whip was too long and snagged on a ladder upon returning from a dive. 11/14/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's ballout whip was too long and snagged on a ladder upon returning from a dive. New whip, post dive whip blew off of hat fitting. Investigation uncovered a bad crimp and pressure in the first stage regulator. SoM Non-Diving Heart Issue Recordable Incident Personnel Topside Significant of the first stage regulator. Amarine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was stallized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside Significant Significant								, , , , , , , , , , , , , , , , , , , ,
During a saturation bell run, the saturation technician inadvertently began coming up on the bell winch before the diver was still standing on the clump weight frame. Miscommunication due to lack of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way communications between the sat tech and diving supervisor over a VHT read of clear, two-way control tech and diving supervisor over a VHT read of clear, two-way control to a divine to he divine the filt run, the saturation of clear, two-way control the tot and diving supervisor over a VHT read of clear, two-way control the follow-way control to he divine the filt volves of the divine the filt volves of the filt volves of the filt volves of the filt volves of the filt value of the filt va	12/22/2018	GoM	Diving	Eve Injury		Personnel	Air Diving	
of clear, two-way communications between the sat tech and diving supervisor over a VHF radio. 11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's bailout whip was too long and snagged on a ladder upon returning from a dive. New whip, post dive whip blew off of hat fitting. Investigation uncovered a bad crimp and pressure 11/14/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 issue with the first stage regulator. A marine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Illness First Aid Personnel Topside 16 people were transported in with the flu symptoms from offshore platform. Medivac was called from a third party charter vessel, employee (marine crew member) had signs of a stroke-after researching, it was found that the vessel owner did not have a response covered medivac plan in place. Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6	12/22/2010	GOIVI	Diving	Lye injury		rersonner	All Divilig	
11/18/2018 GoM Diving None Near Miss Personnel Saturation Additionally, the bell winch override switch in the dive control was also left on during the bell run. 11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's bailout whip was too long and snagged on a ladder upon returning from a dive. New whip, post dive whip blew off of hat fitting. Investigation uncovered a bad crimp and pressure in 1/14/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 issue with the first stage regulator. A marine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Illness First Aid Personnel Topside 16 people were transported in with the flu symptoms from offshore platform. Meditionally, the bell winch override switch in the dive control was also left on during the bell run. New whip, post dive whip blew off of hat fitting. Investigation uncovered a bad crimp and pressure in 100 issue with the first stage regulator. A marine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Illness First Aid Personnel Topside 16 people were transported in with the flu symptoms from offshore platform. Meditace are searching, it was found that the vessel owner did not have a response covered medivac plan in place. Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6								
11/18/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 Diver's bailout whip was too long and snagged on a ladder upon returning from a dive. New whip, post dive whip blew off of hat fitting. Investigation uncovered a bad crimp and pressure 11/14/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 issue with the first stage regulator. A marine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Illness First Aid Personnel Topside 16 people were transported in with the flu symptoms from offshore platform. Medivac was called from a third party charter vessel, employee (marine crew member) had signs of a stroke-after researching, it was found that the vessel owner did not have a response covered medivac plan in place. Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6								
New whip, post dive whip blew off of hat fitting. Investigation uncovered a bad crimp and pressure 11/14/2018 GoM Diving None Near Miss Diving Equipment Air Diving A marine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was A marine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was Stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Non-Div				+	1			······································
11/14/2018 GoM Diving None Near Miss Diving Equipment Air Diving 100 issue with the first stage regulator. A marine vessel person fell out of chair while eating breakfast and went into cardiac arrest-was stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Illness First Aid Personnel Topside Stabilized and sent in for further medical help, survived heart attack. 16 people were transported in with the flu symptoms from offshore platform. Medivac was called from a third party charter vessel, employee (marine crew member) had signs of a stroke-after researching, it was found that the vessel owner did not have a response covered medivac plan in place. Personnel Topside Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6	11/18/2018	GOIVI	DIVING	ivone	inear Miss	DIVING Equipment	Air Diving	
9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Illness First Aid Personnel Topside 16 people were transported in with the flu symptoms from offshore platform. Medivac was called from a third party charter vessel, employee (marine crew member) had signs of a stroke-after researching, it was found that the vessel owner did not have a response covered medivac plan in place. Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6	11/14/2018	GoM	Diving	None	Near Miss	Diving Equipment	Air Diving	
9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside stabilized and sent in for further medical help, survived heart attack. 9/19/2018 GoM Non-Diving Illness First Aid Personnel Topside 16 people were transported in with the flu symptoms from offshore platform. Medivac was called from a third party charter vessel, employee (marine crew member) had signs of a stroke-after researching, it was found that the vessel owner did not have a response covered medivac plan in place. Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6	11,17,2010	33141	5.41118		1.1541 111133	2 Edarbilicut	, Sitnig	
9/19/2018 GOM Non-Diving Illness First Aid Personnel Topside 16 people were transported in with the flu symptoms from offshore platform. Medivac was called from a third party charter vessel, employee (marine crew member) had signs of a stroke-after researching, it was found that the vessel owner did not have a response covered medivac plan in place. Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6	9/19/2018	GoM	Non-Diving	Heart Issue	Recordable Incident	Personnel	Topside	
9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside stroke-after researching, it was found that the vessel owner did not have a response covered medivac plan in place. Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6			Non-Diving	Illness	First Aid	Personnel	Topside	16 people were transported in with the flu symptoms from offshore platform.
9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside medivac plan in place. Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6								
Diver umbilical was caught by manta ray-diver climbed his hose and finally got loose. Went table 6								· · · · · · · · · · · · · · · · · · ·
	9/19/2018	GoM	Non-Diving	Heart Issue	Recordable Incident	Personnel	Topside	
	9/19/2019	GoM	Diving	None	Near Miss	Environment	Air Diving	
9/19/2018 GoM Non-Diving Heart Issue Recordable Incident Personnel Topside Crane operator not feeling well, was treated and removed off vessel. Had heart attack at hospital.								

							Potential decompression sickness incident was reported. Vessel was brought in and diver
0/40/2040	6-14	Distant		December to delegate	D	Air Divis	transported to West Jeff Medical Center in New Orleans. Analzyed and treated as a squeeze and
9/19/2018	GOM	Diving	Illness	Recordable Incident	Personnel	Air Diving	42 recovered.
9/19/2018	GoM	Diving	None	Near Miss	Other Equipment	Air Diving	110 DP system on vessel froze (went black and diver was recovered-decompreessed for 10 mins).
3, 13, 2010	00111	Diving.	None	14641 141133	other Equipment	7 til Diving	Diver bruised shin on project and reported later when injury became severe and needed antibiotics
9/19/2018	GoM	Diving	Leg Injury	Recordable Incident	Personnel	Air Diving	Did not adhere to JSA on reporting incidents.
		- J					
9/19/2018	GoM	Diving	Leg Injury	Restricted Duty	Personnel	Air Diving	7 Tender had swelling of leg-didn't report until 36 hours of incident and finally was taken off of job.
9/19/2018	Inland	Diving	Not Defined	Near Miss	Personnel		200 Diver was pinned by underwater saw that shifted during project.
							Working pipeline repair leak with diver in water started feeling burning sensation. Pulled out of
9/19/2018		Diving	Chemical Exposure	First Aid	Other Equipment	Air Diving	10 water and after few minustes starting chemical first degree from condensate, not from pipeline.
9/19/2018		Non-Diving	Vessel Damage	Property Damage	Other Equipment	Office/Warehouse	Industrial fire on dive vessel at shipyard during repairs and upgrades.
9/19/2018	GoM	Diving	None	Near Miss	Environment	Air Diving	10 Alligator Hazard-Animal would not leave work area. Pre-job planning-decided not to go in decompression-had an alarm go off on platform and diver wa
9/19/2018	GoM	Diving	None	Near Miss	Personnel	Air Diving	50 brought up to muster station (8 minutes-total time to get diver out of water to muster station).
9/19/2016	GOIVI	Diving	None	ivedi iviiss	reisonnei	All Divilig	Third party tug boat crew moving anchors-flat calm weather-had SSE on back deck who tried to stop
9/19/2018	GoM	Non-Diving	Hand Injury	Recordable Incident	Personnel	Topside	anchor wire with bare hands and lost tip of finger (lack of experience).
3/13/2010	GOIVI	IVOIT DIVING	Tidila injury	necordable incident	reisonner	Topside	Third party vessel re-hired from being stacked-discovered water system was contaminated and had
							to redo filtration (after filter test) of water system on the vessel. Went through proper standard
9/19/2018	GoM	Non-Diving	Vessel Damage	Property Damage	Other Equipment	Topside	CMID inspection prior to going on hire.
3/ 13/ 2010		itton string	vesser sumage	Troporty Samage	other Equipment	. opside	Surface dive-working on deck-blind flange being removed-a pin hole leak was identified in High
9/19/2018	GoM	Diving	None	Near Miss	Diving Equipment	Topside	pressure tensioning hose and issue mitigated.
		- u			0 1 1	·	Third part vessel company provide surface umbilical management system (SUMS) drawings for a
9/19/2018	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	LARS that were not accurate-off 1 meter.
							Subsea project-water depth 72' but working 4500' of water threaded lifting eye came out of a tension
9/19/2018	GoM	Non-Diving	None	Property Damage	Other Equipment	Air Diving	72 that wasn't rated for the intended load. Stripped out threads.
							UW inspection on a jacket. HP water jet, retro nozzle came loose, diver noticed a small injection
5/16/2018	GoM	Diving	None	Near Miss	Other Equipment	Air Diving	injury. Diver ok after medical review.
5/16/2018	GoM	Non-Diving	None	Near Miss	Diving Equipment	Topside	Saturation system leaking port. Incorrect installation.
							Snatch block being de-rigged, entire assemble fell 20ft (42 lbs), serious near miss. Possible missing
5/16/2018	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	retaining pin.
							Serious near miss on significant load, pinch/crush point lead to injury but could easily have been a
5/16/2018		Non-Diving	None	Near Miss	Other Equipment	Topside	fatality.
5/16/2018	GoM	Non-Diving	Vessel Damage	Property Damage	Other Equipment	Topside	Load drop spool piece, tugger unspooled dropped load 4,000ft.
F /1 C /2010	C-M	Divises	Nama	Naga Maiga	Divine Ferriement	Tanaida	Incident regarding communication and miscommunications during SIMOPS with lifts and divers.
5/16/2018	GOIVI	Diving	None	Near Miss	Diving Equipment	Topside	Used different radio channels, communication plans, no direct incident but many job delays. Ship husbandry job on ship at anchorage off smaller boat. Tide/current changed diver's umbilical
5/16/2018	GoM	Diving	Illness	Recordable Incident	Environment	Air Diving	fouled on boulders. Dive hose parted, diver recovered days later.
3/10/2018	GOIVI	Diving	lilless	Recordable ilicidelit	Environment	All Divilig	LFI-riser replacement in shallow water. Jetting and air lifting around rip-wrap, struck by shifting roc
							Restricted duty release. RCA performed-PPE-glove selection and reviewed air lift construction.
							Moved hand holds from 3-9 to 5-7 closer to the diver in his zone of control. Also, hand guards
5/16/2018	GoM	Diving	Hand Injury	Restricted Duty	Other Equipment	Air Diving	installed.
3/10/2010	00111	Diving	Tidita injury	nestricted buty	Other Equipment	7 til Diving	
							LFI-near miss-equipment submersible pump to jet pump. Lifting pump 30ft high, 6" hose uncoupled
							and fell to deck. Hose weight about 100lbs. Upon investigation, only 2-3 threads were secured prip
							to lifting. Reconnected and a piece of rope used as a field-expedient safety device. Replaced with
							soft sling as a strain relief. Duct taped all cam connections. Supplier all connections shall have asse
							numbers and installation/inspection sheets for the equipment, including a marking line once the
5/16/2018	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	equipment is assembled at the shop.
							ROV crew member-working on a jack up vessel in the North Sea-crew member was lowering a
							submersible pump in a hatch way, pump became lodged/hung on something and a strap broke and
							pump fell. Worker was killed when strap wrapped around his foot and pulled him down. A new
3/21/2018	North Sea	Non-Diving	Single Fatality	Fatality	Other Equipment	Topside	product (strap) was mesh was being used.
							LARS returned from another country with issues to address. A proposal was made on requirements
							of a LARS system-there is a lack of knowledge about certifications, maintenance procedures,
							modifications to keep up standard, etca recent survey showed a fatality per year pertaining to LAF
3/21/2018	North Sea	Non-Diving	None	Near Miss	Other Equipment	Office/Warehouse	operations worldwide.
							Crew member in early 30's had flu-like symptoms on vessel and did not report. He was sent onshort
2/2:/22:-							when health declined and went to see family doctor. He was put in ICU and had serious
3/21/2018	GOIVI	Non-Diving	Illness	Restricted Duty	Personnel	Topside	complications, treated and released.

		1						Rigging and lifting incident share-several near misses and potential incidents-Non standarded rigging
3/21/2018	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside		being used.
11/15/2017		Diving	Hand Injury	First Aid	Environment	Air Diving		Diver was on a scrapping project and was moving old tire and received a bite.
11/13/2017	COIVI	DIVING	Tidila injury	THISCAIG	Livironinene	All DIVING		Incident with a coating contractor-worker was transferring from platform and reached out, fell into
								pipe and had issues in rib area. After visit to ER-there was a difference in a diagnostic review of X-
11/15/2017	GoM	Non-Diving	Back Injury	Recordable Incident	Personnel	Topside		Ray, which caused issue with recording the incident
11/13/2017	CONT	Tron Biring	Buck Hijuly	necordable meldent	rersonner	Topside		Non-diving property incident at office-electrical feed from main line to office area had issues that
11/15/2017	Office/Warehouse	Non-Diving	Facility Damage	Near Miss	Other Equipment	Office/Warehouse		added hazards to the area.
==,==,===					- Carrette			Diving incident-(not recordable or first aid)-diving in NE area of US-working in river section in a
								downtown area. While removing pilings on a river project, working at low tide, divers were walking
								in shallow water. A few days later, three divers reported itches from bites from wildlife parasites
11/15/2017		Diving	Rash	First Aid	Environment	Air Diving		(duck itch) infection-needed treatment
•								Diver in water-flusing a pipeline on a subsea assembly and during diver switch out, he was put in
11/15/2017	GoM	Diving	Rash	First Aid	Environment	Saturation		ditch area and developed an itch in the groin area from irritation.
								Facility incident-office shop located in area near chemical plant-company had two shop hands feeling
11/15/2017	Office/Warehouse	Non-Diving	Chemical Exposure	Near Miss	Environment	Office/Warehouse		nauseous-odors from plant affected the workers
	·	İ	·					Removing a production jacket-after a walkthrough by group of workers, a welder was walking down
								a walkway-on grading that was just installed and not properly secured, a welder fell through the
11/15/2017	GoM	Non-Diving	Back Injury	Recordable Incident	Other Equipment	Topside		grading.
								Diver was working in 12ft of water, had to dig to 10ft deep to locate pipeline-job turned into a deep
								ditch scenario. Once job was completed, jackup vessel's leg was stuck in mud and a diver was sent
								down to jet out lef for the jack up boat. Diver got stuck in ditch and had to send a second diver to go
11/15/2017	GoM	Diving	None	Near Miss	Environment	Air Diving	12	in to get him out.
								Salvaging a jacket in 60ft water, company cut jacket in half to assist lifting. Weather came up and
11/15/2017	GoM	Non-Diving	Vessel Damage	Recordable Incident	Weather	Topside	60	pushed barge into jacket and sunk barge.
								Platform evacuated in middle of night-30' pig launcher had an explosion-two injuries-under
11/15/2017	GoM	Non-Diving	Chemical Exposure	Recordable Incident	Other Equipment	Topside		investigation.
								IMCA document released regarding survey issues-concerned divers might be possibly affected by
11/15/2017	GoM	Diving	None	Near Miss	Other Equipment			sound waves from multi beam sonar apparatus.
								Diver was performing inspection and a manta ray hooked on him and moved him. Had to mitigate at
11/15/2017	GoM	Diving	None	Near Miss	Environment		180	sight to protect diver.
								Supply vessel working offshore had a spool piece in a connex box. Crane was lifting box and was
								caught while being lifted. Spool piece rolled, busted through door and fell 8ft to deck causing
11/15/2017	GoM	Non-Diving	Vessel Damage	Recordable Incident	Other Equipment	Topside		damage (weight of spool 1500lbs).
								Mussel relocation in midwest for scientific company in shallow water with lots of current. Took
								tender and tied him to structure to overcome current. At 4 hour mark, tender passed out (heat
								exhaustion) and dropped face forward and ran into diver. Pulled him out and did CPR and call
9/20/2017	GoM	Diving	Heat Exhaustion	Recordable Incident	Weather	Air Diving	6	ambulance. Taken to hospital and was at work the next day.
- / /								Team of 9 deployed to Mexico for mud mat project with new vessel and mixed languages amongst
9/20/2017		Non-Diving	None	Near Miss	Personnel	Topside		crew. All stop was called by employee due to being unsafe.
0/00/00/-						200 411		Employee removing a manhole cover with manlift. When cover became loose, it caused the
9/20/2017		Non-Diving	Head Injury	Recordable Incident	Other Equipment	Office/Warehouse		operator to fall 25ft and is in a coma.
0/20/20:=	C-M	Non-Bird	None	N	Out Facility	T		Dropped object while transferring bottle rack from platform to vessel. Rigging person notice a
9/20/2017	GOIVI	Non-Diving	None	Near Miss	Other Equipment	Topside		crescent wrench in the skid.
								Traveling crew change incident-a trailer loaded with personnel gear became undone and hit back of
7/10/2017		Non Divine	Equipment Desses	Droporty Dorosa	Other Farriament	Othor		vehicle pulling it. The hitch pin came out of the trailer hitch and trailer broke back glass. Weak pin in
7/19/2017		Non-Diving	Equipment Damage	Property Damage	Other Equipment	Other		hitch. Worker was working off site trying to remove a man hole cover on location. Tried using an electric
				1				winch and cound not break it free. Then used hydraulic lift unit and got in bucket. The force of the
								cover becoming free forced him out of bucket, fell to ground and received severe head injuries. Sent
7/10/2017		Non Diviso	Hood Injury	Boordoble Incident	Darcannal	Office /Marchaus		
7/19/2017		Non-Diving	Head Injury	Recordable Incident	reisonnei	Office/Warehouse		to hospital.
								Facility forklift operator was unloading equipment using forks to unload under frame of the
				1				equipment. All stop was directed, but operator did not hear and did not stop, damaging equipment.
7/10/2017	Office/Warehouse	Non-Diving	Facility Damage	Property Damage	Personnel	Office/Warehouse		Operator had ear buds in (listening to music) and did not hear alert.
7/13/2017	Office/ waleflouse	I MOII-DIVIIIR	r actificy Dalliage	Troperty Damage	i ersonner	Office/ wateriouse		Operation had ear buds in firstening to music, and did not field dieft.
				1				Working in Korea, diver was on semi-submersible in port using dry suit. Diver became fouled and
								inflated suit in attemp to get free. During attempt to become free, diver made rapid ascent to
								surface developing DCI symptoms but was not treated in a decompression chamber for reasons
								unknown. The IP became unconscious and evacuated to hospital with no hyperbaric capabilities.
7/19/2017		Diving	Illnoss	Pocordable Incident	Parcannal	Air Diving	40	Then transfered to hospital with capabilities. Condition of diver unknown.
//19/201/		Diving	Illness	Recordable Incident	Le soumer	Air Diving	40	men dansiered to nospital with capabilities. Condition of diver unknown.

							Diving operations at wind farm offshore-concrete mat was being set and mat was set on a diver who
7/19/2017		Diving	Single Fatality	Fatality	Operational Control	Air Diving	died.
							SAT diver in SAT for 3 days-started to develop a dry cough. After a few days, it worsened then diver
							developed laryngitis. Doctor was called in and decompressed diver, treated fro cough-no other
7/19/2017	GoM	Diving	Illness	First Aid	Personnel	Saturation	issues.
1, 20, 202		8					
							Quality control issue. Identified web slings labeled as 4" but were tagged as 3", 3 ply slings-
7/19/2017	Office/Warehouse	Non-Diving	None	Near Miss	Personnel	Office/Warehouse	difference in slings capacities were 3,000 lbs. Removed before being put into service.
7/13/2017	office, warehouse	Iton Diving	Tronc	rear iviiss	i croonner	Office/ Warehouse	On a recent site visit-the diving site ops doing inspection work with an aluminum skiff, tied up to
							dock with 3 man dive team working with big life jackets on. Multiple issues with worksite safety
5/17/2017	GoM	Diving	None	Near Miss	Personnel	Air Diving	management and small vessles issues.
3/17/2017	GOIVI	Diving	IVOITE	INCALIVII33	rersonner	All Divilig	management and small vessies issues.
							Power line sagged and hit company electrical line, causing damage to business (electrical and server
5/17/2017	Office/Warehouse	Non-Diving	Facility Damage	Property Damage	Other Equipment	Office/Warehouse	and shut shop down for appox. 36 hours. Review your business continuity plan.
3/17/2017	Office/ wareflouse	Non-Diving	I actiffy Darriage	Froperty Damage	Other Equipment	Office/ Wateriouse	Recent issues with malware and ransonware withing businesses. Information updates sent out.
F/17/2017	Office /Warehouse	Non Diving	Facility Damage	Dranarty Damaga	Other Fauinment	Office /Marchause	
5/17/2017	Office/Warehouse	Non-Diving	Facility Damage	Property Damage	Other Equipment	Office/Warehouse	Look at cyber insurance for protection.
F /47/2047	C-M	Nan Birina	None	Nia a a Nation	D	Toroitale	For the control of th
5/17/2017		Non-Diving	None	Near Miss	Personnel	Topside	Employee working an anchor wire and wire jumped out of sheave. Not using right tool for job.
5/17/2017	GOIVI	Diving	None	Near Miss	Diving Equipment	Air Diving	Pneumo hose leaking-was inspected and check before dive-all stop called to repair.
E /47 /22 / =	latara de la constitución de la	Di dia	Name	No and Adi	Other Fr. 1		Overseas pipeline was being worked on and the pipeline had lock out/tag out prior to start. Pipeline
5/1//2017	International TBD	Diving	None	Near Miss	Other Equipment	+	had a large release of gas-dviers were working during gas release.
							Vessel was doing subsea related work-adjusting a seal on end connector. Connector was a bit top
							heavy was set to be installed. Unit was chained on deck, during adjustment of chain to lower, crane
							operator saw the elbow begin to dip and came up on load and broke off a couple of attachment
							points. No injury-the decision by crane operator was knee jerk reaction-lack of information not
5/17/2017	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	shared.
							Fast line on crane at dock, half load lift and line broke-issues with inspections on critical lifts, seeing
5/17/2017	GoM	Non-Diving	None	Property Damage	Other Equipment	Office/Warehouse	more issues in industry during downturn.
							Sat diver complained after 2 days in SAT of being sick. After a couple of days he was OK but then the
3/22/2017	GoM	Diving	Fatigue	Near Miss	Personnel	Saturation	problems came back. Doctor called and found no illness, over exerted himself on task.
							4PT anchor boat working sporadically had issue with wire rope on anchor winch. Routine
							maintenance not performed and had broken anchor cable-routine maintenance should be
3/22/2017	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	performed.
		, i				· ·	Data recorders to gauge dive profile-one recorder used in water. At end of day dive, unit had a puff
							of smoke appear and was sent in and reported that seal was compromised and battery was
3/22/2017	GoM	Diving	None	Near Miss	Diving Equipment	Topside	damaged.
		, ,			0 1 1	· ·	Diver in hot water suit-usually wear long sleeves-diver did not have proper taping on sleeves and ha
3/22/2017	GoM	Diving	Arm Injury	First Aid	Personnel	Air Diving	chaffing of wrist-bad irritation.
5/ ==/ ===							Shallow water dive operations with lift bags-diver grabbed bag and hand was caught behind and wa
3/22/2017	GoM	Diving	Hand Injury	First Aid	Other Equipment	Air Diving	pinched.
3/22/2017		Diving		First Aid	Personnel	Air Diving	Knife cut with diver jumping in water and knife opens and cut him on the arm.
5,22,2017	33111	- 17111b	, u, w. y	507110		, 514111g	Malaysia-offloading supply vessel containing container boxes and groceries on steel deck. Rigging u
							of a refrigerator box while worker was unplugging box, and a wave caused the connex box to slide
1/18/2017		Non-Diving	Single Fatality	Fatality	Weather	Topside	into worker, killing him. Sea Fastening issue.
1/10/201/		I TOU DIVING	Jingle Faculty	ratanty	vv catrici	Topside	Forklift incidet. Operator used a sheet of plywood to cover cab during a rain shower. A gust of wind
1/10/2017	Office/Warehouse	Non-Diving	Head Injury	Recordable Incident	Personnel	Office/Warehouse	blew plywood off and hit worker in head. Stitches were required.
1/10/201/	office/ wareflouse	INOII-DINIIIR	i leau iiijui y	Necordanie ilicidelit	I CI SUIIICI	Office/ wateriouse	Employee on back deck of DP vessel took off hardhat while working in small, contained area. Hit
1/10/2017	GoM	Non-Divina	Hoad Injury	Recordable Incident	Parcannal	Topsido	forehead and required stitches.
1/18/2017	GUIVI	Non-Diving	Head Injury	necordable incident	Personnel	Topside	noreneau anu requireu suturies.
1/10/2017		Nam Division	A man I mission :	Danaudahle Jereide i	Domana I		A piece of tubing pine was sticking out of a service and beauty discounted and of the service of
1/18/2017		Non-Diving	Arm Injury	Recordable Incident	rersonnei	+	A piece of tubing pipe was sticking out of a compressed trash bag and lacerated arm of worker.
4 /4 2 /22 :=	055: 444				l		Hydraulic leak incident during freezed. Ball valve cracked due to cold weather, causing oil spill in
1/18/2017	Office/Warehouse	Non-Diving	Environmental Damage	Property Damage	Weather	Office/Warehouse	yard.
							While pumping concrete into a form, hose got plugged during a short work break and went under
		L			L		pressure. Hose was checked for pressure, showed no signgs, but when hose was disconnected,
1/18/2017	Office/Warehouse	Non-Diving	Eye Injury	Recordable Incident	Other Equipment	Office/Warehouse	concrete sprayed on face and eyes of worker.
							Argentina-Fatality due to trauma injury to diver. Was instructed to loosen carabiner, a surge came
1/18/2017	International TBD	Diving	Single Fatality	Fatality	Weather	Air Diving	and pushed diver. Helmet came off.
							Young diver in water in high current vomited in helmet from over exertion. Diver surfaced with no
11/23/2016	GoM	Diving	Illness	Near Miss	Weather	Air Diving	70 complications.
							Diver in SAT un-flanging pipeline-had irritation on wrist and we into beel and applied cream. Suspec
11/23/2016	GoM	Diving	Hand Injury	First Aid	Other Equipment	Saturation	600 possibly from chemical
	GoM	Non-Diving	Environmental Damage	Dosordable Incident	Other Equipment	Other	News report-company rep directed ROV pilot to open valve and dumped oil in the GoM.

				1			Engineer in galley resting, went into cardiac arrest. Due to medics and personnel on board, they
11/23/2016	GoM	Non-Diving	Heart Issue	Recordable Incident	Personnel	Topside	revived him, was sent to shore, recovered.
11/22/2016	CoM	Diving	Dach	First Aid	Diving Faviament	Caturation	700 Diver had an itahu aar in CAT. Sant info to dector and addressed increased shamber hydiana
11/23/2016	GOIVI	Diving	Rash	First Aid	Diving Equipment	Saturation	700 Diver had an itchy ear in SAT. Sent info to doctor and addressed issue of chamber hygiene.
							LFI-Diver LARS winch/Diver umbilical. LARS loaded on vessel one month prior-42 dives done prior to
							incident. Bringing diver up in basket, clump weight wire grabbed hold of umbilical. Wire sucked into
							winch and pulled diver in area of danger. Hazards identified after-not much training with LARS,
11/23/2016	GoM	Diving	None	Near Miss	Personnel	Topside	space issues, SIMOPS being done. LARS operator had limted vision during task.
11, 13, 1010		56	110.10		r croomic.	. opside	Several divers had dive hats inspected by company, after further investigation, it was found the
9/21/2016	Office/Warehouse	Non-Diving	None	Near Miss	Personnel	Office/Warehouse	company was not recognized as a certified hat inspector by Kirby Morgan.
27 = 27 = 2 = 2							Lift bag procedure was not followed during a surface dive. Diver was recovering soffit pool with a
9/21/2016	GoM	Non-Diving	None	Near Miss	Personnel	Air Diving	20ft lift-lift bag released without safety strap and went to the surface.
							16" pipeline repair-dive contractor identified leak and demobed. A flushing crew went out and when
9/21/2016	GoM	Non-Diving	Environmental Damage	Near Miss	Other Equipment	Air Diving	dive contractor returned to line, found bubbles come out-leaking valve main cause.
							Vessel to vessel crane incident. Taking a spool piece off vessel when last tie down ratchet strap
9/21/2016	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	broke when vessel dropped out from under load. Crane kept load, no injury or damage.
3/21/2010	00111	Tron Bring	Itolic	14001 141133	other Equipment	Topside	broke when vessel dropped out from drace road. Crane Reperioda, no mjary or damage.
							Trinidad-Divers installed 2 dead man anchors. Lift bags installed and diver was trapped due to
							movement/shifting of dead man anchor (crane counterweight) tipping over. Left leg trapped and
9/21/2016	Atlantic Ocean	Diving	Leg Injury	Recordable Incident	Other Equipment	Saturation	diver was sent back to bell with swelling. Diver had to have surgery to repair leg. Full recovery.
		-	-0 1 1		4.6		New helicopter policy in the middle east. Rescued a person having a heart attack and without this
9/21/2016	International TBD	Non-Diving	Heart Issue	Recordable Incident	Personnel	Topside	helicopter, the person would have died.
							LARS system issue-clump weight was racked and 2 blocked the clump weight (800lbs) fell to lower
9/21/2016	GoM	Diving	None	Near Miss	Diving Equipment	Topside	deck. No injuries. Lack of following procedures.
							SAT system LARS-moving bell to mate up to system, clump wire broke away from the bell guide wire
9/21/2016	GoM	Non-Diving	None	Near Miss	Diving Equipment	Topside	standoff. Failure to follow procedure.
							Person on vessel went to galley, fell over, and went into cardiac arrest. CPR administered and got
9/21/2016	GoM	Non-Diving	Heart Issue	Recordable Incident	Personnel	Topside	hear restarted. Called Coast Guard to air lift him and brought to hospital. Treated and doing well.
							DP DSV had uncontrolled ascent of flexible flowline using lift bags. Found that use of lift bags in
							shallow water makes bags inflate quickly. Parts of an 8" flowline lifted and the diver was straddling
							the flowline. The divers umbilical was draped over the flowline and raised the flowline. Diver exited
						l	flowline and dumped air from the airbags to recover flowline. No damages to line. Diver umbilical
7/20/2016	GoM	Non-Diving	None	Near Miss	Other Equipment	Air Diving	137 management -root cause still under investigation. Personnel illness-had an annual physical and had evacuation plan in place. Woke up and felt he was
							being choked and went to bathroom and saw throat area was swollen. Called medic. Evacuation
							plan was put into action. Air evacuation crew was busy and location was a dark structure. Lesson
							earned-lots of paper work needed and should be done prior. In planning-do not take for granted
7/20/2016	GoM	Non-Diving	Illness	Recordable Incident	Porconnol	Topside	that structure is assembling to land a helicopter on. Person was fine after treatment.
7/20/2010	GOIVI	NOII-DIVING	IIII1633	Recordable ilicident	reisonnei	Торзіце	that structure is assembling to land a helicopter on. Terson was the after treatment.
							Motor vehicle accident-Passenger van involved in single vehicle auto accited. Dive contractor using
							third party crew van to deliver personnel to jobsite in Cameron. Prior to incident, passengers notice
							driver was driving a bit erratic. At approx. 1130 hours, diver either became distrated or fell asleep
							causing van to leave roadway and narrowly miss tree. Diver cited for reckless operation. Should
							have been a stop work authority. Also noted Contractors EMT personnel were without trauma kit as
							trauma kit was in another crew van going to job. Take away-make sure trauma kits rides with EMT's
7/20/2016		Non-Diving	Fatigue	Recordable Incident	Personnel	Other	to job sites.
,,20							Diver in bell and noticed pressure dropping. Got pressure back and located a bubbling leak and
7/20/2016		Diving	None	Near Miss	Diving Equipment	Saturation	repaired with o-ring. Investigation showed inspection a few weeks earlier.
7/20/2016		Non-Diving	None	Property Damage	Other Equipment	Other	Manifold piping had a blow out.
7/20/2016	GoM	Non-Diving	None	Near Miss	Personnel	Topside	Person inserted a gas in the dive shack.
							Tender had pain in sinus area and right lob. Pressure relief by Sudafed. Most personnel were sick or
							vessel with clold and flu symptoms. Decision made to demob for a few days for crew to get healthy.
7/20/2016		Non-Diving	Illness		Personnel	Topside	Vessel removed and job continued without incident.
5/20/2016	Office/Warehouse	Non-Diving	Single Fatality	Fatality	Other Equipment	Office/Warehouse	Fatality-downstream sector (refinery).
- 10 - 1		L		L		<u>-</u>	Diver went to chamber-tender was too quick on slide by a couple of minutes and treated for OM
5/20/2016	GoM	Diving	Illness	Near Miss	Personnel	Air Diving	decompression. Re-educate tender on chamber policies.

			T	Г			DP incident-vessel coming into platform and was about 1200 meters from platform, captain left
							bridge and had an assistant take over the controls. Vessel moved into anchor pattern of another
							vessel in area. Vessel stopped and moved north of anchor patter. Near miss and all stop to review
E/20/2016	S CoM	Non Diving	None	Noor Micc	Dorconnol	Tonsido	
5/20/2016	GOIVI	Non-Diving	None	Near Miss	Personnel	Topside	issue. Human error.
							Diver was hand jetting and had a ditch wall collapse. Material hit diver in chest and he recovered
5/20/2016	GoM	Diving	None	First Aid	Environment		with minor first aid. RCA was done.
							Diver doing ship husbandry work and went home. Next day reported rash and other symptoms
5/20/2016	GoM	Diving	Rash	Recordable Incident	Environment	Air Diving	(PVO). Needed treatment and had some other issues to be addressed.
							In Iraq-construction superintendent working in plant-pinch bar fell from above and hit in head
3/23/2016	International TBD	Non-Diving	Head Injury	Recordable Incident	Operational Control	Office/Warehouse	(hardhard). Seriously injured.
3/23/2016	6 GoM	Non-Diving	Vessel Damage	Property Damage	Environment	Other	4pt vessel coming in from sea buoy and hit some bottom areas (mudline).
3/23/2016	GoM	Diving		First Aid	Environment	Saturation	SAT diving-felt tug on left arm and found two puncture wounds (possible eel).
3/23/2016		Non-Diving	- ' '		Environment	Topside	Recordable on re-occuring event. Finished shift and undressing-something fell in eye.
3/23/2020				THE CONTRACTOR OF THE CONTRACTOR	2	- Popolius	Pillar valve incident. Possible mis-matched fittings from US/Foreign vessel-different standards on
							fittings (thread patterns) being purchased from GoM suppliers. Mitigation actions (policies and
2/22/2016	CoM	Diving	None	Noor Micc	Other Fauinment		precedures) are in plance within some GoM dive contractors.
3/23/2016	GOIVI	Diving	None	Near Miss	Other Equipment		
- 1 1	.				L		Cook was cutting meat and meat cutting tool shifted/slide and he grabbed cutter and sliced through
3/23/2016	GOM	Non-Diving	Hand Injury	Recordable Incident	Other Equipment	Topside	gloved hand requiring stitches.
							Surface diving using O2-diver got in chamber-could not clear-omitted decompression-possibility due
3/23/2016	GoM	Diving	Illness	Near Miss	Personnel	Air Diving	to antihistamine (fit for duty).
							Diver issue with pink eye on dive spread (fit for duty). Another with bump on head issues on job
3/23/2016	GoM	Non-Diving	Eye Injury	First Aid	Personnel	Topside	prior to leaving dock.
							36 guys sent to hospital in Asia from a vessel that was cold stacked-due to mold in ducting of the air
3/23/2016	International TBD	Non-Diving	Illness	Recordable Incident	Other Equipment	Topside	conditioning system.
3/23/2010	international TDD	INOII-DIVING	11111633	Necordable incident	Other Equipment	Topside	Pig receiver incident-operator pigging an 8" pipeline. Crew attempted to bleed of PL and remove pig
							1
	.				L		Due to a faulty reading the launcher still had about 400 PSI when the door was opened. The pig sho
1/20/2016	GoM	Non-Diving	Head Injury	Property Damage	Other Equipment	Topside	from the receiver causing sever facial injuries to the IP. No procedure or permit was in place.
1/20/2016	GoM	Non-Diving	Vessel Damage	Property Damage	Environment	Topside	Tanker pushed a dive boat out of a channel. Out of date NAV aids lead to the vessel grounding.
					1		
					1		Umbilical failure due to either umbilical tree or other object crushing the dive hose and dive was
1/20/2016	GoM	Non-Diving	None	Near Miss	Diving Equipment	Air Diving	aborted. Further investigation lead to replacing brands of hoses (agua flow vs flex flow).
1/20/2016	GoM	Non-Diving	Leg Injury	First Aid	Other Equipment	Topside	Crew member grinding on deck had a kickback leading to an abrasion on leg above boot.
			-5 ,- ,		1, 1, 1, 1, 1, 1, 1, 1, 1, 1, 1, 1, 1, 1		Tender using an aluminum boat hook and due to weather sea action, the hook caught the tenders'
1/20/2016	SIGOM	Non-Diving	None	Near Miss	Weather	Topside	life vest-hook was double ended-take out of service.
1/20/2016				Near Miss	Other Equipment	Topside	Crane exceeded capacity lifting concrete filled box.
1/20/2010	GOIVI	Non-Diving	vessei Dalliage	iveal iviiss	Other Equipment	+ +	
. /00/00/4					<u>_</u> .		Automobile accident in a company truck. Citizen ran stop sign. Truck was totaled but since all
1/20/2016		Non-Diving		First Aid	Personnel	Other	personnel were belted in, none were seriously injured.
1/20/2016	Office/Warehouse	Non-Diving	Hand Injury	First Aid	Personnel	Office/Warehouse	Nicitor at an office hurned himself with soffee will now use lide on all owns
							Visitor at an office burned himself with coffee-will now use lids on all cups.
1/20/2016							Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely
	Office/Warehouse	Non-Diving	None	Near Miss	Other Equipment	Office/Warehouse	· ·
1/20/2016	-	Non-Diving Non-Diving		Near Miss First Aid	Other Equipment Personnel	Office/Warehouse Office/Warehouse	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely
1/20/2016	-					 	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety.
	5	Non-Diving	Hand Injury	First Aid	Personnel	Office/Warehouse	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should
1/20/2016	5		Hand Injury			 	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair.
11/18/2015	5 GoM	Non-Diving Non-Diving	Hand Injury Vessel Damage	First Aid Property Damage	Personnel Other Equipment	Office/Warehouse Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong
	5 GoM	Non-Diving	Hand Injury	First Aid	Personnel	Office/Warehouse	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair.
11/18/2015	5 GoM	Non-Diving Non-Diving	Hand Injury Vessel Damage	First Aid Property Damage	Personnel Other Equipment	Office/Warehouse Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket.
11/18/2015 11/18/2015	5 GoM	Non-Diving Non-Diving Diving	Hand Injury Vessel Damage None	Property Damage Near Miss	Personnel Other Equipment Diving Equipment	Office/Warehouse Topside Saturation	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation
11/18/2015	5 GoM	Non-Diving Non-Diving	Hand Injury Vessel Damage	First Aid Property Damage	Personnel Other Equipment	Office/Warehouse Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket.
11/18/2015 11/18/2015	5 GoM	Non-Diving Non-Diving Diving	Hand Injury Vessel Damage None	Property Damage Near Miss	Personnel Other Equipment Diving Equipment	Office/Warehouse Topside Saturation	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings.
11/18/2015 11/18/2015	G GOM G GOM	Non-Diving Non-Diving Diving	Hand Injury Vessel Damage None Heart Issue	Property Damage Near Miss	Personnel Other Equipment Diving Equipment	Office/Warehouse Topside Saturation	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings.
11/18/2015 11/18/2015 11/18/2015	G GOM G GOM	Non-Diving Non-Diving Diving Non-Diving	Hand Injury Vessel Damage None Heart Issue	Property Damage Near Miss Near Miss	Personnel Other Equipment Diving Equipment Personnel	Office/Warehouse Topside Saturation Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting.
11/18/2015 11/18/2015 11/18/2015	G GOM G GOM	Non-Diving Non-Diving Diving Non-Diving	Hand Injury Vessel Damage None Heart Issue	Property Damage Near Miss Near Miss	Personnel Other Equipment Diving Equipment Personnel	Office/Warehouse Topside Saturation Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was
11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM G GOM G GOM	Non-Diving Non-Diving Diving Non-Diving Non-Diving	Hand Injury Vessel Damage None Heart Issue Illness	Property Damage Near Miss Near Miss First Aid	Personnel Other Equipment Diving Equipment Personnel Personnel	Office/Warehouse Topside Saturation Topside Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos
11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM G GOM G GOM G GOM	Non-Diving Non-Diving Diving Non-Diving Non-Diving Diving	Hand Injury Vessel Damage None Heart Issue Illness	Property Damage Near Miss Near Miss First Aid Near Miss	Personnel Other Equipment Diving Equipment Personnel Personnel Diving Equipment	Office/Warehouse Topside Saturation Topside Topside Air Diving	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos was tested and QC'd two months prior to use.
11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM G GOM G GOM G GOM	Non-Diving Non-Diving Diving Non-Diving Non-Diving	Hand Injury Vessel Damage None Heart Issue Illness	Property Damage Near Miss Near Miss First Aid	Personnel Other Equipment Diving Equipment Personnel Personnel	Office/Warehouse Topside Saturation Topside Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos was tested and QC'd two months prior to use. Crane operator lit a cigarette in a non-smoking area and was terminated. Life saving rules of Shell.
11/18/2015 11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM G GOM G GOM G GOM G GOM	Non-Diving Diving Non-Diving Non-Diving Non-Diving Diving Diving Non-Diving	Hand Injury Vessel Damage None Heart Issue Illness None None	First Aid Property Damage Near Miss Near Miss First Aid Near Miss Near Miss	Personnel Other Equipment Diving Equipment Personnel Personnel Diving Equipment Personnel	Office/Warehouse Topside Saturation Topside Topside Air Diving Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solelizely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos was tested and QC'd two months prior to use. Crane operator lit a cigarette in a non-smoking area and was terminated. Life saving rules of Shell. During a site clearing project, some items were jetted material below surface. BSEE sited company
11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM G GOM G GOM G GOM G GOM	Non-Diving Non-Diving Diving Non-Diving Non-Diving Diving	Hand Injury Vessel Damage None Heart Issue Illness	First Aid Property Damage Near Miss Near Miss First Aid Near Miss Near Miss	Personnel Other Equipment Diving Equipment Personnel Personnel Diving Equipment Personnel	Office/Warehouse Topside Saturation Topside Topside Air Diving	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos was tested and QC'd two months prior to use. Crane operator lit a cigarette in a non-smoking area and was terminated. Life saving rules of Shell. During a site clearing project, some items were jetted material below surface. BSEE sited company on the issue.
11/18/2015 11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM G GOM G GOM G GOM G GOM	Non-Diving Diving Non-Diving Non-Diving Non-Diving Diving Diving Non-Diving	Hand Injury Vessel Damage None Heart Issue Illness None None	First Aid Property Damage Near Miss Near Miss First Aid Near Miss Near Miss	Personnel Other Equipment Diving Equipment Personnel Personnel Diving Equipment Personnel	Office/Warehouse Topside Saturation Topside Topside Air Diving Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos was tested and QC'd two months prior to use. Crane operator lit a cigarette in a non-smoking area and was terminated. Life saving rules of Shell. During a site clearing project, some items were jetted material below surface. BSEE sited company on the issue.
11/18/2015 11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM	Non-Diving Diving Non-Diving Non-Diving Non-Diving Diving Diving Non-Diving	Hand Injury Vessel Damage None Heart Issue Illness None None Environmental Damage	First Aid Property Damage Near Miss Near Miss First Aid Near Miss Near Miss	Personnel Other Equipment Diving Equipment Personnel Personnel Diving Equipment Personnel	Office/Warehouse Topside Saturation Topside Topside Air Diving Topside	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos was tested and QC'd two months prior to use. Crane operator lit a cigarette in a non-smoking area and was terminated. Life saving rules of Shell. During a site clearing project, some items were jetted material below surface. BSEE sited company on the issue.
11/18/2015 11/18/2015 11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM	Non-Diving Non-Diving Diving Non-Diving Non-Diving Diving Diving Diving Non-Diving	Hand Injury Vessel Damage None Heart Issue Illness None None Environmental Damage None	First Aid Property Damage Near Miss Near Miss First Aid Near Miss Near Miss Recordable Incident	Personnel Other Equipment Diving Equipment Personnel Diving Equipment Personnel Other Equipment	Office/Warehouse Topside Saturation Topside Topside Air Diving Topside Air Diving	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos was tested and QC'd two months prior to use. Crane operator lit a cigarette in a non-smoking area and was terminated. Life saving rules of Shell. During a site clearing project, some items were jetted material below surface. BSEE sited company on the issue. DP vessel with ROV operations; DP system failure and vessel moved only 60' before manual controls
11/18/2015 11/18/2015 11/18/2015 11/18/2015 11/18/2015 11/18/2015 11/18/2015	G GOM	Non-Diving Diving Non-Diving Non-Diving Non-Diving Diving Diving Diving Diving	Hand Injury Vessel Damage None Heart Issue Illness None None Environmental Damage None	First Aid Property Damage Near Miss Near Miss First Aid Near Miss Near Miss Recordable Incident Near Miss	Personnel Other Equipment Diving Equipment Personnel Diving Equipment Personnel Other Equipment Other Equipment	Office/Warehouse Topside Saturation Topside Topside Air Diving Topside Air Diving Other	Office evacuation due to a forklift striking a gas line. Line was clearly marked. Lesson is to not solely rely on signs or barricades for safety. Worker accidently impacted a nut onto his finger up to the knuckle. Crane boom incident. Crane operator mentioned in a statement that there was an issue and should use SWA, but did not stop work. Crane boom cratered and multiple cost occurred to repair. Boat charter with SAT system, after bell run #9, a port gasket failed on a flat disk window. Wrong procedure in original installation of gasket. Diver went out on a project without enough of peronal medicine and BP escalated and evacuation was needed. Companies need to be aware of any illness issues at pre-job meetings. Diver showed up on job site ill and conditions worsened. Companies need to be aware of any illness issues at pre-job meeting. Shallow water diving with air package. Bubbles were noticed coming from his hose and dive was aborted and hose changed. Further investigation found bubbles again and hose had holes in it. Hos was tested and QC'd two months prior to use. Crane operator lit a cigarette in a non-smoking area and was terminated. Life saving rules of Shell. During a site clearing project, some items were jetted material below surface. BSEE sited company on the issue. DP vessel with ROV operations; DP system failure and vessel moved only 60' before manual controls were taken over by captain.

	I	T	T	T	I	1	Mahilising vessel at dealy a tender reacted to lower abdomen pain and had a blocked intesting and
11/18/2015	GoM	Non-Diving	Illness	First Aid	Personnel	Topside	Mobilizing vessel at dock, a tender reacted to lower abdomen pain and had a blocked intestine and was sent for treatment.
11/10/2013	COIVI	IVOIT DIVING	IIIIC33	Tilst Aid	i cisonnei	Торзійс	Forklift positioning load in yard. Nudged a piece of conduit on side of building, and arc out, electrical
11/18/2015	Office/Warehouse	Non-Diving	Facility Damage	Property Damage	Other Equipment	Office/Warehouse	short throughtout building.
							Offshore worker had a injection of hydraulic fluid into hand and was shipped in to be treated-
11/18/2015	GoM	Non-Diving	Hand Injury	Recordable Incident	Other Equipment	Topside	occupational doctor's clinic.
							During a recent dive audit, a small dive vessel at an overseas location had a small diesel air
11/18/2015	GoM	Non-Diving	None	Near Miss	Personnel	Topside	compressor beneath deck in a confined space area. Crew was not aware of hazard.
							Diving fatality in Mexico, SAT diver working at base of platform and platform shifted causing
9/16/2015	International TBD	Diving	Single Fatality	Fatality	Operational Control	Saturation	350 incidents. SIMOPS going on, mixed languages and cultural differences on location.
0/16/2015	CaM	Divine	Hand Inium.	Final Aid	Divine Ferriement	Aia Divina	Incident in shallow water, on location for 12 hours, night work-diver jetting assembly and gas bubble
9/16/2015	GOIVI	Diving	Hand Injury	First Aid	Diving Equipment	Air Diving	came to surface. Diver was burned on ladder (hot) while getting out of water. Fire on vessel. Contractor working in Nigeria, West Africa-Diver had laceration on leg in water and was sent home
							for a couple of days. Infection occurred and needed medical attention. Out of work for an extended
9/16/2015	International TBD	Diving	Leg Injury	Recordable Incident	Other Fauinment	Air Diving	period.
3/10/2010			128] /	Trees and trees are trees	other Equipment	7 5.116	Incident in UK, SAT project, DP diving-had a discharge of aerated water that pushed the diver behind
9/16/2015	North Sea	Diving	None	Near Miss	Diving Equipment	Saturation	a pipe. Had to stop the discharge so diver could free himself.
					0 1 1		
							Dive crew was demobbing from a job traveling from Freshwater City, LA at 10:30pm in a couple of
7/15/2015	GoM	Non-Diving	Equipment Damage	Property Damage	Environment	Other	crew vans. One van hit a cow in the road. No one was hurt/injured. Van was totaled.
							DP vessel lost SWAY and there was diver in the water. Stopped the dive and removed diver from
7/15/2015		Non-Diving	None	Near Miss	Other Equipment	Air Diving	water. Vessel control panel switch was manually/accidentally hit and taken out of operation.
7/15/2015	GoM	Diving	Arm Injury	First Aid	Environment	Air Diving	Lionfish contact in Ship Shoal area, visibility was good. Treated and returned to work.
							Diver in Main Pass area, diver reported a chemical burn, large burn (look like second degree burn)
							down his spine and started blistering. Unable to identify what caused this issue. Possible chemical
7/15/2015	GoM	Diving	Back Injury	Recordable Incident	Other Equipment	Air Diving	(dissident) seeped down his wet suit.
							Lionfish sting, first time being stung. Diver had his own personal gloves to prevent possible sting.
7/15/2015	GoM	Diving	Hand Injury	First Aid	Environment	Air Diving	Was treated, all ok. Went back to work.
							Bay Marchand area, lock out/tag out procedure on a wheel guard inspection, an encroachment by
							crew boat. LRAD was used to call out to the Captain of crew boat who responded negatively and
7/15/2015	CaM	Divine	Nama	Naan Misa	Damanal	Air Divino	dive contractor reached out to the crew boat company to discuss the issue. Diver taken out of
7/15/2015	GOIVI	Diving	None	Near Miss	Personnel	Air Diving	water.
7/15/2015	International TBD	Diving	Rash	First Aid	Environment	Air Diving	Group of Brazillian divers working in a tank, had rashes on skin, rashes due to wet suit issues.
7/15/2015	international TBB	DIVING	Itasii	THIST AIG	Littironinient	All Diving	2 overseas issues, piepline was bouncing on bottom causing the divers hose to gather under the
7/15/2015	International TBD	Diving	None	Near Miss	Other Equipment	Air Diving	pipeline causing a potential hazard.
, -, -					1.1		Close call-Diver was marking a pipeline, end of day-diver was 75'to 100ft from front og barge.
							Recreational fishing vessel was approaching and diver was in 4ft of water and vessel came extremely
7/15/2015	GoM	Diving	None	Near Miss	Other Equipment	Air Diving	4 clost to diver (10ft from diver)
							Pipeline leak in CA-Plains All American Piepline-leak onshore and ran into a culvert ditch into a cove
5/21/2015		Non-Diving	Environmental Damage	Recordable Incident	Other Equipment	Other	area into beach area. CleanSeas-oil response group in charge of clean up.
5/21/2015	GoM	Diving	None	Near Miss	Diving Equipment	Air Diving	Near miss-chamber issue-gauges were read incorrectly. Re-educate on processes in place.
							Jet pump was set on deck and was positioned where you could not see water discharging over the
							side from manifold. Another manifold was added and tested at dock, but unit was not pressured to
							full throttle on mainfold. Once full pressure was in tack, connector was not tighten enough and had
5/21/2015	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	near miss.
							4pt vessel-deck crew heard thump, investigated, and found a 7ft Mako shark that had jumped into
5/21/2015	GoM	Non-Diving	None	Near Miss	Environment	Topside	the boat.
- 10 - 1							
5/21/2015		Diving	None	Near Miss	Other Equipment	Air Diving	Stored energy from a pipeline jumped when being cut. Diver was in near vicinity, near miss.
5/21/2015	GOM	Non-Diving	None	Near Miss	Other Equipment	Topside	Tied down chain failed on a wire line unit on back of a vessel, unit slide to end of vessel.
E/21/201E	GoM	Non-Diving	Hoad Injury	Pacardahla Incident	Parcannal	Tonsido	Crane operator fell and hit head while on ladder and he does not remember how he got there.
5/21/2015	International TBD	Non-Diving	Head Injury	Recordable Incident	Personnel Operational Control	Topside	
5/21/2015	international IBD	Diving	None	Near Miss	Operational Control	Saturation	Overseas DP incident with drifting. Working overseas. Contractor flying, at airport, pulled groin at baggage claim, possible hernia. Sent
3/25/2015	International TBD	Non-Diving	Leg Injury	Restricted Duty	Personnel	Other	back to US to recheck. Not a hernia, but had other issues. Fit for work.
3/25/2015			Leg Injury Illness	Recordable Incident	Personnel	Other Gas Diving	150 Veteran diver-experienced Type II decompression.
3/23/2015	GOIVI	Diving	IIIIIESS	necordable incident	Personnel	Gas Diving	Threading end of pipe for oxygen service with liquid form of Teflon. Issue with pieces of tape tearing
3/25/2015	GoM	Non-Diving	None	Near Miss	Diving Equipment	Topside	off threads.
3/23/2013	GOIVI	INOIL-DIAILIR	INOTIC	INCUI INIISS	Diving Equipment	Tupside	on uneaus.

	I	T		T	T	Ī	
3/25/2015	GoM	Non-Diving	None	Near Miss	Personnel	Topside	Sr. Client rep taking part in conference call and a fire drill was in place and he did not respond.
3/23/2013	GOIVI	NOII-DIVING	None	INEAL IVIISS	reisonnei	Topside	Offshore Superintendent concerned about fittings coming offshore, not the correct fitting and
3/25/2015	GoM	Non-Diving	None	Near Miss	Other Equipment	Tonsido	questioned types of fittings being sent offshore for safety issues.
3/23/2013	GOIVI	NOII-DIVING	None	INEAL IVIISS	Other Equipment	Topside	Pinch point on diving bell clump weight, low visibility and caught hand-minor injury. Tender reached
2/25/2015	CoM	Diving	Hand Injune	First Aid	Dorconnol		over to the control lever and hit wrong lever to lower clump weight.
3/25/2015	GOIVI	Diving	Hand Injury	First Aid	Personnel		over to the control level and filt wrong level to lower clump weight.
3/25/2015		Diving	None	Noor Miss	Other Fauinment		Cutting ains with guillating say and when it broke off it had stared energy and energy and
3/25/2015		Diving	None	Near Miss	Other Equipment		Cutting pipe with guillotine saw and when it broke off, it had stored energy and sprung pipe.
2/25/2015	Office /Manahausa	Nan Divina	Nama	Naar Miaa	Other Faulance	Ain Divine	Conducting loss of gas training in yard, fitting failed on dive hose and all stop. Storage issues on hose
3/25/2015	Office/Warehouse	Non-Diving	None	Near Miss	Other Equipment	Air Diving	in sunlight was issue and change in procedure of storing.
							Vanelinidest formaniana anima anima base anama anama anima base anima anima base anima anima anima anima anima
2/25/2015	C-M	Non Divine	Vaccal Damage	Dunanti Damasa	Fariananant	Tanaida	Vessel incident, fog was an issue coming up river, barges were wrapped on bank and were sticking
3/25/2015	GOIVI	Non-Diving	Vessel Damage	Property Damage	Environment	Topside	out in the channel and vessel bumped barge. Take away-Call USCG when issues are seen.
2/25/2015	C-M	Nan Divina	Name	Naar Miss	Damanal	Tanaida	Offloading LARS off of TLP and loading on vessel. LARS hit a piece of equipment and the tip of the
3/25/2015 3/25/2015		Non-Diving	None None	Near Miss Near Miss	Personnel	Topside Air Diving	LARS, causing LARS to shift and tilt. 15 Loss of air in hat at 15ft of water. Dive hat issue.
3/23/2013	GOIVI	Diving	None	inear iviiss	Diving Equipment	All Divilig	Recordable on lifting. Crane operator was lifting and sling was tightening up on a piece of equipment
2/25/2015	C-M	Nan Divina	Hand Inium.	Danaudahla luaidaut	Damanal	Tanaida	
3/25/2015	GOIVI	Non-Diving	Hand Injury	Recordable Incident	Personnei	Topside	and person reached in to move sling and smashed finger.
							Double fatality and third man broke leg, working with a 150 derrick barge, issues with a change out
							, , , , , , , , , , , , , , , , , , , ,
2/25/2045	C-M	Nan Birina	Mariate Fearling	F-4-P4	044	Tanada	of hardware to mooring chain and concrete block. Keeper under buoy failed and buoy slipped and
3/25/2015	GOIVI	Non-Diving	Multiple Fatality	Fatality	Other Equipment	Topside	safety wire was shock loaded and failed causing fatalities and injuries.
2/25/2245			.		0.1 5		Wireline unit chained off to lift boat, and chain was not rated for load and chained failed. Near miss.
3/25/2015	GOM	Non-Diving	None	Property Damage	Other Equipment	Topside	Look at policy on chain use.
2/25/2245			.				
3/25/2015		Non-Diving	None	Near Miss	Personnel		Safety alert and share-person covered a smoke detector with plastic and broke policy on vessel.
2/25/2245				E A			Offshore turnaround project-had three first aids in one day. Minor cuts and had a safety stand
3/25/2015	GOIVI	Non-Diving	Hand Injury	First Aid	Personnel	Topside	down. Complemented personnel on reporting.
2/25/2245			.				Received mixed gas from vendor and bottles were marked wrong (wrong bottles for the proper mix
3/25/2015	GOM	Diving	None	Near Miss	Diving Equipment	Gas Diving	of gas.
4/44/2045		a	.		0.1 5		Video of pillar valve incident was viewed by DWG group-4 people medi-vac off vessel. Root cause-
1/14/2015	GOIVI	Diving	None	Recordable Incident	Other Equipment	Topside	metric thread connecting to standard pipe thread on the bottle failed.
							Electrician drilling holes with cordless drill. At days end, helper (SSE) picking up drill to remove drill
1/14/2015	C-M	Non Divine	Hand Inium.	Danaudahla luaidaut	Other Fautement	Tanaida	bit, drill engaged while loosening chuck to remove bit and caught glove and de-gloved helper injuring
1/14/2015	GOIVI	Non-Diving	Hand Injury	Recordable Incident	Other Equipment	Topside	hand
1/14/2015	C-M	Nan Divina	Hand Inium.	Danaudahla luaidaut	Other Fautement	Tanaida	While reaching for come-a-long, individual jammed thumb. After further evaluation, turned out to
1/14/2015	GOIVI	Non-Diving	Hand Injury	Recordable Incident	- 	Topside	be fractured.
1/14/2015		Non-Diving	Illness	Near Miss	Personnel		More workers showing up for work (at jobsite) with colds and sniffles.
1/14/2015	C-M	Nan Divina	Illanaa	Naar Miaa	Damanal	Tanaida	Contractor employee went offshore with cold and had additional underlying health issues as well.
1/14/2015	GOIVI	Non-Diving	Illness	Near Miss	Personnel	Topside	Turned into upper respiratory infection.
1/14/2015	C-M	Non Divine	Name	Naar Miss	Other Fautement	Tanaida	During a hazard hunt pre-job-company noticed a lever style chain binder (banned item) on back deck
1/14/2015	GOIVI	Non-Diving	None	Near Miss	Other Equipment	Topside	of vessel. Prompted additional inspections on charts on vessel.
							Overseas contractor doing subsea diving work and diver was buried by subsea mattress being set in
1/14/2015		Diving	Book Injury	Roctricted Duty	Other Fauinment	Air Divina	place on the sea floor. Diver was injured but came up on his own. Soft bottom helped diver recover.
1/14/2015		Diving	Back Injury	Restricted Duty	Other Equipment	Air Diving	place of the sea floor. Diver was injured but came up of his own. Soft bottom helped diver recover.
1/14/2015		Diving	None	Noor Miss	Dorconnol		Free in recording the correct dive bettem time was transposed and error was missed by 2 people
1/14/2015		Diving	None	Near Miss	Personnel		Error in recording the correct dive bottom time was transposed and error was missed by 3 people. Removing padeyes from DPII vessel-burning topside-not recognizing potential hazards that involved
1/1//2015	GoM	Non-Divina	None	Near Miss		Tonsido	water and electrical issues.
1/14/2015 1/14/2015		Non-Diving Non-Diving	None None	Near Miss	Other Equipment	Topside Topside	Two blocking a crane on offshore projects (a recurring task), headache ball dropped.
1/14/2013	GOIVI	NOII-DIVING	None	Property Damage	Other Equipment	Topside	Tender working on deck with alternative cutting device on leg in pouch on pants and when bending
11/19/2014	GoM	Non-Diving	Arm Injuny		Other Equipment	Topside	down, cut his bicep.
11/19/2014	GOIVI	Non-Diving	Arm Injury		Other Equipment	Topside	down, cut his bicep.
							Crane was in the process of attaching spring line to a platform. Two employees using a come-a-long
							and chain to pull in slack. All stop was called by Superintendent due to improper method. When
11/19/2014	GoM	Non-Diving	Hand Injury	First Aid	Personnel	Topside	undoing the come-a-long, the crane started to pull, resulating in a badly bruised finger.
11/15/2014	GOIVI	INOII-DIVING	i ianu nijury	i ii St Aiu	i cradillel	Topside	Jet pump was working on deck and tender kneeled down to unplait the jet hose-nipple fitting on the
							air starter on the jet pump came apart from air hose. Hose was long enough to hit the tender in face
11/19/2014	GoM	Non-Diving	Head Injury		Diving Equipment	Tonsido	(had a hose restraint whip check on hose).
11/19/2014			None	Near Miss		Topside	Vessel encroachment with diver in water (vessel came within 100ft of diver).
		Diving		+	Other Equipment	Tonsido	
11/19/2014	GUIVI	Diving	None	Near Miss	Other Equipment	Topside	Tender working with a dive hose and tripped in closed area. Trip hazard awareness. Engineer in engine room, bump air starter air line with no check on air hose and air hose detached
11/10/2014	GoM	Non Divina	Evo Injuny	Noar Miss	Other Equipment	Tonsido	
11/19/2014	GUIVI	Non-Diving	Eye Injury	Near Miss	Other Equipment	Topside	and was hit in eye. (PPE worked (protected eye).

1			1				International incident-person struck by lightening and died. Look at making preparations when
11/19/2014	Non-Diving	Single Fatality	Fatality	Environment	Tonsido		storms and lightening possiblitlies are in the area of job sites.
11/19/2014	NOII-DIVINg	Single ratality	ratality	Environment	Topside		Tug incident anchors-changing shackles and buoy came up and hit employee on hand. While another
							employee heading to safe zone feel and hit head on 55 gallon drum that was located on route to
11/19/2014 GoM	Non-Diving	Hand Injury		Other Equipment	Topside		muster station
11/19/2014	Non-Diving	Single Fatality	Fatality	Other Equipment	Other		Fatality on fracking job with high pressure line bursting, hitting individual.
11/13/2014	IVOIT DIVING	Single rutuity	ratanty	Other Equipment	Other		Incident overseas-pillar valve on top of bailout. Valve blew out while dressing stand-by diver,
							resulting in 4 divers being medivac'd by helicopter. IMCA sent 4 safety flashes identifying previous
11/19/2014	Non-Diving	Chemical Exposure	Recordable Incident	Diving Fauinment	Topside		pillar valve incidents involving mis-matched threads.
11,13,201	Tron Biring	Chemical Exposure	Recordable incluent	Diving Equipment	Торыше		Hyperbaric lifeboat trunk leak repair. Leak at seal between mating face and HBL, poor decisions
9/17/2014 GoM	Diving	None		Other Equipment	Saturation		were made to correct leak.
9/17/2014 GoM	Non-Diving	Single Fatality	Fatality	Other Equipment	Topside		Contract hand died from explosion at a valve and was sent overboard.
9/17/2014 GoM	Non-Diving	Single Fatality	Fatality	Personnel	Topside		Heart attact fatality on offshore vessel-welder.
		,	•		<u> </u>		1" ball valve failure on mainfold (China) cracked-crowfoot on valve was manufactured in China as
9/17/2014	Non-Diving	None	Near Miss	Other Equipment	Other		well. Awareness to all within a pressured system.
							4pt anchor vessel-disconnected anchor from spring lining-anchor became fouled under spring line
							and anchor broke free from safety lines and pulled off of anchor rack and fell to sea floor. No
9/17/2014 GoM	Non-Diving	None	Property Damage	Other Equipment	Topside		damage to platform or pipeline.
9/17/2014 GoM	Diving	Illness	Recordable Incident	Personnel			Recordable on a decompression sickness. After further investigation, turned out the diver had a PFO
							Possible heat issue-with low blood pressure. Employee stopped taking BP medication which cause
9/17/2014 GoM	Non-Diving	Heart Issue	First Aid	Personnel	Topside		the issue.
							Fatality at a pipe coating contractor's facility. One of the pipes became un-lodge, SWA was started
							by one person and overruled another. Person was put into a pinch point area, pipe moved and
9/17/2014 Office/Warehouse	Non-Diving	Single Fatality	Fatality	Personnel	Office/Warehouse		caused fatality.
- 1 - 1 - 1							Attending doctor mentioned 5 fatalities within 5 days (3 heart attachks). Older workforce-one
9/17/2014	Non-Diving	Multiple Fatality	Fatality	Personnel	Topside		possible disease issue on a foreign vessel.
0/47/2044 055: //				0.1 5	0.000		Basket loaded with items and unidentified weight. Small forklift used-started to tilt-SWA-did lift with
9/17/2014 Office/Warehouse	Non-Diving	None	Near Miss	Other Equipment	Office/Warehouse		correct forklift.
9/17/2014 GoM	Nan Divina	Nama	First Aid	Damanal	Tanaida		Diver was filling in as a medic on vessel. Woke up in the middle of the night thinking he was having a heart attack. Severe case of acid reflux. Was sent in for further analysis.
9/17/2014 Golvi 9/17/2014 Office/Warehouse	Non-Diving Non-Diving	None Heart Issue	Near Miss	Personnel Personnel	Topside Office/Warehouse		Stress test in diver exam caught two possible heart related issues.
3/17/2014 Office/ Waterlouse	Non-Diving	i leai t issue	iveal iviiss	reisonnei	Office/ Wareflouse		Diver/Tender reached down and grabbed an odom weight-back pain and was sent in for further
9/17/2014 GoM	Non-Diving	Back Injury		Personnel			analysis.
3/1//2011 CO	Trem siring	Julian y		i ciscinici			Acetylene bottle caught fire on jobsite (on dock and in back of a truck) in a grain terminal (valve or
7/16/2014	Non-Diving	Equipment Damage	Property Damage	Other Equipment	Topside		regulator nipple?). 25 minutes to burn out.
			<u> </u>		· ·		Barge incident-pleasure craft drifted into a dive spread and drifted against the work vessel (vessel
7/16/2014 GoM	Non-Diving	Vessel Damage	Property Damage	Other Equipment	Topside		was dead in the water and helpless).
							Diving contractor deployed the LRAD system 8 times for vessel work area encroachment and vessl
7/16/2014 GoM	Diving	None	Near Miss	Other Equipment	Topside		reacted and moved away from dive site all 8 times.
7/16/2014	Non-Diving	Hand Injury	First Aid	Personnel	Topside		IMCA notifications showing a large amount of hand injuries-mostly on deck/vessel tie-up.
							Records show an increase of acclamation syndromes (heat issues) on deck. Hydrate before it is too
7/16/2014 GoM	Non-Diving	Heat Exhaustion	First Aid	Environment	Topside		late.
							Few medical evacuations (chest pains or medical issues) 3-4 occasions. Plans and drills helped out in
7/16/2014	Non-Diving	Heart Issue		Personnel	Topside		the process of safety recovery.
							Incident on a large leased DP ROV vessel-worker complaining about stomach issues-on vessel medic
							gave IV with meds without notifying anyone on board. Couple of days later, same medic gave same
7/16/2014 GoM	Non-Diving	Illness	Restricted Duty	Personnel	Topside		person another IV and turns out he had appendicitis and needed surgery.
7/16/2014	Diving	Single Fatality	Fatality	Personnel	Air Diving		Incident overseas-diver inspection on a sea chest (fatality). Local diver in scuba.
-4.0400.4							40% of all offshore incidents were hand related injuries (from one oil operator research). Encourage
7/16/2014 GoM	Non-Diving	Hand Injury	First Aid	Personnel	Other		everyone to wear gloves with cut rating of 4.
7/16/2014	Non-Diving	None	+	Personnel	Other		Research shows more physical issues not related to work is on the rise on job sites.
7/16/2014	Non Divine	None		Dorsonnol	Othor		Offichare persons calling personal physicians before reporting illnesses to prepay outh anity.
7/16/2014	Non-Diving	None	+	Personnel	Other		Offshore persons calling personal physicians before reporting illnesses to proper authority. Lion fish sting-diver stung on top of foot-reported to Wildlife and Fisheries. A recent diver counterd
7/16/2014 GoM	Diving	Leg Injury		Environment			30 lionfish in small area.
7/16/2014 GoM	Diving Diving	Leg Injury None	Near Miss	Diving Equipment		QΩ	Loss of communication on job site-diver at 89ft
7/10/2014 GOIVI	Diving	INUTIC	ואכמו ואווטט	Priving Equipment	+	89	Setting riser clamp-tugger being used as a hold back for clamp-hand reached back behind him and
							got pinched in clamp and breaks couple of fingers-surge from vessel was 8ft. Hand should be in front
5/14/2014 GoM	Non-Diving	Hand Injury	Recordable Incident	Weather	Topside		of face at all times.
5/14/2014 GoM	Non-Diving	Equipment Damage	Near Miss	Other Equipment	Topside		Near miss-sling/wire incident-vessel surged and crane wire broke and block fell.

	1	T			1		T T
5/14/2014	GoM	Non-Diving	Arm Injury		Personnel	Topside	Diver woke up with a sore shoulder-had him shipped in, but may have had other issues to address.
			, , , , , , , , , , , , , , , , ,			Горили	DP vessel operating on SPAR (Divers in SAT) and weather conditions changed rapidly and tug pushed
ļ							back against vessel and damaged the thruster. Used another line to re-establish connection to
5/14/2014	GoM	Diving	Vessel Damage	Property Damage	Weather	Saturation	vessel.
							Deepwater mooring recover-barge and tug hipped up-drifted off area and came over top of power
5/14/2014	GoM	Non-Diving	None		Other Equipment	Topside	cable.
							Fire at sea-flames inside tool compressor, muffler wrap on generator, blower unit on SATsystem
5/14/2014		Non-Diving	Equipment Damage	Property Damage	Other Equipment	Topside	smoking-inside a hot box, blanket for heat treatment caught fire .
5/14/2014	GoM	Diving	None	Near Miss		Gas Diving	180 Surface gas dive at 180ft and diver had to go on surface gas.
							Emergency preparedness. Seaman on 4pt had personal health issues and did not have a helipad. It
							was decided to utilize a USCG helicopter medical evacuation. Person is doing well, crew reacted
ļ							well, medical management through DMT and medical director. It is good to look at your emergency
2/11/2014	GoM	Non-Diving	Illness		Personnel	Topside	plans to ensure should an emergency occur you have a strong plan in place.
2/11/2011	00111	Non Bring	IIIICSS		rersonner	Topside	Dryer incident aboard DSV while at dock. Towels used to clean fryer were washed and then placed
							into dryer. The towels began to smoke, power to the dryer was isolated and the towels soaked with
2/11/2014	GoM	Non-Diving	None	Property Damage	Personnel	Topside	water and removed. No one was injured.
							Empty personnel basket being lifted off deck, tag line under personnel basket wrapped around
ļ							spotters leg and lifted him up about 15ft. Tag lines should be an area of focus and should be
2/11/2014	GoM	Non-Diving	None		Operational Control	Topside	addressed in JSA.
							ROV operation, JSA performed and moored to structure downwind side to H2S structure, entire crev
ļ							went to SCBAs and all crew successfully donned equipment and vessel disengaged from structure.
							Cascade whips were a little short, one crew member did not hear the alarm go off but was notified.
2/11/2014	GoM	Non-Diving	None	Near Miss	Operational Control	Topside	All and all a successful event.
2/44/2044			S: 1 5 . I':	F !!!	0.1 5		Diver fatality in Italy-during scrapping operations, diver's leg was crushed by a piece of metal. He
2/11/2014	International TBD	Diving	Single Fatality	Fatality	Other Equipment		was recovered to surface and died of internal bleeding.
ļ							Rig off the coast of Africa, two guys had flu and one had stomach bug. OIM kept personnel on and ir
ļ							three days, 7 personnel were ill. In one week, 47 personnel were sick. The eventually 72 people
1/15/2014		Non-Diving	Illness	First Aid	Personnel	Topside	were sick. It too two and a half weeks to get everyone well.
1/15/2011		Tron biving	iiiicss	T II S C 7 II G	reisonner	Topside	Jetting down a riser in 5ft of water, three-man crew, shallow field working for quite some time.
ļ							Operation for the day to jet down riser, diver goes down without bailout, gets to 10ft-valve assembly
							on side of ditch which slid down and caught umbilical between helmet and d-ring. Diver ditched hat
1/15/2014	Inland	Diving	Single Fatality	Fatality	Personnel	Air Diving	5 and with no bailout, did not recover.
1/15/2014		Diving	Multiple Fatality	Fatality			On December 12th, the Washington post had an article about two Navy Divers that drowned.
							Early December incident involving helicopter. 8 guys onboard doing crew change, helo came down
1/15/2014	GoM	Non-Diving	None	First Aid	Other Equipment	Topside	with hard landing. Under investigation, everyone was okay.
ļ							New York and all the control of the
							Near miss and all stop surrounding weather. Sim ops were condensed due to time line, fixing to move anchors, getting ready for travel, rig to move equipment to platform and personnel exiting
ļ							platform, divers in deco. Subsequent near miss and some good all stops regarding weather, there is
1/15/2014	GoM	Non-Diving	None	Near Miss	Weather	Topside	no reason to get in a rush and slow down and recognize weather issues.
1/15/2011	COM	Tron Diving	Hone	ivedi iviiss	Wedther	Topside	Derrick barge with SAT system-two part line on number two black to make service lifts to pull
							conductor. Sitting in seas and weather, surge and wire rope parted with diver in water and he
							moved away and wire rope passed close to him. Planned and recognized that there was risk pulling
1/15/2014	GoM	Diving	None	Near Miss	Weather	Saturation	conductor, scope should have been proofing conductor prior to lift. Way too close near miss.
							Norwegian related divers suing state for injuries in 70s and 80s, they were thrown out of court in
1/15/2014		Diving			Personnel	Other	Norway and Court of Human Rights has taken up account.
 -							Jetting on a subsea assembly and the nozzle hit a valve with a little small release of product. No on
11/20/2013	GoM	Diving	Environmental Damage	Near Miss	Other Equipment		was injured, ensure that personnel are competent to perform jetting operations and aware of area.
12, 20, 2013			1				Pipeline was being abandoned and line was damaged around check valve (what hit check valve?)
22, 20, 2013					1	I	which caused a small release, then line was shut in. There was a lack of competent personnel
22, 20, 2013							
		a					running the project, stop work is imperative and could have prevented this incident from occuring.
11/20/2013		Diving	Environmental Damage	Property Damage	Personnel		running the project, stop work is imperative and could have prevented this incident from occuring. No one was injured.
		Diving	Environmental Damage	Property Damage	Personnel		running the project, stop work is imperative and could have prevented this incident from occuring. No one was injured. Individual fell on back deck and broke his knee cap. The root cause was that he tripped over his
11/20/2013	GoM					Tonside	running the project, stop work is imperative and could have prevented this incident from occuring. No one was injured. Individual fell on back deck and broke his knee cap. The root cause was that he tripped over his coveralls. He was wearing the FRC coverall, and it was oversized due to the heat, which contributed
	GoM	Diving Non-Diving	Environmental Damage Leg Injury	Property Damage Recordable Incident		Topside	running the project, stop work is imperative and could have prevented this incident from occuring. No one was injured. Individual fell on back deck and broke his knee cap. The root cause was that he tripped over his
11/20/2013	GoM					Topside	running the project, stop work is imperative and could have prevented this incident from occuring. No one was injured. Individual fell on back deck and broke his knee cap. The root cause was that he tripped over his coveralls. He was wearing the FRC coverall, and it was oversized due to the heat, which contributed to tripping incident.
11/20/2013	GoM					Topside	running the project, stop work is imperative and could have prevented this incident from occuring. No one was injured. Individual fell on back deck and broke his knee cap. The root cause was that he tripped over his coveralls. He was wearing the FRC coverall, and it was oversized due to the heat, which contributed

the second of th			1	T	I	I			T
11/20/201 Geld Over Order North Heart Mos Operationed Control Other Operationed Control Other Operationed Control Other Other Operationed Control Other									Divers did everything right, identified line correctly from riser, installed a 6 000lh hot ton on what
selle in from toor of patiernm, and drawing was increase. If the could not have been staged with a considerable control of the could not have been staged with a considerable control of the could not have been staged with a considerable and staged and a control of the could not have been staged with a control of the could not have been staged with a control of the could not have been staged with a control of the could not have been staged with a control of the could not have been staged and an own and the could not have been staged and an own and the count of the could not have been staged and an own and the count of the c									
12/07/003 GM Owner Name Name Name Name Name Name Name Name									, , , , ,
1/20/2013 GM									
1/12/2023 GeM Non During September 1 Septe									1
1/20/2013 GAM Non-Chiring 8e, Injury Non-Chiring 8e, Injury Non-Chiring 8e, Injury Non-Chiring 8e, Injury Non-Chiring Non-Chi	11/20/2012	CoM	Diving	None	Noor Micc	Operational Control	Othor		
1/20/2003 Gold Non Outring Ligating to the membership of the properties allocated on their Eguigneon Togothe Individual Cell	11/20/2013	GOIVI	DIVING	None	inear iviiss	Operational Control	Other		·
1/20/2013 Code Nove-Driving Leg Injury Recordable incident Other Equipment Topicide Opinion Recordable incident Opinion Recordable incident Opinion Recordable incident Opinion Recordable Opinion Rec									
11/20/2013 Gold Non-Diving N	44/20/2042	C-14	Non Birton	Landalian.	Dana adalah basida at	044 5	Tourists		
1/20/2013 Gold Non-Cloving None Near Miss Personnel Togiste to except personal relationing point and interest prime load and was not expressed to the except personal prime load and was not empared. The prime load was not extra major from load and was not empared. The prime load was not extra major from load and was not empared. The prime load was not extra major from load and was not empared. The prime load was not extra major from load and was not empared. The prime load was not extra major from load and was not extra major from load and was not extra major from load was not extra major from load and was	11/20/2013	GOIVI	ואסח-טועות	Leg injury	Recordable incident	Other Equipment	Topside		, ,
1/20/2013 Gold Non-Driving No									=
Divine operations performing underwater impactions, sin op desiation submitted, following procedures, notifying all personnel when divers either and either the water. Papers 1200 hours, the procedures, notifying all personnel when divers either and either the water. Papers 1200 hours, the procedures in policy and personnel when developed the water. Papers 1200 hours, the procedures in policy and papers and personnel when developed the water. Papers 1200 hours, the procedures in policy and papers and p	/22/22/2						L		
procedures, nonfringing all personnel when dever extracted and extract the water. Approx. 100 house, the part of t	11/20/2013	GOIM	Non-Diving	None	Near Miss	Personnel	Topside		not engage brake when leaning out. Rigger was away from load and was not injured.
procedures, nonfringing all personnel when dever extracted and extract the water. Approx. 100 house, the part of t									District of the second of the
Treed to get in south with platform, radio silvance dur to performing show without anothing diversity and own performed and an original previous exists and ofference of a sub-standing investigation to determine ones cause Performany leavon learned was a charge occurred that instead of mechanically cutting tubing a Performany leavon learned was a charge occurred that instead of mechanically cutting tubing a Religious provided by the plant of the children of t									
y18/203 com									
Preliminary lesson learned was a change occurred that instead of mechanically actificing bulling a decision was marked to should instead and that all parties in the decision was marked with all parties in the decision was marked with all parties in the additional parties of the should instead of the book of instead. Failer to communicate with all parties in the decision was marked glefter in eye with required flushing to remove detain and a vivil to the distort at the eye shifter removing Pequired PEP. Employees have lead debtris fall in their eye, while removing Pequired PEP. Employees have lead debtris fall in their eye, while removing required PEP. Employees have lead debtris fall in their eye, while removing Pequired PEP. Employees have lead debtris fall in their eye, while removing Pequired PEP. Employees have lead debtris fall in their eye, while removing Pequired PEP. Employees have lead debtris fall in their eye, while removing Pequired PEP. Employees have lead debtris fall in their eye, while removing Pequired PEP. Employees have lead debtris fall in their eye, while removing required PEP. Employees have lead debtris fall in their eye, while removing required PEP. Employees have lead debtris fall in their eye, while removing required PEP. Employees have lead debtris fall in their eye, while removing required PEP. Employees have lead debtris fall in their eye, while removing required PEP. Employees the debtris fall in their eye, while removing required PEP. Employees fall in their eye, while removing required PEP. Employees fall in their eye, while removing required PEP. Employees fall in their eye, while removing required PEP. Employees fall in their eye, while removing required PEP. Employees fall in their eye, while removing required PEP. Employees fall in their eye, while removing required PEP. Employees fall in their eye, while removing required PEP. Employees fall debtris fall in their eye while removing required PEP. Employees fall debtris and their and their and their and their and their and the									
9/18/203 GOM Diving None Near Miss Operational Control services of the service									1
Syl18/2013 GoM Non-Diving Eye Injury First Aid Personnel Topide Topi									
Sylayors Non-Diving Fernance Topside Sylayors									·
Systay S	9/18/2013	GoM	Diving	None	Near Miss	Operational Control			
SylaR/2013 Non-Diving Syla Injury First Aid Personnel Topoide Non-Diving Property Damage Property Dama									
9/18/2013 CoM Non-Diving Environmental Damage Property Damage Operational Control 9/18/2013 CoM Non-Diving None Property Damage Personnel Topside 9/18/2013 CoM Non-Diving None None None None None None None None									
9/18/2013 GoM Non-Diving Environmental Damage Property Damage Personnel Topside Sol of pipeline. 9/18/2013 GoM Non-Diving None Property Damage Personnel Topside International	9/18/2013		Non-Diving	Eye Injury	First Aid	Personnel	Topside		
9/18/2013 GOM Non-Diving None Property Damage Personnel Topside Improved in the safety glasses which in turn caused the lacerating sub mar mast, sender was refusing crase into hydraulic units instead of crane. No none was injuried. 9/18/2013 GOM Non-Diving Head Injury Recordable Incident 9/18/2013 GOM Diving None Near Miss Other Equipment Other Equipment Other Equipment Other Equipment Obver set up containment dome over 4 inch pipe to be cut and small debris around pipeline. Dome attached to come-along to lift pipe to make cut. Angle changed dome and lipped over prinning divers hose. Standby diver launched and classrad foular flows. Brother driver revoered to dec. Corrective measures dome has leveling appects before diver performing cutting operations possibly adding an auger to dome to content to see Bloot of its stability. Heat related lines, working on a SAI project in Arzona, deteriorated which necessitated the use of an Why the DMT rounts. Employees contained and classrad found hose. Bloot Both MTS for the guida's response. 9/18/2013 GOM Non-Diving None Near Miss Personnel Air Diving Allows and the service of the ser									
9/18/2013 GoM Non-Diving None Property Damage Personnel Topside tank instead of crane. No none was injured. 9/18/2013 GoM Non-Diving Head Injury Recordable Incident Personnel Topside the safety glasses which in turn caused the lacration. Journal of the safety glasses which in turn caused the lacration. 9/18/2013 GoM Oiving None Near Miss Other Equipment Other Equipment Other Standby Governed a little too low as it was coming up, sling had all title stored energy and struck the rigger on the safety glasses which in turn caused the lacration. One was the safety glasses which in turn caused the lacration. 9/18/2013 GoM Oiving None Near Miss Other Equipment Other Equipment Other Equipment Other Standby LASS for diver recovery, completed phase 1 of project relocated LASS to other side of structure work LASS for diver recovery, completed phase 1 of project relocated LASS to other side of structure standby LASS bumped member. MOC issued to continue work after review. Oiver set up containment dome over 4 inch pipe to be cut and small debris around pipeline. Dome tractice of the side of structure standby LASS bumped member. MOC issued to continue work after review. Oiver set up containment dome over 4 inch pipe to be cut and small debris around pipeline. Dome tractice of the safety glasses which in turn cannel dispend over princing divers hose. Standby diver launched and cleared fouled hase. Both divers reovered to deck. Corrective measures dome has been largely and subject to dome to connect to sea floor for stability. Heat Testaded littles, working on a 54 project in Activities, working on a 54 project in Activities, working on a 54 project of dome to connect to sea floor for stability. Heat Eshaustion Restricted Duty Weather Topside Quiet response. Stop work issued during installing hull piping, Had an ROV operated valve supposed to go in water open, however it was closed. Before topside launched was supposed to go in water open, however it was closed. Before topside launched was supposed to go in water open,	9/18/2013	GoM	Non-Diving	Environmental Damage	Property Damage	Operational Control		50	
Singles struck by a shackle received sutures. Installing turnbuckles and while installing 51 our of 54, lowered a little to low as it was coming up, sling had a little stored energy and struck the rigger on the safety glasses which in turn caused the laceration. Page									
9/18/2013 GoM Non-Diving Head Injury Recordable Incident Personnel Topside Unwered a filtit boo low as it was coming up, sling had a little stored energy and struck the rigger on the safety glasses which in turn caused the laceration. Divo por from structure two LARS for diver recovery, completed phase 1 of project relocated LARS to other side of structure standby LARS bumped member. MOC issued to continue work after review. Diver set up containment dome over 4 inch pipe to be cut and small debris around pipeline. Dome attached to come along to lift pipe to make cut. Angle changed dome and tiped over prinning divers recovered to dec. Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an auger to dome to connect to see floor for stability. Heat Exhaustion Restricted Duty Weather Topside Store the Diving Store the Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an any by the Diving August to the DMT store. Depreted in factors, deteriorated quickly and kudos to the DMTs for the quick response. Stop work Issued during installing hull piping. Had an ROV operated valve supposed to be wrifted. However, it was allumeded closed. An ROV vessel was in close prominity which opened they aver, instead of jumping a diver. Priz/2013 GoM Diving Environmental Damage Personnel Other University of the property Damage Personnel Diving Bash Near Miss Personnel Diving Bash None Property Damage Personnel Diving Bash None Restricted Daving Single Fatality Fatality Operational Control Air Diving Single Fatality Fatality Operational C	9/18/2013	GoM	Non-Diving	None	Property Damage	Personnel	Topside		·
9/18/2013 GoM Non-Diving None Near Miss Other Equipment Other Sequipment O									1
9/18/2013 GoM Diving None Near Miss Other Equipment Other Structure two LARS for diver recovery, completed phase 1 of project relocated LARS to other side of structure standby LARS bumped member. MOC issued to continue work after review. Diver set up containment dome over a inch pipe to be cut and small debris around pipeline. Dome attached to come-along to lift pipe to make cut. Angle changed dome and tipped over pinning divers hose. Standby diver launched and cleared fouled hose. But niders received to deck. Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an auger to do mote connect to sea floor for stability. 9/18/2013 One Diving None Near Miss Personnel Air Diving auger to do mote to connect to sea floor for stability. Heat related illness, working on a SAT project in Arzona, deteriorated which necessitated the use of an IV by the DMT onsist. Employees' condition deteriorated quickly and kudos to the DMTS for the DM									
9/18/2013 GoM Diving None Near Miss Other Equipment Ones side of structure standby LARS bumped member. MOC issued to continue work after review. Diver set up containment dome over 4 inch pipe to be cut and small debris around pipeline. Dome attached to come-along to lift pipe to make cut. Angle changed dome and tipped over pinning divers hose. Standby devire launched and deared foulded hose. Both divers reverved to deck. Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an auger to dome to connect to sea floor for stability. 9/18/2013 Onlying None Near Miss Personnel Air Diving auger to dome to connect to sea floor for stability. 9/18/2013 Onlying Heat Exhaustion Restricted Duty Weather Topside Quick response. 9/18/2013 GoM Non-Diving None Near Miss Other Equipment Other Quick response. 9/18/2013 GoM Non-Diving None Near Miss Other Equipment Other Jumping a diver. 9/18/2013 GoM Diving Environmental Damage Near Miss Personnel Near Miss Personnel Diving Rash Near Miss Personnel Near Miss Personnel Diving Rash Near Miss Personnel Diving None Near Miss Personnel Diving Rash Initiations. 7/17/2013 GoM Diving Rash None Property Damage Personnel Saturation Diving None Property Damage Personnel Saturation Diving None Property Damage Personnel Saturation Diving Saturation Diving Saturation Diving Single Fability Fability Operational Control Air Diving Solven Damage Diving Statisticy on a wind farm project overseas. A cement make year on top of diver. 7/17/2013 Diving None Property Damage Personnel Saturation Diving Saturation Diving Single Fability Fability Operational Control Air Diving Solven measures and pass the review. 8 Diving Statisticy on a wind farm project overseas, A cement make was ear on top of diver. 8 Diving Statisticy on a wind farm project overseas, A cement make as a Table 6 Cardiac event which necessitated the use of measures and taking off hat, pressure released on the first project overseas, A cement makes ear on top of diver. 7/17/20	9/18/2013	GoM	Non-Diving	Head Injury	Recordable Incident	Personnel	Topside		the safety glasses which in turn caused the laceration.
9/18/2013 GoM Diving None Near Miss Other Equipment Ones side of structure standby LARS bumped member. MOC issued to continue work after review. Diver set up containment dome over 4 inch pipe to be cut and small debris around pipeline. Dome attached to come-along to lift pipe to make cut. Angle changed dome and tipped over pinning divers hose. Standby devire launched and deared foulded hose. Both divers reverved to deck. Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an auger to dome to connect to sea floor for stability. 9/18/2013 Onlying None Near Miss Personnel Air Diving auger to dome to connect to sea floor for stability. 9/18/2013 Onlying Heat Exhaustion Restricted Duty Weather Topside Quick response. 9/18/2013 GoM Non-Diving None Near Miss Other Equipment Other Quick response. 9/18/2013 GoM Non-Diving None Near Miss Other Equipment Other Jumping a diver. 9/18/2013 GoM Diving Environmental Damage Near Miss Personnel Near Miss Personnel Diving Rash Near Miss Personnel Near Miss Personnel Diving Rash Near Miss Personnel Diving None Near Miss Personnel Diving Rash Initiations. 7/17/2013 GoM Diving Rash None Property Damage Personnel Saturation Diving None Property Damage Personnel Saturation Diving None Property Damage Personnel Saturation Diving Saturation Diving Saturation Diving Single Fability Fability Operational Control Air Diving Solven Damage Diving Statisticy on a wind farm project overseas. A cement make year on top of diver. 7/17/2013 Diving None Property Damage Personnel Saturation Diving Saturation Diving Single Fability Fability Operational Control Air Diving Solven measures and pass the review. 8 Diving Statisticy on a wind farm project overseas, A cement make was ear on top of diver. 8 Diving Statisticy on a wind farm project overseas, A cement make as a Table 6 Cardiac event which necessitated the use of measures and taking off hat, pressure released on the first project overseas, A cement makes ear on top of diver. 7/17/20									
Diver set up containment dome over 4 inch pipe to be cut and small debris around pipeline. Dome attached to come-along to lift pipe to make cut. Angle changed dome and tipped over pinning divers hose. Standby diver launched and cleared foulded hose. Both divers reovered to deck. Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an auger to dome to connect to sea floor for stability. Personnel Air Diving Heat Exhaustion Restricted Duty Weather Topside									
attached to come-along to lift pipe to make cut. Angle changed dome and tipped over pinning divers hose. Standby diver launched and cleared fouled hose. Both divers reovered to deck. Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an auger to dome to connect to see floor for stability. Personnel	9/18/2013	GoM	Diving	None	Near Miss	Other Equipment			other side of structure standby LARS bumped member. MOC issued to continue work after review.
attached to come-along to lift pipe to make cut. Angle changed dome and tipped over pinning divers hose. Standby diver launched and cleared fouled hose. Both divers reovered to deck. Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an auger to dome to connect to see floor for stability. Personnel									
hose. Standby diver launched and cleared fouled hose. Both divers reovered to deck. Corrective measures dome has leveling aspects before diver performing cutting operations possibly adding an auger to dome to connect to sea floor for stability. Heat related liliness, working on a SAT project in Arizona, deteriorated which necessitated the use of an IV by the DMT onsite. Employees' condition deteriorated quickly and usdos to the DMTS for the quick response. Stop work issued during installing hull piping. Had an ROV operated valve supposed to go in water open, however it was closed. Before topside launched it was supposed to be verified. However, it was launched closed. An ROV vessel was in close proximity which opened the valve, instead of jumping a diver. 7/17/2013 GoM									
9/18/2013 GoM Diving None Near Miss Personnel Air Diving auger to dome to connect to sea floor for stability. Personnel Air Diving Heat Exhaustion Restricted Duty Weather Topside and the treated illness, working on a SAT project in Arizona, deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated quickly and kudos to the DMTS for the quick response. Stop work issued during installing hull piping, Had an ROV operated valve supposed to go in water open, however it was closed. Before topside launched it was supposed to be verified. However, it was launched closed. An ROV vessel was in close proximity which opened the valve, instead of jumping a diver. 7/17/2013 GoM Diving Environmental Damage Near Miss Personnel Hot tap into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put in action. Treat every line as if it is live. Diver working in area where distillates are located. Be aware and use the proper skin cream in treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation De SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Environmental Damage Personnel Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Operational Control Air Diving Single Fatality Operational Control Air Diving Single fatality on a wind farm project overseas. A cement mat was set on to pol diver. Cardiac event which necessitated launching a Pelicopter, during a major weather occurrence, to									
9/18/2013 GOM Diving None Near Miss Personnel Air Diving auger to dome to connect to sea floor for stability. Heat Exhaustion Restricted Duty Weather Topside auk related illness, working on a SAT project in Arizona, deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT onsite and IV by the DMT onsite. Employees' condition deteriorated which necessiated the use of an IV by the DMT on size of the DMT on Stable supposed to go in water of personal and not personal									
Heat related illness, working on a SAT project in Arizona, deteriorated which necessitated the use of an IV by the DMT onsite. Employees' condition deteriorated quickly and kudos to the DMTS for the quick response. Stop work issued during installing hull piping. Had an ROV operated valve supposed to go in water open, however it was closed. Before topogied launched it was supposed to be verified. However, it was launched closed. An ROV vessel was in close proximity which opened the valve, instead of jumping a diver. 1/17/2013 GoM Diving Environmental Damage Near Miss Personnel University of the policy of the policy open, however it was closed. Before topogied launched it was supposed to be verified. However, it was launched closed. An ROV vessel was in close proximity which opened the valve, instead of jumping a diver. 1/17/2013 GoM Diving Environmental Damage Near Miss Personnel University of the policy of the policy open, however it was closed. Before the was tagged abandoned but was live. Procedures were put in action. Treat every line as if it is live. 1/17/2013 GoM Diving Rash Near Miss Environment Topside Diving Water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 1/17/2013 Diving None Property Damage Personnel Saturation Diving Single Fatality Operational Control Saturation Diving Single Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. 1/17/2013 International TBD Diving Single Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver.									
an IV by the DMT onsite. Employees' condition deteriorated quickly and kudos to the DMTS for the quick response. Stop work issued during installing hull piping. Had an ROV operated valve supposed to go in water open, however it was closed. Before topside launched it was supposed to be verified. However, it was launched closed. An ROV vessel was in close proximity which opened the valve, instead of jumping a diver. Political Comment Diving Diving Environmental Damage Near Miss Personnel Diving Diving Environmental Damage Near Miss Environment Diver working in area where distillates are located. Be aware and use the proper skin cream in treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. Application Diving None Property Damage Personnel Diving Diving Diving Diving Resident Diving Diving Diving Diving Diving Resident Diving Di	9/18/2013	GoM	Diving	None	Near Miss	Personnel	Air Diving		,
9/18/2013 Diving Heat Exhaustion Restricted Duty Weather Topside quick response. Stop work issued during installing hull piping. Had an ROV operated valve supposed to go in water open, however it was closed. Before topside launched it was supposed to go in water open, however, it was closed. An ROV vessel was in close proximity which opened the valve, instead of jumping a diver. 7/17/2013 GoM Diving Environmental Damage Near Miss Personnel University of the Equipment Diver working in area where distillates are located. Be aware and use the proper skin cream in treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Environmental Damage Property Damage Personnel Saturation Diver bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Operational Control Air Diving SB Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to									Heat related illness, working on a SAT project in Arizona, deteriorated which necessiated the use of
Stop work issued during installing hull piping. Had an ROV operated valve supposed to go in water open, however it was closed. Be fore topside launched it was supposed to be verified. However, it was launched closed. An ROV vessel was in close proximity which opened the valve, instead of jumping a diver. 7/17/2013 GoM Diving Environmental Damage Near Miss Personnel Hot tap into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put in action. Treat every line as if it is live. 7/17/2013 GoM Diving Rash Near Miss Environment Topside and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation Diving Hilness Near Miss Personnel Diving Single Fatality Operational Control Saturation 7/17/2013 International TBD Diving Single Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Stop work issued during installing hull piping. Had an ROV operational Roove, it was alonged. However, it was looked. An ROV vessel was in close from the My contained to be verified. However, it was launched closed. An ROV vessel was in close proximity which opened the valve, instead of jumping adver. Hot tap into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put in action. Treat every line as if it is live. Diver working in area where distillates are located. Be aware and use the proper skin cream in treating skin irritations. Shallow water underwater inspection									an IV by the DMT onsite. Employees' condition deteriorated quickly and kudos to the DMTS for the
open, however it was closed. Before topside launched it was supposed to be verified. However, it was launched closed. An ROV vessel was in close proximity which opened the valve, instead of jumping a diver. 7/17/2013 GoM Diving Environmental Damage Near Miss Personnel Hot tap into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put in action. Treat every line as if it is live. Diver working in area where distillates are located. Be aware and use the proper skin cream in treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation Diving Liness Near Miss Personnel Diving Environmental Damage Property D	9/18/2013		Diving	Heat Exhaustion	Restricted Duty	Weather	Topside		, · · ·
9/18/2013 GOM Non-Diving None Near Miss Other Equipment Other Jumping a diver. 7/17/2013 GOM Diving Environmental Damage Near Miss Personnel Were put in action. Treat every line as if it is live. 7/17/2013 GOM Diving Rash Near Miss Environment 7/17/2013 GOM Diving Rash Near Miss Environment 7/17/2013 GOM Diving Rash Near Miss Environment 7/17/2013 GOM Diving Hand Injury Other Equipment Topside and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation Diving Illness Near Miss Personnel Diving Environmental Damage Property Damage Personnel Saturation Diving Diving Environmental Damage Property Damage Personnel Saturation Diving Diving Environmental Damage Property Damage Personnel Saturation Diving Diving Single Fatality Operational Control Saturation Diving Single Fatality Single Fatality Operational Control Saturation Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to	1								
9/18/2013 GoM Non-Diving None Near Miss Other Equipment Other jumping a diver. 7/17/2013 GoM Diving Environmental Damage Near Miss Personnel Hot tap into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put in action. Treat every line as if it is live. 7/17/2013 GoM Diving Rash Near Miss Environment Diving Rash Near Miss Environment Treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to									
Tyl 7/2013 GoM Diving Environmental Damage Near Miss Personnel Hot tap into a mis-identified pipeline. Pipeline was tagged abandoned but was live. Procedures were put in action. Treat every line as if it is live. Diver working in area were distillates are located. Be aware and use the proper skin cream in treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Illness Near Miss Personnel 120 Diver omitted decompression on lay barge in malaysia. Treated as a Table 6 7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to									
7/17/2013 GoM Diving Environmental Damage Near Miss Personnel were put in action. Treat every line as if it is live. Diver working in area where distillates are located. Be aware and use the proper skin cream in treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation Diving Hand Injury Diving Illness Near Miss Personnel Diving Diving Environmental Damage Property Damage Operational Control Saturation Diversity of the plant of the property Damage Diving Single Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to	9/18/2013	GoM	Non-Diving	None	Near Miss	Other Equipment	Other		
Diver working in area where distillates are located. Be aware and use the proper skin cream in treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation Diving Illness Near Miss Personnel Diving Diving Diving Diving Environmental Damage Property Damage Operational Control Saturation Diving Single Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to									
7/17/2013 GoM Diving Rash Near Miss Environment treating skin irritations. Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Environmental Damage Property Damage Personnel Saturation Diving Environmental Damage Property Damage Operational Control Saturation Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to	7/17/2013	GoM	Diving	Environmental Damage	Near Miss	Personnel			,
Shallow water underwater inspection job at Galv 209. A grit blasters' nozzle was plugged/clogged up and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Illness Near Miss Personnel 120 Diver omitted decompression on lay barge in malaysia. Treated as a Table 6 7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Patality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to									Diver working in area where distillates are located. Be aware and use the proper skin cream in
and had stored energy. When a diver was getting out of water and taking off hat, pressure released and hit him in the hand. Medical treatment needed. 7/17/2013 Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Illness Near Miss Personnel 120 Diver omitted decompression on lay barge in malaysia. Treated as a Table 6 7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to	7/17/2013	GoM	Diving	Rash	Near Miss	Environment			
7/17/2013 Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diver omitted decompression on lay barge in malaysia. Treated as a Table 6 7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to									
7/17/2013 Diving None Property Damage Personnel Saturation DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss. 7/17/2013 Diving Illness Near Miss Personnel 120 Diver omitted decompression on lay barge in malaysia. Treated as a Table 6 7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to	1								and had stored energy. When a diver was getting out of water and taking off hat, pressure released
7/17/2013 Diving Illness Near Miss Personnel 120 Diver omitted decompression on lay barge in malaysia. Treated as a Table 6 7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to	7/17/2013	GoM	Diving	Hand Injury		Other Equipment	Topside		and hit him in the hand. Medical treatment needed.
7/17/2013 Diving Illness Near Miss Personnel 120 Diver omitted decompression on lay barge in malaysia. Treated as a Table 6 7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to									
7/17/2013 Diving Environmental Damage Property Damage Operational Control Saturation Dive bell was dropped a few meters on the M/v Skandia Norway. Umbilical was damaged. 7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to					Property Damage		Saturation		DP SAT project in Malaysia. Hydraulic impact wrench was pulled into the thruster. Near miss.
7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to	7/17/2013		Diving	Illness	Near Miss	Personnel		120	Diver omitted decompression on lay barge in malaysia. Treated as a Table 6
7/17/2013 International TBD Diving Single Fatality Fatality Operational Control Air Diving 98 Diving fatality on a wind farm project overseas. A cement mat was set on top of diver. Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to									
Cardiac event which necessitated launching a helicopter, during a major weather occurrence, to			Diving	Environmental Damage	Property Damage	Operational Control	Saturation		·
	7/17/2013	International TBD	Diving	Single Fatality	Fatality	Operational Control	Air Diving	98	
5/15/2013 GoM Non-Diving Heart Issue Restricted Duty Personnel Topside retrieve a foreman from offshore.									1
	5/15/2013	GoM	Non-Diving	Heart Issue	Restricted Duty	Personnel	Topside		retrieve a foreman from offshore.

				1			
							Standby diver participating in drill, could not clear, and cancelled drill. Diver was examined
5/15/2013	GoM	Diving	Illness	First Aid	Personnel	Air Diving	determined to be unfit for duty. Thankfully he was caught during a drill and not during work.
		-					AB on vessel had a bone spur on his foot and condition worsened. Reveled importance of reporting
5/15/2013	GoM	Non-Diving	Leg Injury	First Aid	Personnel	Topside	and being fit for duty before returning to work.
5/15/2013		Diving	Hand Injury	First Aid	Environment		Diver saw lionfish in area (ST 152) and was stung on hand. First aid taken.
0, 20, 2020			i i i i i i i i i i i i i i i i i i i				Lionfish incident in saturation environment. Diver inadvertently struck lionfish and was returned to
5/15/2013	GoM	Diving	Hand Injury	First Aid	Environment	Saturation	bell. General first aid.
0, 20, 2020			i i i i i i i i i i i i i i i i i i i				Bends incidents, which after review, turned out to be an PFO. Neurological analysis need to be
5/15/2013	GoM	Diving	Illness		Diving Equipment	Gas Diving	performed correctly when any possible bend incidents occures.
0/ 10/ 2010		58			Sitting Equipment	ous simile	Cutting concrete on a 30" pipeline, smashed finger with a sledgehammer causing slight fracture to ti
ļ							of finger. During pre-job, an initial procedure it was decided to use wedges and circular saw to cut
ļ							the concrete; however, once in the field the end use pipeline company did not want to use a circula
5/15/2013	GoM	Diving	Hand Injury	Recordable Incident	Personnel		saw and changed procedure.
3/13/2013	COIVI	DIVING	riana injury	recordable incident	reisonner	+	Saw and changes procedure.
ļ							Refinery incident-taking apart a separator, 12 ft diameter. Flushed with nitrogen and water, followe
ļ							all procedures and removing bolts. Last few bolts were hot cut and during cutting operation, there
5/15/2013	Office/Warehouse	Non-Diving	Single Fatality	Fatality	Other Equipment	Office/Warehouse	were trapped hydrocarbons which caused an explosion, killing one person and injuring six.
3/13/2013	Office, warehouse	Iton Diving	Single raturey	Tatanty	Other Equipment	Office, Warehouse	Production incident-changing tip on 40K water blaster, there is a special tool to remove barrel to
ļ							work on tip. Instead of using designed tool, employees utilized a crescent wrench on tip. Equipmen
ļ							was locked out and hand slipped causing high pressure to escape through water blaster which
E /1E /2012		Nan Divina	Hand Inium.	Final Aid	Davasanal	Office (March access	
5/15/2013	6	Non-Diving	Hand Injury	First Aid	Personnel	Office/Warehouse	caused a minor injury to employee.
ļ							Makila Dan kanada da da da da manada a da manada da manada da manada da manada da da da da da da da da da manada da
ļ							Mobile Bay-Leaving dock in the morning, there was very bad fog, with limited visibility. Vessel was
ļ							moving very slowly, heading out to location. All of a sudden Captain saw on rader something
							approaching hard and fast. An all stop was immediately called and the other (commercial fishing)
5/15/2013	GoM	Non-Diving	None	Near Miss	Weather	Topside	vessel passed within 50ft. Lesson learned, if foggy, should not leave dock until visibility improves.
ļ							
ļ							Working in shallow water, a 4pt vessel was picking up anchors when a shrimp boat encroached on
ļ							operation. 4pt vessel tried unsuccessfully to hail on-coming vessel and it passed very near anchor
5/15/2013	GoM	Non-Diving	None	Near Miss	Other Equipment		spread. Dept. of Homeland Security showed up and went after shrimp boat.
							During inspection of rental jet pump, downstream valves should have been rated at 400 psi. Instead
3/1/2013	8	Non-Diving	None	Near Miss	Other Equipment	Other	both were rated at 250 psi. No one was hurt as pre-inspection of equipment caught issue.
0/1/2010				Treat triiss	other Equipment		Jet hose separated from nozzle, caused from fatigue. It is important to inspect your equipment prior
3/1/2013	GoM	Non-Diving	None	Near Miss	Other Equipment	Topside	to use.
3/1/2013	CONT	Iton Biving	Hone	real wiiss	Other Equipment	Торыше	CNS incident. Type 2 after review of dove no anomalies. It was post chamber run on 140ft table and
3/1/2013	GoM		Illness		Diving Equipment		believed to be a PFO.
3/1/2013		Nan Divina		Daga udabla la sida ut		Tanaida	
3/1/2013	GOIVI	Non-Diving	Arm Injury	Recordable Incident	Other Equipment	Topside	Falls from top bunk and sustaining injuries. Look at all hazards involved getting in and out of bunks.
ļ							Air dive from DP vessel. Dive fouled on bottom, perhaps panicked, swam to surface, fell back down
2/4/2042			S. 1 5 . 1.	E . 19			and took an injury. Stand by diver jumped in and when diver was brought to surface, he was
3/1/2013	GoM	Diving	Single Fatality	Fatality	Personnel	Air Diving	unresponsive.
ļ							
ļ							A near miss occurred hold back wire on LARS system (secondary wire) and had been out for a long
!							time on theis spread. Since this wire wasn't being used it was taped up with caution tape and it
		L.					covered and allowed a moisture buildup. A proper inspection could not be performed due to cautio
1/23/2013	GoM	Non-Diving	None	Near Miss	Environment	Topside	tape covering hazard. Wasn't a lifting wire, it was a static wire.
!							Employee getting out of bunk, slipped on ladder and struck head, falling ended up having to have
1/23/2013	GoM	Non-Diving	Back Injury	Recordable Incident	Personnel	Topside	back surgery.
!							Vessel went dead in the water and battery charge system wasn't working properly and realized that
1/23/2013	GoM	Non-Diving	Vessel Damage	Near Miss	Other Equipment	Topside	although they were charging, it was not reaching battery.
							Diver umbilical was severed while DP vessel drifted offsite and diver ended up on top of structure for
!							46 minutes before he could be rescued. No injuries were sustained. He was monitored and returne
1/23/2013	GoM	Diving	None	Recordable Incident	Other Equipment	Saturation	to work in few weeks-shared by DSV Bibby Topaz.
							Encroachment from small crabbing vessel in shallow water (15') during a site clearance. Diver
1	1	Diving	None	Near Miss	Personnel	Air Diving	15 working 150' from barge and an outboard crabbing boat crossed over diver and cut poly line.
11/14/2012	GoM			1	1	 	Decompression Issue-Dr. was called-diver was sent to table 4, coherent and was brought back to
11/14/2012	GoM			1			
11/14/2012	GoM						
		Diving	Illness		Personnel		vessel. 34 hours later, diver had no recollection and did not remember anything. Recommended
11/14/2012		Diving	Illness		Personnel		vessel. 34 hours later, diver had no recollection and did not remember anything. Recommended sending a tender down to watch over him.
11/14/2012	GoM			Fatality		Tonside	vessel. 34 hours later, diver had no recollection and did not remember anything. Recommended sending a tender down to watch over him. Fatality related to Billy Bugh device-Crane operator lost control of a load and passenger fell from the
	GoM	Diving Non-Diving	Illness Single Fatality	Fatality	Personnel Other Equipment	Topside	vessel. 34 hours later, diver had no recollection and did not remember anything. Recommended sending a tender down to watch over him.

9/19/2012	CoM	Diving	Log Inium	Dogardable Incident	Darrannal	Caturation	Diver in Sat working off DP vessel working on downed platform. Diver had a 30" caisson roll down 400 and injure his leg. He was de-satted and medical attention provided. Diver was in a pinch point area.
9/19/2012	GOIVI	Diving	Leg Injury	Recordable Incident	Personner	Saturation	Diver 143ft SurD02 out on 150/50 table, in water and chamber time unremarkable. He reported pain
0/10/2012	CoM	Diving	Illnoss		Dorconnol	Air Diving	
9/19/2012	GOIVI	Diving	Illness		Personnel	Air Diving	143 and was placed on a TT6. After work up it was determined he had a PFO. Employee performing topside burning and burned his forearm and failed to report. He is fine, but
9/19/2012	GoM	Non-Diving	Arm Injury	Near Miss	Personnel	Topside	could have been a major event.
9/19/2012	GOIVI	INOII-DIVIIIg	Arminjury	ivedi iviiss	reisonnei	Topside	Employee utilizing swing rope in offshore California swinging onto a platform from vessel, standard
							swing not rough seas, misjudged the swing; he was caught between vessel and platform causing a
9/19/2012		Non-Diving	Back Injury	Recordable Incident	Personnel	Topside	
3/13/2012		INOII-DIVING	Dack Injury	Recordable ilicident	reisonnei	Topside	crushing injry to his pelvis. Davit type swing rope set up, davit not engineered for design and employee fell onto grating and
							davit fell into the gulf. All fields should look at their swing rope systems to ensure that they are
9/19/2012	CoM	Non-Diving	Book Injury	Recordable Incident	Other Fauinment	Tansida	designed correctly.
9/19/2012	GOIVI	INOII-DIVIIIg	Back Injury	Recordable ilicident	Other Equipment	Topside	Incorrect filter canister, CO2 instead of air, was installed into system and was recognized before
9/19/2012	GoM	Diving	None	Near Miss	Diving Equipment		incident occurred.
9/19/2012	GOIVI	Diving	None	ivedi iviiss	Diving Equipment		Ordinary Seaman had two fingers caught in rollers while untying anchor handling tug from material
9/19/2012	CoM	Non Diving	Hand Injury		Dorconnol	Tansida	
9/19/2012	GOIVI	Non-Diving	Hand Injury		Personnel	Topside	barge.
							Two students at dive school were gas diving in tank and had significant event, retrieved out of tank
							unconscious and taken to hospital. One student recovered and returned to school. One student still
9/19/2012	Office/Warehouse	Diving	Illness	Recordable Incident	Diving Equipment	Office/Warehouse	in ICU and on respirator. Gasses should always be inspected and analyzed prior to use.
							Diver in DP DSV and working on structure and performing penetration diving. Vessel had DP runoff,
							divers' umbilical was severed and fouled. He went into bailout and it took 37 minutes to retrieve
							diver. Diver was brought aboard vessel unconscious and CPR was administered. It was possible that
9/19/2012	North Sea	Diving	None	Recordable Incident	Other Equipment		the diver had 7-14 minutes without breathing gas. Diver recovered and breathing on his own.
							Near miss surface diving job, diver down 80ft setting clamps. On deck, tenders were preparing for
							next clamp and it fell overboard striking divers umbilical. Diver went on bail out and returned to
9/19/2012	GoM	Diving	None	Near Miss	Operational Control	Air Diving	80 surface without incident. It is important to verify housekeeping prior to task implementation.
							Post Hurricane Isaac-road to Fourchon was partially flooded and closed at night. Preparing to
							mobilize post storm and getting back to vessel, an All Stop was called to allow employees to return to
9/19/2012		Non-Diving	None	Near Miss	Weather	Other	work safely.
							Near miss post hurricane, returning to work in land facility and getting back to normal, had a power
							surge that could have possibly been a significant event. Things change post storm and need to verify
9/19/2012	Office/Warehouse	Non-Diving	None	Near Miss	Weather	Office/Warehouse	power situation before returning back to normal activities.
							Norfolk-performing ship husbandry work. Media reported not an ADCI member. Cleaning of ships
8/22/2012	Atlantic Ocean	Diving	Single Fatality	Fatality	Personnel	Air Diving	hulls, machine utilized to perform operations, diver connected to bail-out that was empty.
							Swing rope incident. Personnel transferring and fell between vessel and landing sustained a crushing
8/22/2012	GoM	Non-Diving	Back Injury	Recordable Incident	Personnel	Topside	injury.
8/22/2012		Non-Diving	None	Near Miss	Other Equipment	Topside	Swing rope, performed weight test and swing rope collapsed, no injury occurred.
						·	
							First aid injury while performing an underwater inspection cleaning marine growth and struck his
8/22/2012	GoM	Diving	Hand Injury	First Aid	Environment	Air Diving	hand on member. Wearing Kevlar gloves and still sustained a minor laceration.
-, , -		Ü	, , , ,			, i	End connector popped of surface diving 100ft abandoning line and during dewatering phase, gas
							plume excaped. Well thought out scope of work. Everything done according to procedure and
							passed an annulus test and end connect still seperated. Seals and grippers on design act
							independently of each other an older model; company tested and stated nothing is wrong. If
							installing end connectors, ask the question how you can be certain that the grips are set. What can
8/22/2012	GoM	Non-Diving	None	Near Miss	Other Equipment		100 be done to ensure that it is set?
0/22/2012	GUIVI	INOII-DIVIIIR	INUITE	INEQL INII22	Other Equipment	+ +	Ops west of mississippi river, identified 4 lion fish, returned to bell and contacted beach. They are
							not protected and can ber terminated. Texas wildlife and fisheries would like to be contacted on
0/22/2012		Divine	None	Noor Miss	Environment	Coturction	
8/22/2012		Diving	None	Near Miss	Environment	Saturation	location of sightings. If stung, the fix is hot water.
0/22/22/2	Cana	Divine	De als latinaria	December 1 1 1 1	Daman - I	Catumetics	Diver in saturation woke up compaining of extreme leg pain. Blew down and no relief and the
8/22/2012	GOIVI	Diving	Back Injury	Recordable Incident	Personnel	Saturation	thought is back or muscle pain.
0.100.1==:				E		<u> </u>	AMERICA has actually analytical Book and the college of the colleg
8/22/2012	GOM	Non-Diving	Rash	First Aid	Environment	Topside	MERSA has raised its ugly head. Remember to utilize cleaning products that address Staph.
							Incident Share-Two divers in water, 3 man bell teams performing indepent tasks. Noticed diver had
							claped knife on bent tube assy. Thought it was a one off incident. Again next day, same occurrence
							again. Did a review and found it was not isolated to one specific company and personnel are
		L					learning in diving school. Each school said they were not teaching that. Polled divers and found that
6/20/2012	GoM	Diving	None	Near Miss	Personnel	Saturation	it does occur. Memo sent all divers in the company that it was not an acceptable practice.

DSWG Industry Incident Near Miss Report

6/20/2012 CoM	4	Diving	None	Noor Mics	Other Fouriers est		Abandonment work occurring installing end connectors on 12" pipeline, everything was followed an annulus test completed, pushing pig from facility to end connector. Diver had exited water during testing and end connector blew off-at no point exceeding 180 psi. Still undergoing tests to
6/20/2012 GoM	1	Diving	None	Near Miss	Other Equipment		determine why this occurred and no specific error was made.
							Lacerated finger on pipeline preparation for removal project utilizing a super sea wach guillotine saw. Diver was 3/4 way through cut when his middle finger came in contact with a pinch point on saw, causing laceration that required sutures. Diver returned to work with not days away. During RCA process, it was determined the design of the saw allowed for an unguarded opening near the
6/20/2012 GoM	1	Diving	Hand Injury	Recordable Incident	Other Equipment		blade retention mechanism. Revised JSA and installed guards.
6 100 100 10 5 11			S: 1 5 1 1:	5 !!			Responded to a mayday from helicopter pilot, rig/field helicopter used different direction to enter/leave structure and clipped platform. Helicopter sat down in water and floats did not activate.
6/20/2012 GoM		Non-Diving		Fatality	Operational Control	Topside	Divers had to recover helicopter pilot's body.
5/12/2012 GoM	7	Non-Diving	None	Near Miss	Environment		Watch for staph infections in offshore environment.
5/12/2012 GoM	4	Non-Diving	Cinalo Fotolity	Fatality	Operational Control	Tonsido	Offshore person fell through a hole on a platform and resulted in a fatality. A lot of issues in the report and analysis. Randy will send a document on the incident.
3/12/2012 GOIVI	1	MOII-DIVINg	Single Fatality	Fatality	Operational Control	Topside	SAT diving in Mexico. Diver stung by sting ray and a barb from the tail went through his hot water
							suit and wet suit in his thigh. Mentioned to group to look at worst case scenario when dealing with
5/12/2012		Diving	Leg Injury	Recordable Incident	Environment	Saturation	issues like this for your response plan.
5/12/2012 GoM			Hand Injury	Necordable ilicident	Personnel	Topside	Rigger hand injury on a routine task on work deck of vessel.
3/12/2012 GOIVI	1	NOII-DIVING	Tranu injury		reisonnei	Topside	44 year old complained of chest pains. A quick and good evauaction plan was in place and got him
5/12/2012 GoM	1	Non-Diving	Heart Issue	Restricted Duty	Personnel	Topside	into the shore.
GoM		Diving	None	Near Miss	Operational Control	Saturation	During a saturation bell run, the saturation technician inadvertently began coming up on the bell winch before the diver was still standing on the clump weight frame. Miscommunication due to lack of clear, two-way communications between the sat tech and diving supervisor over a VHF radio. Additionally, the bell winch override switch in the dive control was also left on during the bell run.
00							OOC website-Several incidents where container bags were left out in the weather, used later and
							straps broke. Need to be inspected for good/usable condition. No injuries but some dry chemical
							was spilled and cleaned up. Another incident where drill pipe parts were dropped. Check life spans
							and condition before use. Quikrete warns not to be picked up by straps more than once. Use forklift
GoM	1	Non-Diving	None	Near Miss	Other Equipment	Office/Warehouse	on pallet and keep out of weather.